

MIT/IL SOFTWARE ANOMALY REPORT

MIT REPORT NO. L-1B-06
PROGRAM LUM
PROGRAM REVISION 116

1.1 ORIGINATOR: Garrin	1.2 ORGANIZATION: FSB	1.3 DATE: 10/2/69	1.4 ORIGINATOR CONTROL NO.
----------------------------------	---------------------------------	-----------------------------	----------------------------

1.5 DESCRIPTION OF ANOMALY:

Read below first. In P66 after touchdown with DAP mode in auto (part of checklist) the following alarms occurred twice: FAILREG + 0 = 31202, +1 = 00520, +2 = 00520. A V5N9 and and ERROR RESET followed the first and second occurrences which were separated by more than a minute with no other alarms. We suspect only one 520 alarm caused by the 1202. 1202 cause unknown.

CONTINUED ON PAGE

1.6 DESCRIPTION OF RUN:

LMS descent simulation on 10/1/69. The LR had been failed in position one causing a 523 alarm at P64. The crew did a PRO and continued, landing in P66. The crew voiced a concern that the 523 alarm logic may have been the cause since it was the first time they used it.

CONTINUED ON PAGE

- MIT ANALYSIS -

2.1 CAUSE:

Insufficient data

CONTINUED ON PAGE

2.2 RECOGNITION:

CONTINUED ON PAGE

2.3 MISSION EFFECT:

CONTINUED ON PAGE

2.4 AVOIDANCE PROCEDURE:

CONTINUED ON PAGE

2.5 RECOVERY PROCEDURE:

CONTINUED ON PAGE

2.6 PROGRAM CORRECTION:

CONTINUED ON PAGE

2.7 RECOMMENDED DISPOSITION (Fix, Work-around, etc):

CONTINUED ON PAGE

2.8 RECOMMENDED RE-TESTING:

CONTINUED ON PAGE

2.9 MIT/IL SIGNATURE:	2.10 DATE: 10-31
-----------------------	----------------------------

3.1 NASA DIRECTION:

CONTINUED ON PAGE

4.1 CLOSING ACTION TAKEN:

CONTINUED ON PAGE

3.2 NASA/MSC SIGNATURE:	3.3 ORGANIZATION:	3.4 DATE:	4.2 SIGNATURE:	4.3 ORGANIZATION:	4.4 DATE:
-------------------------	-------------------	-----------	----------------	-------------------	-----------