

MIT/IL SOFTWARE ANOMALY REPORT

MICROREPORT NO. COL 3
 PROGRAM COLOSSUS
 PROGRAM REVISION 237

1.1 ORIGINATOR: N. Brodeur	1.2 ORGANIZATION: MIT/IL	1.3 DATE: 8/27/68	1.4 ORIGINATOR CONTROL NO. C-2	
1.5 DESCRIPTION OF ANOMALY: When V49 is selected to call R62, the operator error light is turned on erroneously. <p style="text-align: center;"><u>Addition to Anomaly Colossus 3</u></p> 2.5 Replace present sentence by... "If R62 progresses normally, disregard operator error light."				
1.6 DESCRIP V49 was selected properly.				
CONTINUED ON PAGE				
- MIT ANALYSIS -				
2.1 CAUSE: Due to a lack of an ENDOFJOB in the setting up of R62, the program continues on into V48 where an alarm condition is detected TESTXACT				
CONTINUED ON PAGE				
2.2 RECOGNITION: Operator error light				
CONTINUED ON PAGE				
2.3 MISSION EFFECT: None, R62 operates as expected				
CONTINUED ON PAGE				
2.4 AVOIDANCE PROCEDURE: None				
CONTINUED ON PAGE				
2.5 RECOVERY PROCEDURE: Disregard operator error light when selecting V49. <i>if R62 progresses normally.</i>				
CONTINUED ON PAGE				
2.6 PROGRAM CORRECTION: Add TC ENDOFJOB after setting up R62 card 0506 in EXTENDED VERB LOG SECTION.				
CONTINUED ON PAGE				
2.7 RECOMMENDED DISPOSITION (Fix, Work-around, etc): Don't fix for C Prime, fix for subsequent.				
CONTINUED ON PAGE				
2.8 RECOMMENDED RE-TESTING: Try V49E				
CONTINUED ON PAGE			2.9 MIT/IL SIGNATURE: <i>[Signature]</i>	
			2.10 DATE: 9/11/68	
3.1 NASA DIRECTION: <i>[Handwritten notes]</i>			4.1 CLOSING ACTION TAKEN: M.I.T. will fix after Rev 237 <i>[Signature]</i>	
CONTINUED ON PAGE			CONTINUED ON PAGE	
3.2 NASA/MSC SIGNATURE:	3.3 ORGANIZATION:	3.4 DATE:	4.2 SIGNATURE:	4.3 ORGANIZATION: