

Configure DAP for 1⁰ Deadband

| | | |
|-------|-------------------------------------|---------|
| V48E | R03 | V01 N46 |
| | | 12021 |
| V21E | | |
| 12011 | ABCDE SET D = 1 (1 ⁰ DB) | V01 N46 |
| | | 12011 |
| V33E | | V06 N47 |
| | | |
| V96E | | P00 |

Verify P99 address

| | | |
|---------|--|---------|
| V5 N26E | | V05 N26 |
| | | 13001 |
| | | 01420 |
| | | 12067 |

Call P99

| | | |
|------|-------------------|---------|
| V30E | | P99 |
| | | V50 N18 |
| V33E | | |
| | MONITOR MANEUVER | V06 N18 |
| | MANEUVER COMPLETE | V50 N18 |
| E | | |

| | | |
|-------------|-----------------------|---------|
| | MONITOR COUNTDOWN | V06 N40 |
| TIG -30 sec | ---- AVE G ON | |
| TIG -0 sec | ---- RCS GUIDANCE | |
| | RCS CUTOFF | V16 N40 |
| V33E | | |
| | | V16 N85 |
| V82E | | |
| | Ha, Hp, TFF to 35K ft | V16 N44 |
| V33E | | |
| | | V16 N85 |
| V33E | | |
| | | V37 |
| 00E | | |
| | | P00 |