Apollo 15 Launch Checklist

Please note that most of the hand-written additions to this document were added during the compilation of the Apollo 15 Flight Journal in 1998 to 2000. To a large extent, they reflect changes read up to the crews during the course of the mission.

David Woods – Editor: Apollo Flight Journal

080-13C

NATIONAL AERONAUTICS AND SPACE ADMINISTRATION

*(JULY 26 LAUNCH) 131 P
*APOLLO 15 ~~120~~
* CSM 112 SINGLE
*CHANGE C

*CSM LAUNCH CHECKLIST

ING DATA

	OPR	#	T	PGM	SIGNATOR	LOC	SUBJECT
7-9-71	MSC	00	R	APO	BENTLEY	080-13C	X1

PREPARED BY

GUIDANCE & CONTROL PROCEDURES SECTION

SYSTEMS PROCEDURES BRANCH

CREW PROCEDURES DIVISION

MANNED SPACECRAFT CENTER

HOUSTON, TEXAS

JULY 9, 1971

APOLLO 15

CSM LAUNCH CHECKLIST

JULY 9, 1971

PREPARED BY: Dennis L. Bentley

DENNIS L. BENTLEY
BOOK MANAGER

APPROVED BY: C. C. Thomas

C. C. THOMAS, CHIEF
GUIDANCE & CONTROL PROCEDURES SECTION
CREW PROCEDURES DIVISION

It is requested that any organization having comments, questions, or suggestions concerning this document contact Dennis L. Bentley, Systems Procedures Branch, CG221, Building 4, room 253, telephone 483-2651.

This document is under the configuration control of the Crew Procedures Control Board (CPCB). All proposed changes should be submitted to the Apollo Flight Data File Manager, T. W. Holloway, CG5, Building 4, room 230, telephone 483-4271.

Distribution of this document is controlled by Flight Data File Manager, T. W. Holloway, Flight Planning Branch, Crew Procedures Division.

CSM LAUNCH CHECKLIST

LIST OF EFFECTIVE PAGES

Basic 3/29/71
Change A 5/5/71
Change B 5/28/71
Change C 7/9/71
Pen & Ink 7/9/71
Change D 7/13/71 (P&I)

PAGE	DATE	PAGE	DATE
*i	7/9/71	*2-12	7/9/71 (P&I)
*ii	7/9/71	*2-13	7/9/71 (P&I)
iii	5/28/71	2-14	5/5/71
1-1	3/29/71	2-15	3/29/71
1-2	3/29/71	*2-16	7/9/71 (P&I)
1-3	5/5/71	2-17	3/29/71
1-4	3/29/71	2-18	5/28/71
1-5	3/29/71	*2-19	7/9/71
1-6	5/5/71	2-20	5/28/71
1-7	3/29/71	2-21	5/28/71
1-8	5/5/71	2-22	5/28/71
1-9	5/5/71	2-23	5/28/71
1-10	3/29/71	2-24	5/28/71
1-11	3/29/71	2-25	5/28/71
1-12	3/29/71	2-26	5/28/71
1-13	3/29/71	*2-27	7/9/71
1-14	5/5/71	*2-28	7/9/71
1-15	5/5/71	2-29	5/28/71
*2-1	7/9/71	2-30	5/28/71
*2-2	7/9/71	2-31	5/28/71
*2-3	7/9/71	*2-32	7/9/71 (P&I)
*2-4	7/9/71	2-33	5/28/71
*2-5	7/9/71	3-1	3/29/71
2-6	5/5/71	3-2	3/29/71
2-7	5/5/71	*3-3	7/9/71 (P&I)
*2-8	7/9/71 (P&I)	*3-4	~~7/9/71 (P&I)~~ 7/13/71 (P&I)
*2-9	7/9/71 (P&I)	3-5	3/29/71
2-10	3/29/71	3-6	~~5/5/71~~ 7/13/71 (P&I)
2-11	5/5/71	3-7	3/29/71

*Current change

LIST OF EFFECTIVE PAGES (CONT)

PAGE	DATE
4-1	3/29/71
4-2	3/29/71
4-3	3/29/71
4-4	5/28/71
4-5	3/29/71
4-6	5/5/71
4-7	5/5/71
4-8	3/29/71
4-9	3/29/71
4-10	3/29/71
4-11	3/29/71
4-12	3/29/71
4-13	3/29/71
4-14	3/29/71
4-15	3/29/71
4-16	3/29/71
5-1	3/29/71
5-2	3/29/71
5-3	3/29/71
5-4	3/29/71
5-5	3/29/71
5-6	3/29/71
5-7	3/29/71
5-8	3/29/71
5-9	3/29/71
5-10	3/29/71
5-11	3/29/71
6-1	3/29/71
6-2	3/29/71
6-3	3/29/71
6-4	3/29/71
6-5	3/29/71
6-6	3/29/71
6-7	3/29/71
6-8	3/29/71
6-9	3/29/71
*6-10	7/9/71(P&I)
7-1	3/29/71
7-2	3/29/71
7-3	3/29/71
7-4	3/29/71
7-5	3/29/71
7-6	3/29/71
7-7	3/29/71
*7-8	7/9/71(P&I)
8-1	3/29/71
8-2	3/29/71
8-3	3/29/71
8-4	3/29/71
8-5	3/29/71
8-6	3/29/71
8-7	3/29/71
8-8	3/29/71
8-9	3/29/71
8-10	3/29/71
*8-11	7/9/71(P&I)
*9-1	7/9/71(P&I)
9-2	3/29/71
*9-3	7/9/71(P&I)
9-4	3/29/71
9-5	3/29/71
EMER/1-1	3/29/71

*Current Change

CONTENTS

DATE 5/28/71

DATE

LIFTOFF CONFIGURATION

PANEL 1

EMS FUNC - ΔV
EMS MODE - STBY
GTA - off (down)
EMS GTA COVER - Secure
CMC ATT - IMU
FDAI SCALE - 5/5
FDAI SEL - 1/2
FDAI SOURCE - CMC
ATT SET - GDC
MAN ATT ROLL - RATE CMD
MAN ATT PITCH - ACCEL CMD
MAN ATT YAW - RATE CMD
LIM CYCLE - OFF
ATT DBD - MIN
RATE - HIGH
TRANS CONTR PWR - on (up)
RHC PWR NORM (2) - AC/DC
RHC PWR DIR (2) - MNA/MNB
SC CONT - SCS
CMC MODE - FREE
BMAG MODE ROLL - RATE 1
BMAG MODE PITCH - RATE 1
BMAG MODE YAW - RATE 1
SPS THRUST - NORMAL (lock)
ΔV THRUST (2) - OFF (guarded)
SCS TVC PITCH - AUTO
SCS TVC YAW - AUTO
SPS GMBL MOT PITCH (2) - OFF
SPS GMBL MOT YAW (2) - OFF
ΔV CG - LM/CSM
ELS LOGIC - OFF (guarded)
ELS AUTO - MAN
CM RCS LOGIC - on (up)
CM PRPLNT DUMP - OFF (guarded)
CM PRPLNT PURG - off (down) (guarded)
IMU CAGE - off (down) (guarded)
EMS ROLL - OFF
.05G sw - OFF

DATE 3/29/71

LIFTOFF CONFIG

LIFTOFF CONFIG

α/Pc IND sw - α
LV/SPS IND SII/SIVB - SII/SIVB
TVC GMBL DR PITCH - AUTO
TVC GMBL DR YAW - AUTO
EVNT TMR RSET - up (center)
EVNT TMR STRT - center
EVNT TMR MIN - center
EVNT TMR SEC - center

PANEL 2

PL VENT vlv - push (lock)
PROBE EXTD/REL - OFF (guarded)
PROBE EXTD/RETR (2) tb - gray
DOCK PROBE RETR PRIM - OFF
DOCK PROBE RETR SEC - OFF
EXT RUN/EVA LT - OFF
EXT RNDZ LT - off (center)
TUNL LT - OFF
LM PWR - OFF
SM RCS He 1 (4) - center (on,up*)
SM RCS He 1 tb(4) - gray
UP TLM CM - BLOCK
UP TLM IU - BLOCK
CM RCS PRESS - off (down) (guarded)
SM RCS IND sw - PRPLNT QTY
SM RCS He 2 (4) - center (on,up*)
SM RCS He 2 (4) tb - gray
SM RCS HTRS (4) - OFF
SM RCS PRPLNT (4) - center (on, up*)
SM RCS PRPLNT tb (8) - gray
RCS CMD - center (OFF*)
RCS TRNFR - center (SM*)
CM RCS PRPLNT (2) - center (on,up*)
CM RCS PRPLNT tb (2) - gray
SM RCS SEC FUEL PRESS (4) - Center (CLOSE*)
EDS AUTO - on (up)
CSM/LM FINAL SEP (2) - off (down) (guarded)
CM/SM SEP (2) - off (down) (guarded)
SIVB/LM SEP - off(down)(guarded)
PRPLNT DUMP - AUTO
2 ENG OUT - AUTO
LV RATES - AUTO

DATE 3/29/71

TWR JETT (2) - AUTO (down) (guarded)
LV GUID - IU
LV STAGE - off(down)(guarded)
XLUNAR - INJECT
MN REL - off(down)(guarded)
MSN TMR HR, MIN, SEC - off (center)
C/W NORM - BOOST
C/W CSM - CSM
C/W PWR - 1
C/W LAMP TEST - off (center)
MSN TMR - START
RCS IND sel - SM D
CAB FANS - OFF
CRYO PRESS IND - SRG/3
CRYO QTY IND - 2
H2 HTRS (2) - AUTO
O2 HTRS 1&2 - AUTO
O2 HTR 3 - OFF
H2 FANS 1&2 - OFF
H2 FAN 3 - ON
ECS IND sel - PRIM
ECS RAD FLOW AUTO CONT - AUTO
ECS RAD tb - gray
ECS RAD FLOW PWR CONT - off (center)
ECS RAD MAN SEL - RAD 1
ECS RAD PRIM HTR - off (center)
ECS RAD SEC HTR - OFF
POT H2O HTR - OFF
SUIT CKT H2O ACCUM AUTO - 1
SUIT CKT H2O ACCUM ON - off (center)
SUIT CKT HT EXCH - off (center)
SEC COOL LOOP EVAP - off (center)
SEC COOL LOOP PUMP - off (center)
H2O QTY IND sw - POT
GLY EVAP IN TEMP - MAN
GLY EVAP STM PRESS AUTO - MAN
GLY EVAP STM PRESS INCR - center
GLY EVAP H2O FLOW - off (center)
CAB TEMP - MAN
CAB AUTO TEMP tw - max decr
HI GAIN ANT TRACK - AUTO
HI GAIN ANT BEAM - WIDE
HI GAIN ANT PITCH POS - 0°

DATE 5/5/71

DATE

HI GAIN ANT YAW POS - 180°
HI GAIN ANT PWR - OFF
HI GAIN ANT SERVO ELECT - PRIM

PANEL 3

VHF ANT - SM LEFT
SPS ENG INJ VLV ind (4) - CLOSE
FC RAD (3) - center (NORMAL*)
FC RAD (3) tb - gray
FC HTRS (3) - on (up)
FC IND sel - 2
SPS QTY TEST - off (center)
OXID FLOW VLV INCR - NORM
OXID FLOW VLV PRIM - PRIM
PUG MODE - NORM
FC PURG (3) - OFF
FC REAC (3) - center (on,up*)
FC REAC tb (3) - gray
FC 1 MN BUS A - center (on,up*)
FC 1 MN BUS A tb - gray
FC 2 MN BUS A - center (on,up*)
FC 2 MN BUS A tb - gray
FC 3 MN BUS A - OFF
FC 3 MN BUS A tb - bp
MN BUS A RSET - center (RESET*)
FC 1 MN BUS B - OFF
FC 1 MN BUS B tb - bp
FC 2 MN BUS B - OFF
FC 2 MN BUS B tb - bp
FC 3 MN BUS B - center (on,up*)
FC 3 MN BUS B tb - gray
MN BUS B RSET - center (RESET*)
DC IND sel - MNA
BAT CHARGE - OFF
SPS He vlv (2) - AUTO
SPS He vlv tb (2) - bp
SPS LINE HTRS - off (center)
SPS PRESS IND sw - He
S BD XPNDR - PRIM
S BD PWR AMPL PRIM - PRIM
S BD PWR AMPL HI - HIGH
PWR AMPL tb - gray

DATE _____

DATE 3/29/71

S BD MODE VOICE - VOICE
S BD MODE PCM - PCM
S BD MODE RNG - RNG
S BD AUX TAPE - off (center)
S BD AUX TV - off (center)
UP TLM DATA - DATA
UP TLM CMD - NORM
S BD ANT OMNI - B
S BD ANT - OMNI
VHF AM A - (center)
VHF AM B - DUPLEX
VHF AM RCV - off (center)
VHF AM SQLCH tw (2) - noise threshold + 1 div
VHF BCN - OFF
VHF RNG - OFF
S BD SQUELCH - ENABLE
FC REACS v1v - LATCH
H2 PURG LINE HTR - OFF
TAPE RCDR PCM - PCM/ANLG
TAPE RCDR RCD - RCD
TAPE RCDR FWD - FWD
TAPE MOTION tb - gray
SCE PWR - NORM
PMP PWR - NORM
PCM BIT RATE - HI
AC INV 1 - MNA
AC INV 2 - MNB
AC INV 3 - OFF
INV 1 AC 1 - on (up)
INV 2 AC 1 - OFF
INV 3 AC 1 - OFF
AC 1 RSET - center (RSET*)
INV 1 AC 2 - OFF
INV 2 AC 2 - on (up)
INV 3 AC 2 - OFF
AC BUS 2 RSET - center (RSET*)
AC IND sel - BUS 2ØC

PANEL 4

SPS GAUGING - AC1
TELCOM GRP 1 - AC1
TELCOM GRP 2 - AC2
GLY PUMPS - 1 - AC1

DATE 3/29/71

DATE

SUIT COMPR 1 - AC1
SUIT COMPR 2 - OFF
cb Panel 4 - all closed

PANEL 5

FC1 PUMPS - AC1
FC2 PUMPS - AC2
FC3 PUMPS - AC2
G/N PWR - AC1
MN BUS TIE (2) - on (up)
BAT CHGR - AC1
NONESS BUS - MNA
INT INTGL LT - as desired
INT FLOOD LT - OFF, full dim or full bright
INT FLOOD LT DIM - 1
INT FLOOD LT FIXED - OFF
cb Panel 5 all closed except:
  cb INST NONESS - open
  cb ECS XDUCR PRESS GRP 2 MNA - open
  cb WASTE H2O/UR DUMP HTR (2) - open

PANEL 6

MODE - INTERCOM/PTT
PWR - AUDIO/TONE
PAD COMM - OFF
INTERCOM - T/R
S BD - T/R
VHF AM - T/R
AUDIO CONT - NORM
SUIT PWR - on (up)
tw settings - as desired

DATE _____

DATE 5/5/71

PANEL 7

EDS PWR - on (up)
SCS TVC SERVO PWR #1 - AC1/MNA
SCS TVC SERVO PWR #2 - AC2/MNB
FDAI/GPI PWR - BOTH
LOGIC 2/3 PWR - on (up)

SCS ELEC PWR - GDC/ECA
SCS SIG CONDR/DR BIAS 1 - AC1
SCS SIG CONDR/DR BIAS 2 - AC2
BMAG PWR (2) - ON
DIRECT O2 v1v - open (CCW) (>2 in H20 on SUIT/CAB ΔP ind)
(O2 flow - 0.6-0.8 lb/hr)

PANEL 8

cb Panel 8 - all closed except:
cb CM RCS HTRS (2) - open
cb FLOAT BAG (3) - open
AUTO RCS SEL A/C ROLL A1 - OFF
AUTO RCS SEL A/C ROLL C1 - OFF
AUTO RCS SEL A/C ROLL A2 - OFF
AUTO RCS SEL A/C ROLL C2 - OFF
AUTO RCS SEL B/D ROLL B1 - MNA
AUTO RCS SEL B/D ROLL D1 - MNB
AUTO RCS SEL B/D ROLL B2 - MNA
AUTO RCS SEL B/D ROLL D2 - MNB
AUTO RCS SEL PITCH A3 - MNB
AUTO RCS SEL PITCH C3 - MNA
AUTO RCS SEL PITCH A4 - MNA
AUTO RCS SEL PITCH C4 - MNB
AUTO RCS SEL YAW B3 - MNA
AUTO RCS SEL YAW D3 - MNB
AUTO RCS SEL YAW B4 - MNB
AUTO RCS SEL YAW D4 - MNA
INT NUM LT - as desired
INT INTGL LT - as desired
INT FLOOD LT - OFF, full dim, or full brt
FLOOD LTS DIM - 1
FLOOD LTS FIXED - OFF
FLOAT BAG (3) - VENT (locked)
SECS LOGIC (2) - on (up) (locked)
SECS PYRO ARM (2) - on (up) (locked)

PANEL 9

MODE - INTERCOM/PTT
PWR - AUDIO/TONE
PAD COMM - OFF
INTERCOM - T/R
S BD - T/R
VHF AM - T/R

DATE 3/29/71

DATE

AUDIO CONT - NORM
SUIT PWR - on (up)
VHF RNG - NORM
tw settings - as desired

PANEL 10

MODE - INTERCOM/PTT
PWR - AUDIO/TONE
PAD COMM - OFF
INTERCOM - T/R
S BD - T/R
VHF AM - T/R
AUDIO CONT - NORM
SUIT PWR - on (up)
tw settings - as desired

PANEL 12

LM TUNL VENT vlv - LM/CM ΔP

PANEL 13

FDAI sw (2) - INRTL
EARTH/LUNAR - PWR OFF
ALT SET - 90
LTG - OFF
MODE - HOLD/FAST
SLEW - off (center)

PANEL 15

COAS PWR - OFF
UTIL PWR - OFF
PL BCN LT - off (center)
PL DYE MARKER - off (down)(guarded)
PL VENT - OFF

PANEL 16

DOCK TRGT - OFF
UTIL PWR - OFF
COAS PWR - OFF

DATE 5/5/71

DATE 5/5/71

PANEL 100

UTIL PWR - OFF
FLOOD LTS DIM - 1
FLOOD LTS FIXED - OFF
OPT PWR - OFF
IMU PWR - on (up) (guarded)
RNDZ XPNDR - OFF
NUMERICS LT - as desired
FLOOD LTS - off, full dim, or full bright
INTGL LT - as desired

PANEL 101

SYS TEST (LH) - 5
SYS TEST (RH) - B
CM RCS HTRS - OFF
WASTE H2O DUMP - HTR A
UR DUMP - HTR A
RNDZ XPNDR - OPR

PANEL 122

OPT ZERO - ZERO
OPT TELTRUN - SLAVE TO SXT
OPT COUPLING - DIRECT
OPT MODE - MAN
OPT SPEED - LO
COND LAMPS - ON
UP TLM - ACCEPT

DATE 5/5/71

PANEL 162

SCI PWR - OFF (verified at panel closeout)

DATE

PANEL 163

SCI/UTIL PWR - OFF (verified at panel closeout)

PANEL 181

cb Panel 181 - all closed except:
  cb LOGIC PWR (2) - open
CRYO 3 AC PWR - on (up)
SM/AC PWR - on (up)
DOOR JETT - off (down) (guarded)
LOGIC PWR (2) - OFF (ctr)

PANEL 225

cb Panel 225 - all closed except:
  cb HI GAIN ANT FLT BUS - open
  cb HI GAIN ANT GRP 2 - open

PANEL 226

cb Panel 226 - all closed except:
  cb COAS/TUNL LTG MNB - open

PANEL 227

SCI PWR - OFF

PANEL 229

cb Panel 229 all closed except:
  cb MAIN REL PYRO (2)- open
  cb 02 VAC ION PUMPS (2) - open

PANEL 230

MAP CAMR ON - STBY
MAP CAMR ON tb - gray
MAP CAMR TRACK - OFF
MAP CAMR TRACK tb - gray
GAMMA RAY BOOM DPLY - off (ctr)
GAMMA RAY BOOM DPLY tb - gray
GAMMA RAY BOOM JETT - off (down)
GAMMA RAY BOOM JETT tb - gray
MASS SPECT BOOM DPLY - off (ctr)
MASS SPECT BOOM DPLY tb - gray
MASS SPECT BOOM JETT - off (down)
MASS SPECT BOOM JETT tb - gray
MAP CAMR IMAGE MTN - OFF
LASER ALTM - OFF
GAMMA RAY EXP - OFF
MASS SPECT EXP - OFF
MASS SPECT ION SOURCE - OFF
DATA SYS ON - OFF
DATA SYS CAL - off (down)
GAMMA RAY GAIN - ctr
MASS SPECT MULT - LO
MASS SPECT DSCRM - HI

DATE _____

DATE 3/29/71

PAN CAMR SELF TEST - off (ctr)
PAN CAMR STEREO - STEREO
α RAY/X DR - α OFF
SUB SAT - off (ctr)
SUB SAT tb - gray
PAN CAMR MODE - STBY
PAN CAMR OPR tb - gray
PAN CAMR PWR - BOOST
PAN CAMR EXPOSURE - OFF
X RAY - OFF

PANEL 250

cb Panel 250 - all closed except:
  cb PYRO A TIE TO BAT BUS A - open
  cb PYRO B TIE TO BAT BUS B - open
  cb BAT C TO BAT BUS A - open
  cb BAT C TO BAT BUS B - open

PANEL 251

WASTE MGMT OVBD DRAIN vlv - OFF

PANEL 252

BAT VENT vlv - CLOSED
WASTE STOWAGE VENT vlv - VENT

PANEL 275

cb Panel 275 - all closed except:
  cb MNA BAT C - open
  cb MNB BAT C - open
  cb FLT/PL BAT BUS A - open
  cb FLT/PL BAT BUS B - open
  cb FLT/PL BAT C - open

PANEL 276

cb Panel 276 - all closed

DATE 3/29/71

DATE

PANEL 278

cb Panel 278 - all closed except:
  cb UPRT SYS COMPR (2) - open
MAP CAMR/LASER EXP COVERS - ctr
MAP CAMR/LASER EXP COVERS tb - gray
ALPHA/X-RAY EXP COVERS - ctr
ALPHA/X-RAY EXP COVERS tb - gray
SM PWR SOURCE - FC2 (guarded)
O2 TK 3 ISOL vlv - off (ctr)(OPEN*)
O2 TK 3 ISOL vlv tb - gray

PANEL 300

RH SUIT FLOW vlv - FULL FLOW

PANEL 301

LH SUIT FLOW vlv - FULL FLOW

PANEL 302

CTR SUIT FLOW vlv - FULL FLOW

PANEL 303

PRIM CAB TEMP vlv - COLD (CW)
SEC CAB TEMP vlv - COOL-MAX (CW)

PANEL 304

DRNK H2O SUPPLY vlv - OFF (CW)

PANEL 305

FOOD PREP COLD H2O vlv - rel
FOOD PREP HOT H2O vlv - rel

DATE 3/29/71

DATE

PANEL 306

MSN TMR - START
EVNT TMR RSET - UP (center)
EVNT TMR STRT - center
EVNT TMR MIN - center
EVNT TMR SEC - center
MSN TMR HR - center
MSN TMR MIN - center
MSN TMR SEC - center

PANEL 325

CAB PRESS RELF vlv (RH) - BOOST/ENTRY
CAB PRESS RELF vlv (LH) - BOOST/ENTRY
PRIM GLY TO RAD vlv - BYPASS (pull)

PANEL 326

REPRESS PKG vlv - ON
SM 02 SUPPLY vlv - ON
SURGE TK 02 vlv - ON
GLY RSVR IN vlv - OPEN
GLY RSVR BYPASS vlv - CLOSE
GLY RSVR OUT vlv - OPEN

PANEL 350

CO2 CSTR DIVERT vlv - both (center)

PANEL 351

MAIN REG vlv (2) - open
H2O/GLY TK PRESS REG vlv - BOTH
H2O/GLY TK PRESS RELF vlv - BOTH
EMER CAB PRESS vlv - OFF
CAB REPRESS vlv - OFF (CCW)

DATE 3/29/71

DATE

PANEL 352

WASTE TK SERVICING vlv - CLOSE
PRESS RELF vlv - RELF
POT TK IN vlv - OPEN
WASTE TK IN vlv - AUTO

PANEL 375

SURGE TK PRESS RELF vlv - open (CW)

PANEL 376

PLVC - NORMAL (up)

PANEL 377

GLY TO RAD SEC vlv - BYPASS (CCW)

PANEL 378

PRIM GLY ACCUM vlv - open (CCW)

PANEL 379

PRIM ACCUM FILL vlv - OFF (CW)

PANEL 380

O2 DEMAND REG vlv - BOTH
SUIT TEST vlv - OFF
SUIT CKT RET vlv - close (push)

PANEL 382

SUIT HT EXCH PRIM GLY vlv - FLOW (CCW)
SUIT FLOW RELF vlv - OFF
PRIM GLY EVAP IN TEMP vlv - MIN (CCW)
SUIT HT EXCH SEC GLY vlv - FLOW (CCW)
SEC EVAP H2O CONT vlv - AUTO (CW)
PRIM EVAP H2O CONT vlv - AUTO (CW)
H2O ACCUM vlv (2) - RMTE (CCW)

DATE 5/5/71

PANEL 600

EMER O2 vlv - CLOSE

PANEL 601

REPRESS O2 vlv - CLOSE

PANEL 602

REPRESS O2 RELF vlv - OPEN (CW)

PANEL 603

EVA STA O2 SUP - OFF

PANEL 604

SUIT PRESS ALARM - OFF

FWD HATCH

PRESS EQUAL vlv - CLOSE
ACTR HNDL sel - stow/check locked

SIDE HATCH

CAB PRESS DUMP vlv - close (CW)
GEAR BOX sel - LATCH
ACTR HANDLE sel - UNLATCH
LOCK PIN REL KNOB - LOCK
LOCK PIN ind - flush
GN2 VLV HANDLE - outboard
BPC JETT KNOB - toward BPC JETT

* - last momentary position before liftoff.

DATE 5/5/71

DATE

BOOST PREPARATION

-20:00 Change X STABLE MEMBER AZIMUTH, if necessary:

*V78E *
F 06 29 X SM AZ (.01°)
*V21E *
*Load new Azimuth_____ *
*PRO *
*ALIGN GDC *

AUTO RCS A/C ROLL (4) - OFF (verify)
AUTO RCS B/D ROLL B1 & B2 - MNA
AUTO RCS B/D ROLL D1 & D2 - MNB
AUTO RCS PITCH A3 & C4 - MNB
AUTO RCS PITCH C3 & A4 - MNA
AUTO RCS YAW B3 & D4 - MNA
AUTO RCS YAW D3 & B4 - MNB

-15:00 CTE UPDATE VERIFICATION
DC IND sel - BAT C
DC VOLTS ind - 37-37.5 vdc
DC IND sel - MNA
FDAI-1 total att R=90+AZ, P=90, Y=0
FDAI SCALE - 5/5
RATE - HIGH
TRANS CONTR PWR -on(up) (verify)
RHC PWR DIRECT(2)-MNA/MNB
CMC MODE - FREE
BMAG MODE (3) - RATE 1
RHC #2 - ARMED

ASTRO LAUNCH OPERATIONS VOICE CHECK
LMP S BD sw - OFF
CDR VHF AM sw - OFF

VOICE CHECK WITH MCCH
LMP S BD sw - T/R
CDR VHF AM sw - T/R
SPS THRUST - NORMAL (locked)
ΔV THRUST (2) - OFF
α/PC IND sw - α

DATE 7/9/71

BOOST PREPARATION

BOOST PREPARATION

EDS AUTO - on (up)
2 ENG OUT - AUTO
LV RATES - AUTO
RCS CMD - OFF
TVC SERVO PWR #1 - AC1/MNA
TVC SERVO PWR #2 - AC2/MNB

-10:00 FC REAC vlv - LATCH

-08:30 SEC COOL LOOP PUMP - off (ctr) (verify)

-04:10 L/V ENGINE lts (5) - on

-04:00 ASTRO LAUNCH OPERATIONS COMM CHECK

DSKY - Verify P02
V75 (Do not ENTR)
TAPE RCD FWD - FWD (tb-gray)

-2:15 PRIM GLY TO RAD - pull (bypass)

-1:15 MN BUS TIE (2) - on (up)
-1:00 PAD COMM (2) - OFF
VHF AM VOL tw - increase to above normal listening level

-00:45 GDC ALIGN pb - PUSH & HOLD
R=90+AZ, P=90, Y=0
FDAI 2 Total att - no motion
GDC ALIGN pb - release

L
2-3

SATURN BOOST

7/1/71
JULY 26&27

	DET	θ	VI	Ḣ	H
	00:00	90	1341	0	.0
	:30	86	1396	314	.7
	1	68	1892	857	3.5
	1:30	48	3123	1542	9.4
	2	34	5226	2321	18.9
a	2:16	29	6763	2794	25.5
	2:30	26	8073	3095	32.4
b	2:39	24	9014	3307	37.0
	3	24	9222	2904	47.8
	3:30	19	9763	2437	61.0
	4	17	10424	1958	71.8
	4:30	16	11191	1517	80.4
	5	14	12063	1115	86.9
	5:30	12	13041	757	91.5
	6	9	14133	448	94.4
	6:30	7	15351	193	96.0
	7	5	16713	5	96.4
	7:30	2	18244	-102	96.2
	8	5	19709	-117	95.5
	8:30	359	21016	-98	95.0
	9	356	22439	-32	94.7
c	9:10	356	22918	10	94.7
	9:30	353	23178	-56	94.6
	10	350	23703	-108	93.1
	10:30	348	24252	-125	93.5
	11	346	24824	-101	93.0
	11:30	345	25420	-33	92.6
d	11:39	345	25599	-1	92.6

DATE 7/9/71

[a]Timebase 2 (S-IC Center-engine cutoff + .01 sec)
[b]Timebase 3 (S-IC outboard-engine cutoff + .01 sec)
[c]Timebase 4 (S-II outboard-engine cutoff + .01 sec)
[d]Timebase 5 (S-IVB guidance cutoff signal + .21 sec)

LAUNCH TRAJECTORY

LAUNCH ABORT

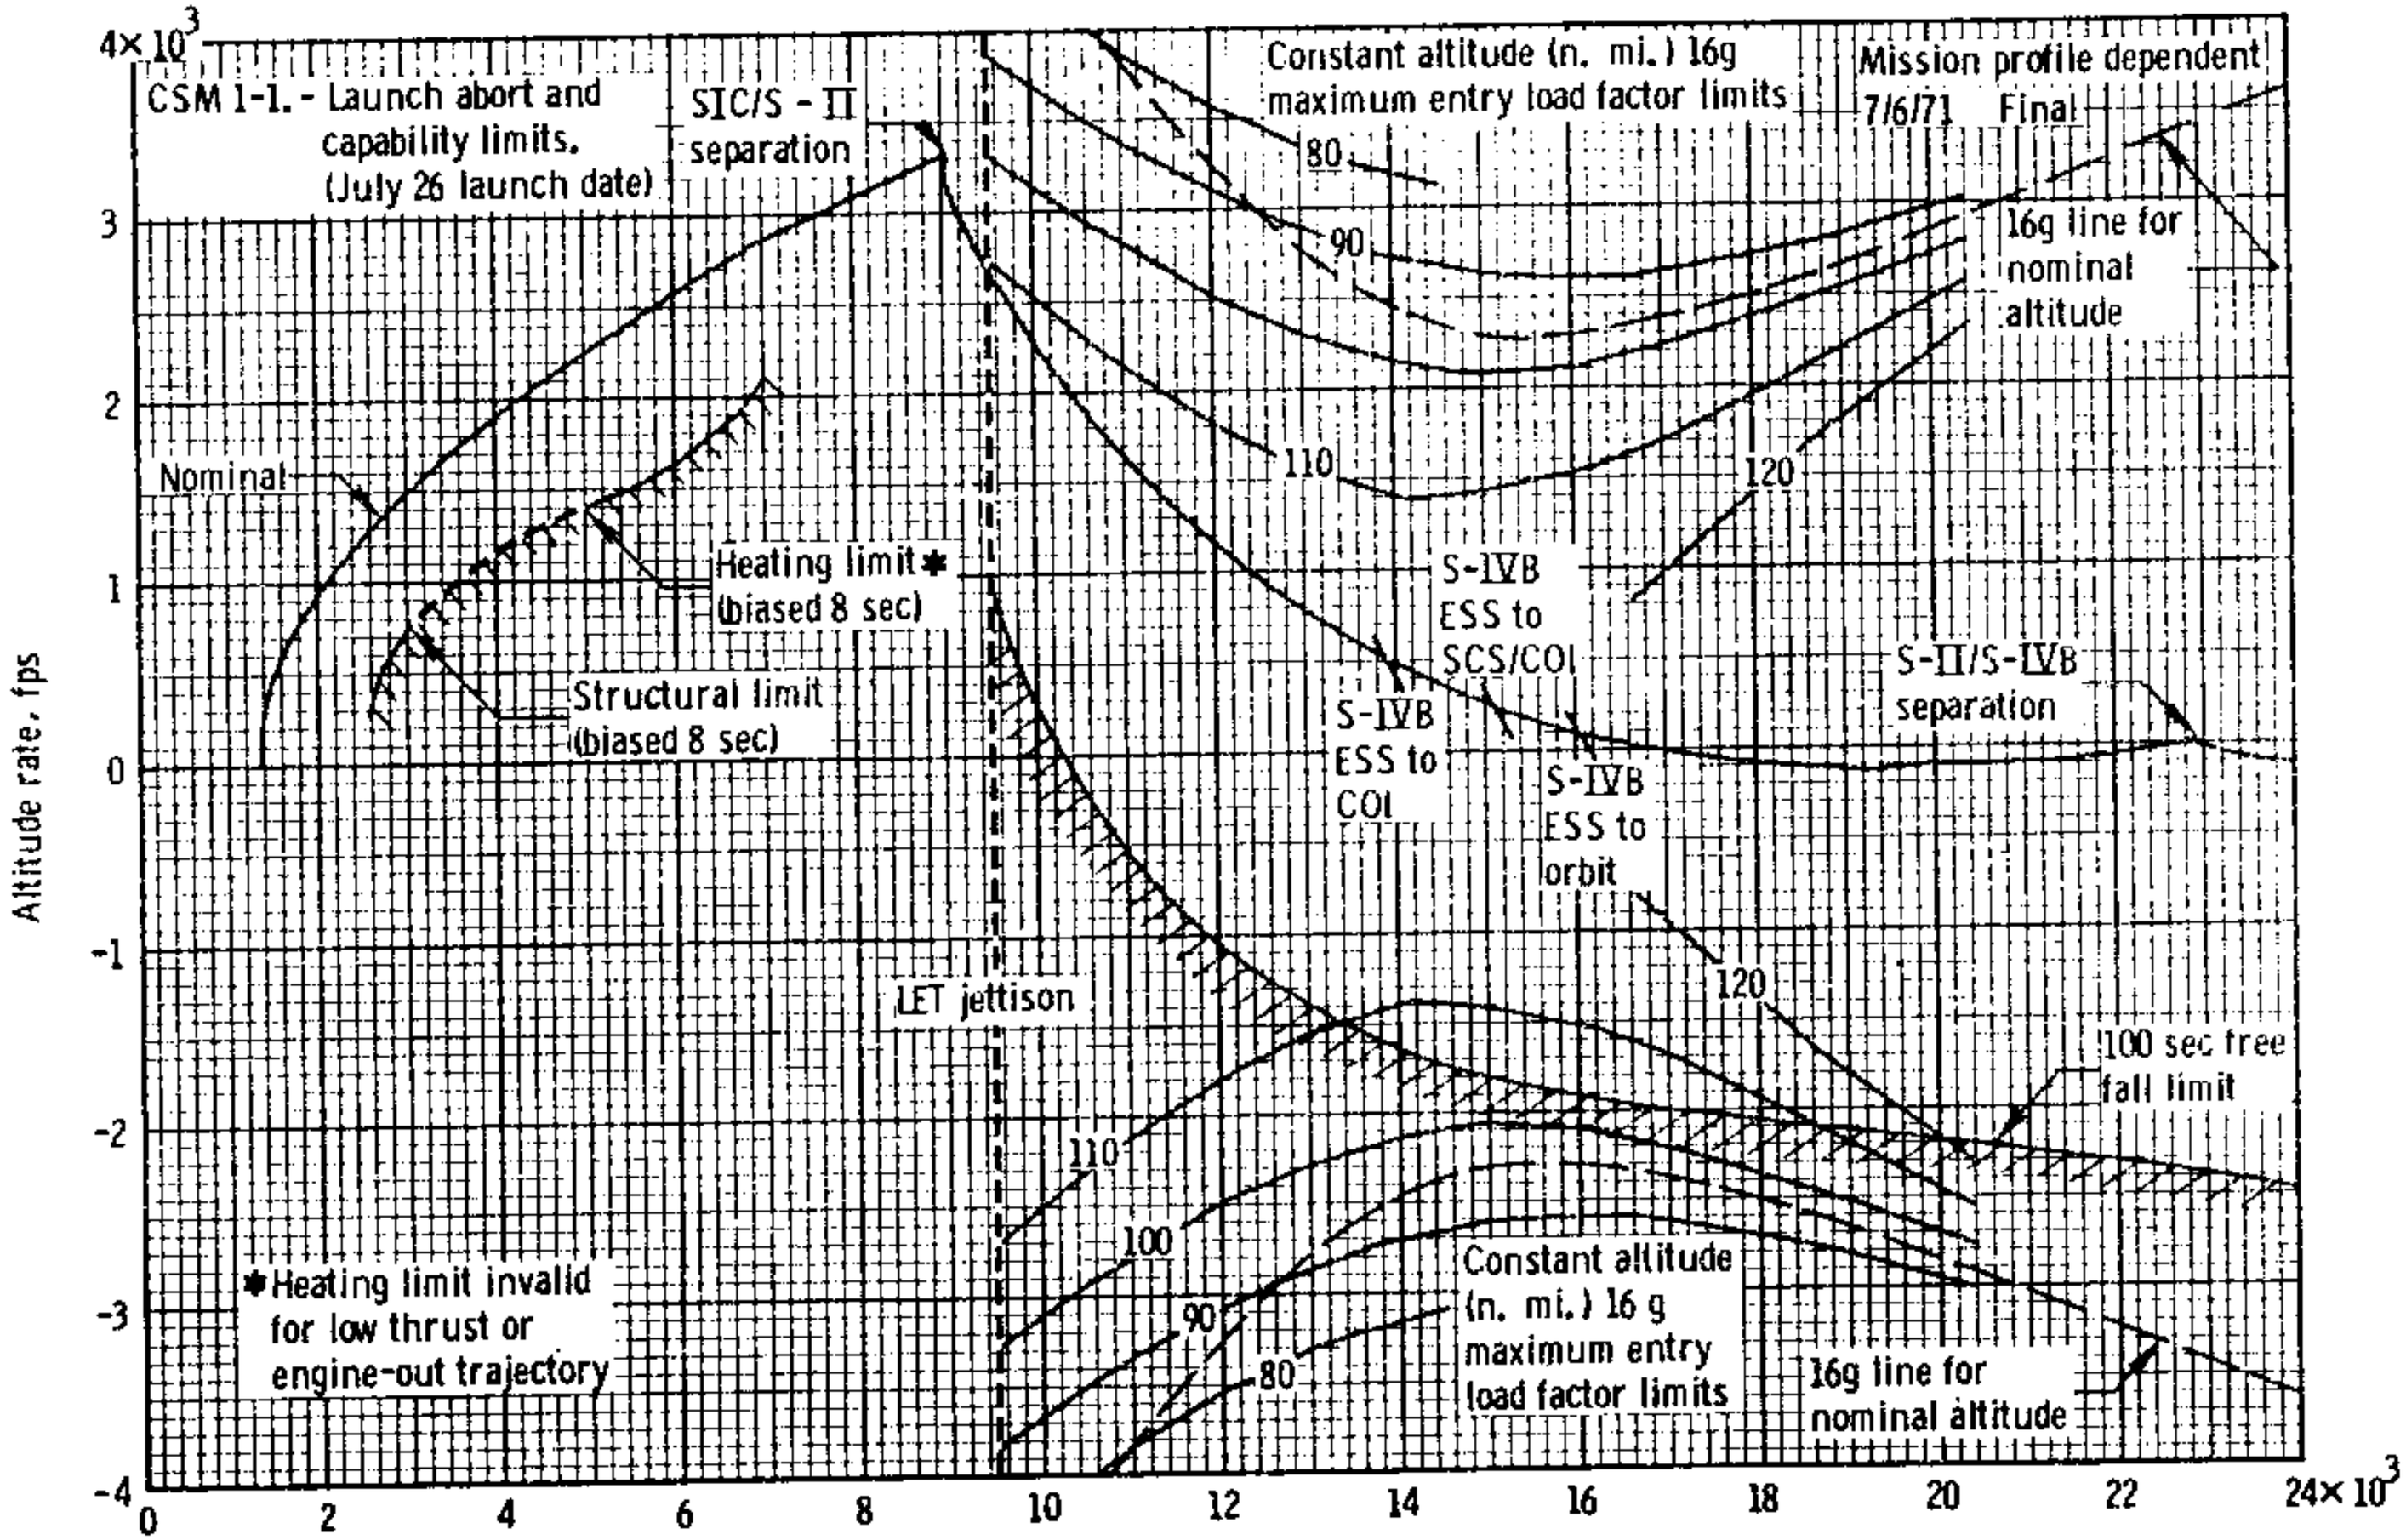

Launch abort and capability limits.

DATE 7/9/71

DATE 7/9/71

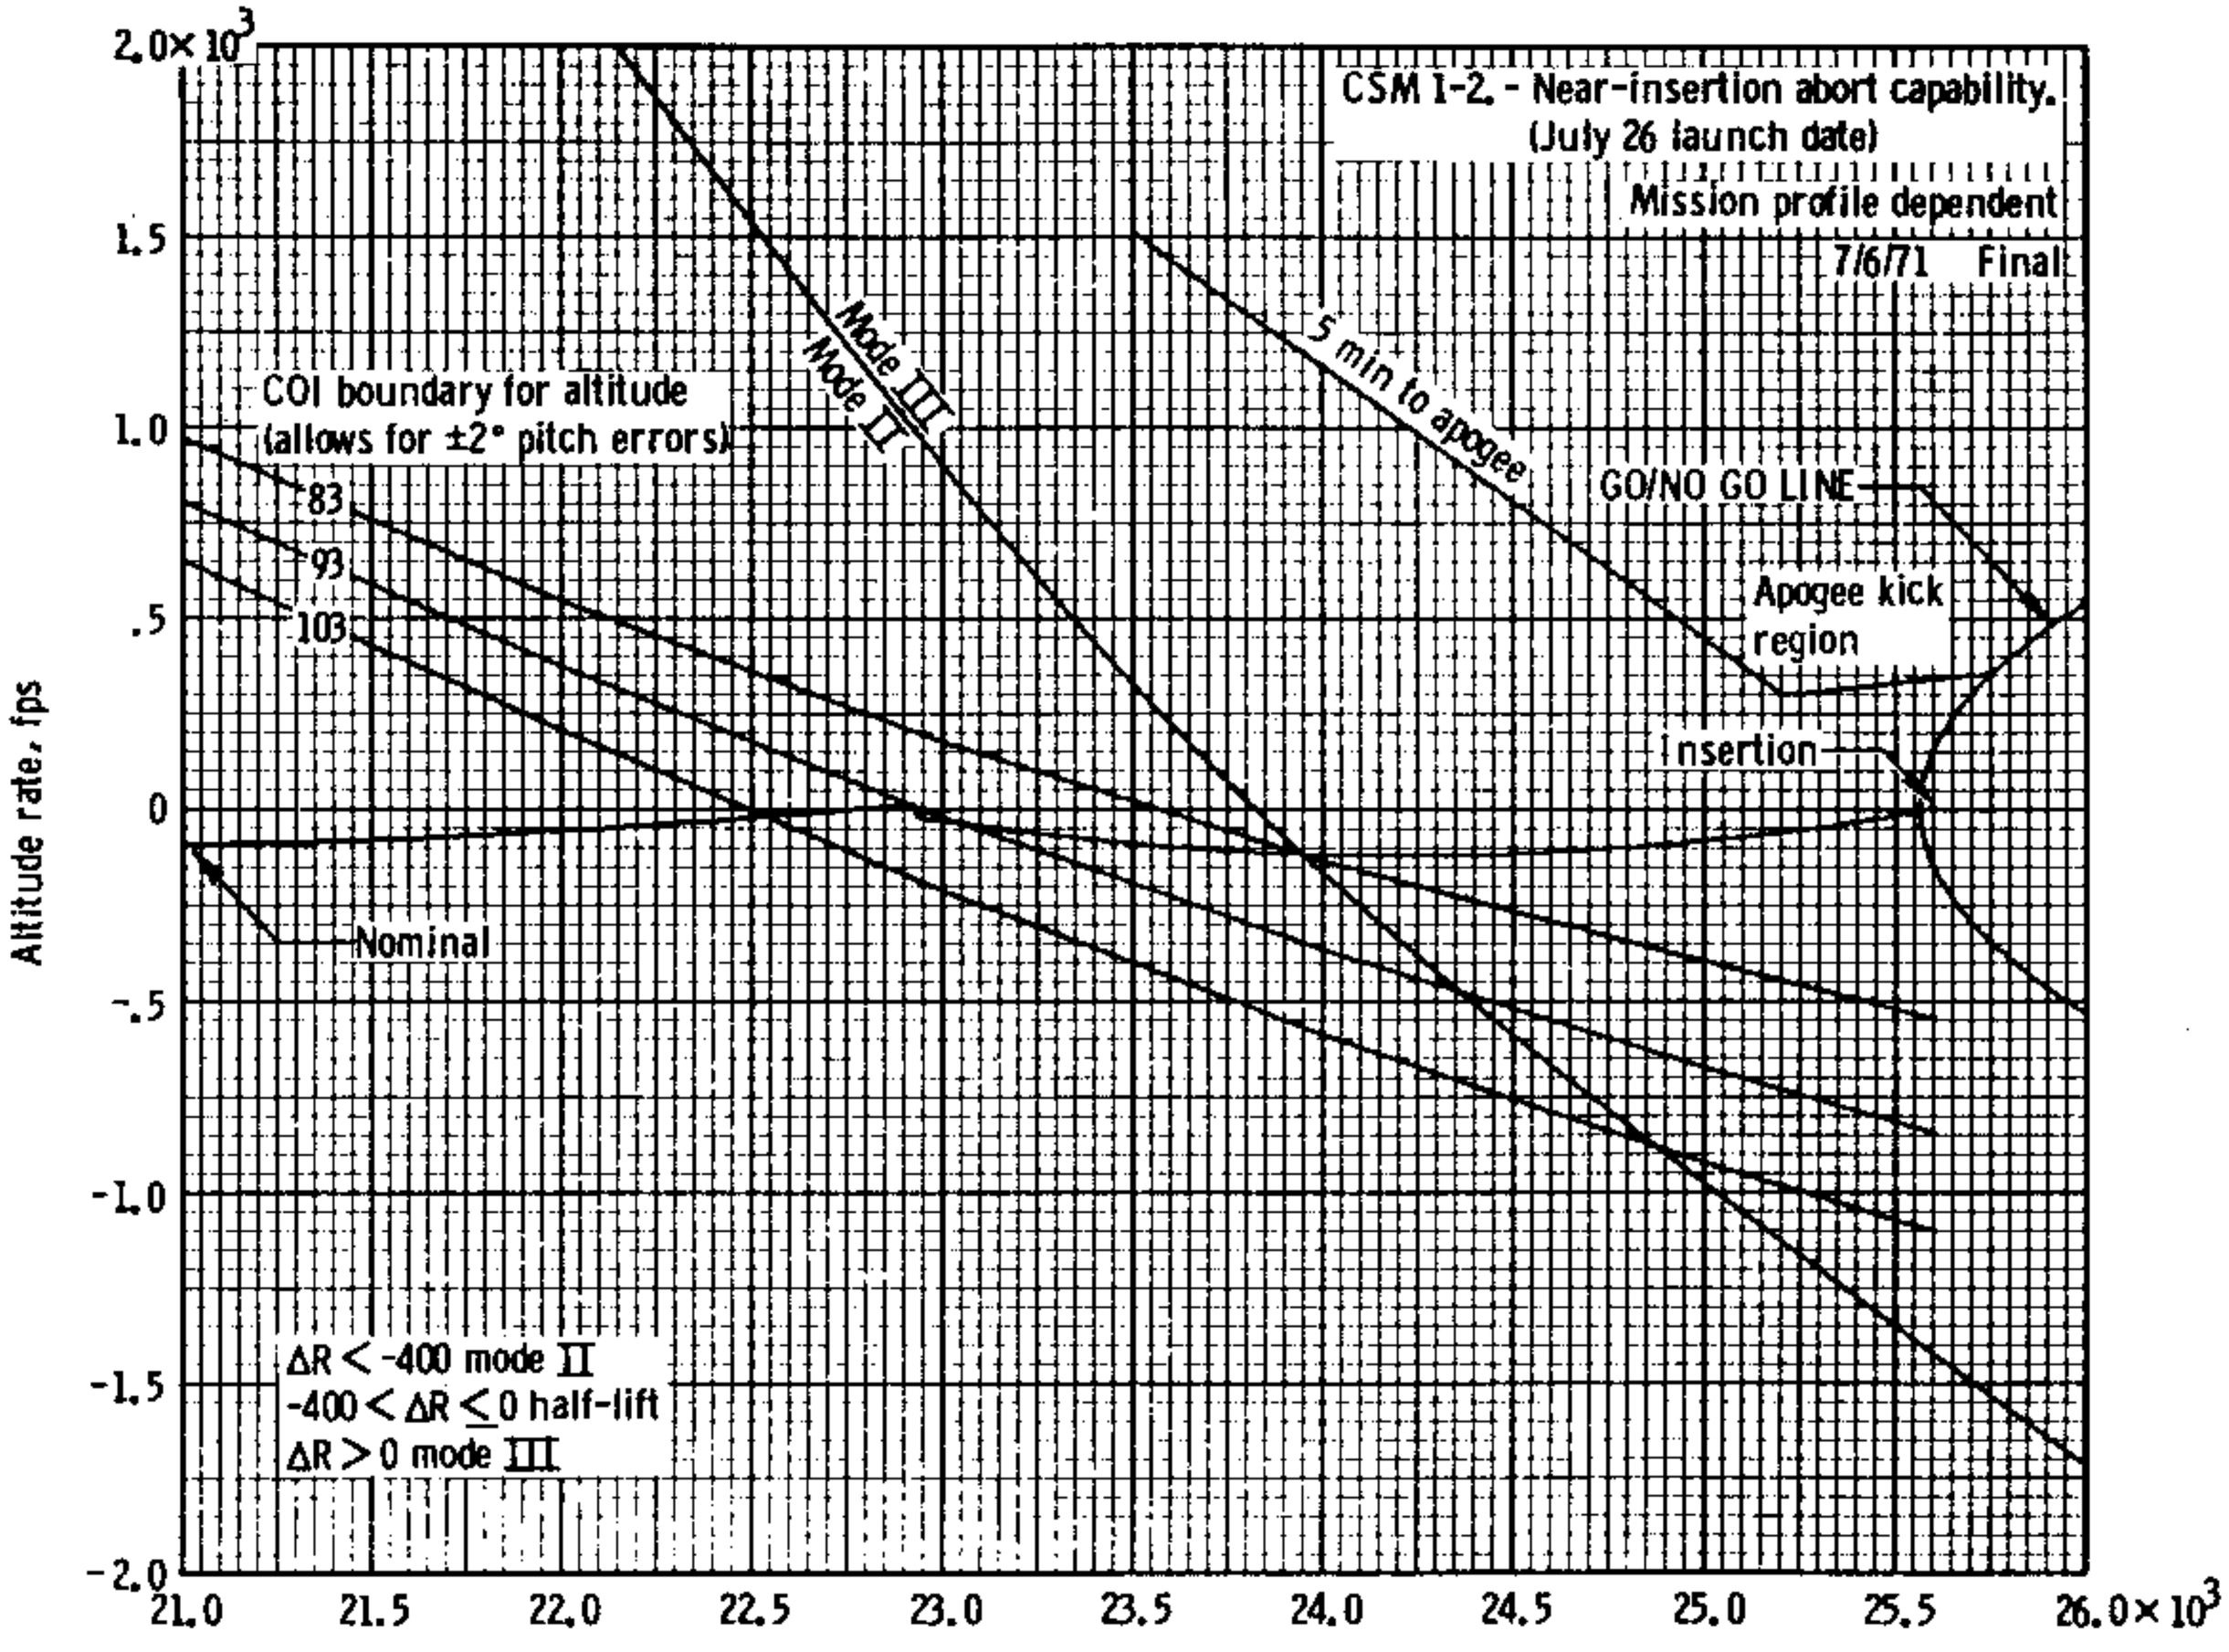

Near-insertion abort capability.

NEAR INSERTION ABORT

CSM 1-4.- Recommended manual EOI shutdown velocities.

Mission independent
4/15/71 Final

SHUTDOWN ALTITUDE, h (N. MI.)	INERTIAL VELOCITY, Vi (fps)	ha/hp (N. MI.)
150	25291	150/90
145	25318	145/90
140	25344	140/90
135	25371	135/90
130	25398	130/90
125	25424	125/90
120	25451	120/90
115	25478	115/90
110	25505	110/90
105	25532	105/90
100	25559	100/90
95	25586	95/90
90	25613	90/90
85	25641	90/85
80	25668	90/80
75	25695	90/75
70	25723	90/70

NOTE: Insertion altitude defines cutoff velocity assuming $\dot{h}$ = 0 and results in h = 90 n mi (h_a or h_p) 1/2 rev. later, example: If h = 75, V_i @ cutoff = 25,695 results in a 75/90 orbit.

DATE 5/5/71

ALTITUDE vs Vi

BOOST

-00:09 Ignition CMD
-00:01 L/V ENGINES lts (5) - out
00:00 LIFTOFF lt - on

*LIFTOFF VERIFIED: *
* If LIFTOFF lt off - push *
* If NO AUTO ABORT lt on - push*

Clock Running (auto) - report
MET Resets & starts counting up auto
P11 auto

*NO P11 - Key ENTR *
START DET & RESET MET

06 62 VI,H DOT, H PAD (fps,fps,.1nm)
If LV GUID & LV RATE lts-on
* LV GUID - CMC *
+00:02 Yaw Mnvr - report
+00:11 Roll & Pitch Program - report
+00:30 Roll complete - report

+00:42 MODE IB - report
PRPLNT DUMP - RCS CMD
+00:50 Monitor $q\alpha$ to T +02:00
(100%, 5° Att error)

CABIN PRESSURE DECREASING ~14K(2.3 nm)

NO PRESSURE DECREASE ~25K(4.1 nm)
* CAB PRESS RELIEF v1v(RH)-DUMP *

+01:21 MAX Q
+01:54 MODE IC - report
V82E, N62E

00:00
+4°/sec P,Y
±20°/sec R
MODE IA
00:42
+4°/sec P,Y
±20°/sec R
MODE IB
H=16.5 nm

BOOST

DATE 5/5/71

BOOST

+02:00 EDS AUTO - OFF
2 ENG OUT - OFF
LV RATES - OFF
LV RATE lt disabled as IU failure cue

+9°/sec P,Y
±20°/sec R

GO/NO GO FOR STAGING - report
+02:16 INBOARD CUTOFF - (lt 5 on)
LIFTOFF lt - out
+02:39 CMC BOOST Polynomial ends
+02:39 OUTBOARD CUTOFF - report (lts on)
+02:40 SIC/SII STAGING (lts - out)
+02:41 SII Ign Command (lts on)
SII SEP lt - on
+02:42 SII 65% - lts out

MODE IC

+03:10 SII SEP lt - out report

+03:16 TWR JETT (2) - on (up) (TFF>1+20)

TWR JETT

*NO TWR JETT, pg L/4-2 *

For MAN BOOSTER CONTROL
* LV GUID - CMC *
* Key V46E *

α/Pc sw - Pc
MAN ATT PITCH - RATE CMD
Twr Jett & MODE II - Report
GLY EVAP STEAM PRESS - AUTO
GLY EVAP H2O FLOW - AUTO

MODE II

+03:20 Guidance Initiate - report (OECO +41sec)
+03:50 Guidance Good
+04:00 Report Status
+05:00 Report Status
+06:00 Report Status
~~+06:05~~ SIVB to COI
GMBL MOT (4) - START - ON (LMP Confirm)
Check GPI
LV/SPS IND = GPI (Momentarily)
PITCH = -0.5°
YAW = +1.90°

DATE 5/5/71

L
2-9

+06:15 OMNI ANT - D (AZ < 96°)
- C (AZ > 96°)
+06:45 SIVB to orbit
+07:00 Report Status
+07:39 IECO (lt 5 - on)
+07:59 PU SHIFT
+08:00 Report Status
+08:30 GO/NO GO FOR STAGING - report
+08:39 Level sense arm _____
+09:08 Mode IV - Report
(VI ~ ~~22,695~~ 22,918, H DOT ~ ~~+97~~ +102, H ~ ~~+93~~ +94.7)
Report Status
+09:10 OECO (lts on)
+09:18 SII Staging - lts out
+09:18 SIVB Ign Cmd - lt on
+09:19 SIVB 65% - lt out

+10:00 GO/NO GO FOR ORBIT - report

+11:00 Report Status
+11:45 SECO (lt on) - report _____
39 (Begin TB5)

*If LV GUID - CMC *
*LV STAGE sw - SII/SIVB *
*SECO *
*LV ENG 1 lt - on *
*Begin TB5 *

*If no SECO,(VI +100 fps) *
*LV STAGE sw - SII/SIVB *
*If still no SECO, THC *
* CCW & neutral in 1 sec *

+11:55 INSERTION - lt out (TB5 + 10 sec)
49

Record VI_____ (fps)
H DOT_____ (fps)
H PAD_____ (.1nm)

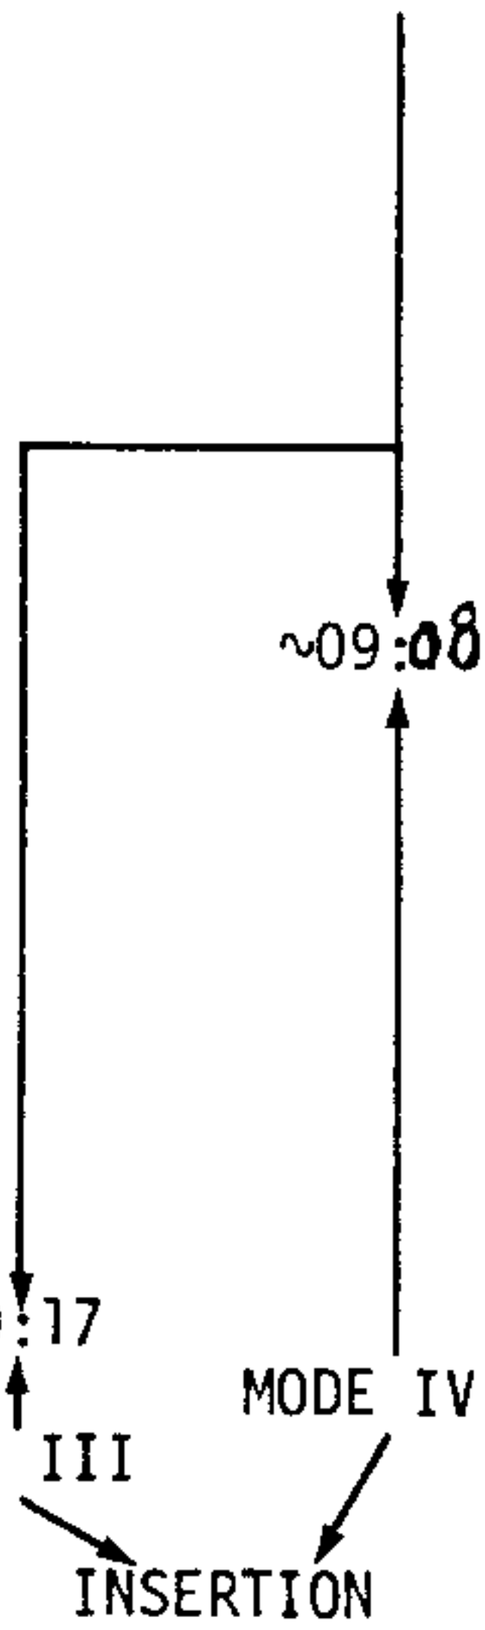

5/5/71

DATE _____

DATE _____

KEY RLSE

Record HA_____ (.1nm)
HP_____ (.1nm)
TFF_____ (min-sec)

PRO

V37E 00E
When CMC ACTY lt out:
V66E
V45E
Verify DAP load, V48: R1 = 31102, R2 = 01111
V46E
V83E (check 0)
PRO

CSM WT _____
P TRIM _____
Y TRIM _____

US LOS
(00:16:06)

SM RCS Control of SIVB (APS module failed)

LV GUID - CMC
MAN ATT (ROLL) - MIN IMP
cb SECS ARM (2) - close
AUTO RCS SEL P&Y - OFF
AUTO RCS SEL A/C ROLL - MNB
AUTO RCS SEL B/D ROLL - MNA
RCS CMD - ON
BSE command BURN MODE ON
If successful: LV GUID - IU
Control PITCH & YAW with THC, ROLL with RHC
Allow SIVB to drift in PITCH (Gravity Gradient)
Control YAW within platform limits
Perform normal procedures except:
TB6-15min: Mnvr to TLI Att & set up ORDEAL, pg L/2-29
Hold TLI Att until Ignition
Null Ullage deviations with SM RCS

After TLI IGNITION: RCS CMD - OFF
AUTO RCS SEL (16) - MNA/MNB
MAN ATT (3) - RATE CMD
After TLI CUTOFF: LV GUID - CMC
MAN ATT (3) - ACCEL CMD
RCS CMD - ON

DATE _____

DATE 3/29/71

INSERTION AND SYSTEMS CHECKS

1 GMBL MTRS (4) - OFF (LMP confirm)
EDS PWR - OFF
TVC SERVO PWR (2) - OFF
MN BUS TIE (2) - OFF(LMP)
SECS PYRO ARM (2) - SAFE
SECS LOGIC (2) - OFF
cb SECS ARM (2) - open
cb DIRECT ULLAGE (2) - open
cb ELS/CM-SM SEP (2) - open
cb FLT/PL VENT - open
EMS FUNC - OFF
TRANS CONT PWR - OFF
ROT CONTR PWR DIRECT(2) - OFF
BMAG MODE (3) - RATE 2
CM RCS LOGIC - OFF
LV STAGE sw - OFF (verify)
RHC #1 & #2 - LOCKED
CAB PRESS REL vlv (2) - NORMAL/LATCHED
REPRESS PKG vlv - OFF
DIRECT 02 vlv - CLOSE
cb ECS XDUCR PRESS GRP 2 MNA - close
INSTALL COAS

MONITOR LV TANK PRESS
*If ΔP >36 psid (OXID > FUEL) *
*If ΔP >26 psid (FUEL > OXID) *
*If LOX TK PRESS >50 psia *
* EMERGENCY CSM/LV SEP pg EMER/1-1*

DATE 5/5/71

CYI AOS
(00:17:12)

NOTE: Steps 2 thru 30 are not sequential

2 SM RCS HTRS (4) - PRIM
C/W - NORMAL
BPC JETT KNOB - 180° from BPC JETT
GN2 vlv HNDL - VENT (pull)
HATCH GEAR BOX - LATCH (verify)
ACTR HNDL SELECTOR - neutral

3 cb WASTE H2O/URINE DUMP HTRS (2) - close
FC REACS vlv - NORM
H2 PURGE LINE HTR - ON

4 MCCH - G/N Status
Z Torquing angle _____

5 SM RCS MONITORING CHECK
SM RCS PRPLNT tb (8) - gray
SM RCS He 1 & 2 tb (8) - gray
SM RCS IND - He TK TEMP
RCS IND sel - SM A, B, C, D
PKG TEMP - 115°-175° F (C/W 75°-205°)
He PRESS - 4100-4200 psia
MANF PRESS - 192-207 psia (C/W 145-215 psia)
He TK TEMP - 60°-90°F

6 CM RCS MONITORING CHECK
CM RCS PRPLNT tb (2) - gray
RCS IND sw - CM 1,2
He TEMP - 60°-90°F
He PRESS - 4100-4200 psia
MANF PRESS - 80-105 psia

7 C/W OPERATIONAL CHECK
C/W LAMP TEST - 1 (LH MA & 15 lts)
C/W LAMP TEST - 2 (RH MA & 20 lts)
C/W CSM - CM (CM RCS lt (2) - on)
C/W CSM - CSM (CM RCS lt (2) - out)

8 CMP to LEB for MN REG CHECK
STRUT UNLOCK LANYARD (2) - STOW
DRINKING WATER SUPPLY vlv - ON
cb COAS/TUNL LTG MNB - close
Unstow:
Helmet bags (U1)
Accessory bags (U1)
Tool E (L2)

9 Confirm normal suit and cabin pressure
If cabin press >5.3:
O2 flow - 0.2 lb/hr
If 4.7 < cabin press < 5.3:
O2 flow - pegged lo or hi, ~0.7 lb/hr stable
EMERG CABIN PRESS vlv - BOTH
SUIT CKT RET vlv - open (pull) Ensure CMS shield cover
Remove helmet & gloves & stow in PGA bag
Unstow & mount TSB's (U1)

INSERTION & SYS CK

DATE 5/5/71

10 MAIN REG CHECK
MAIN REG B vlv - close
EMER CABIN PRESS sel - 1
PUSH TO TEST PB - PUSH (O2 FLOW INC)
MAIN REG B vlv - open
MAIN REG A vlv - close
EMER CABIN PRESS sel - 2
PUSH TO TEST PB - PUSH (O2 FLOW INC)
MAIN REG A vlv - open
EMER CABIN PRESS sel - BOTH

11 SEC RAD LEAK CHECK
Monitor SEC ACCUM QUANTITY
SEC GLY To RAD vlv - NORM for 30 sec,
then BYPASS (CDR)

+20:00 12 ECS Post Insertion Config
GLY RSVR BYPASS vlv - OPEN
GLY RSVR OUT vlv - CLOSE
GLY RSVR IN vlv - CLOSE
PRIM GLY ACCUM QTY 25-50%
PRIM ACCUM FILL vlv - ON until 50-55%
ECS RAD FLOW CONT - PWR
PRIM GLY TO RAD vlv - NORMAL (push)
ECS RAD HTR - PRIM 1 (LMP)
ECS RAD TEMP PRIM OUT below PRIM IN
If outlet temp after 5 min
* above INLET TEMP *
*PRIM GLY TO RAD vlv - *
* BYPASS (pull) *
*Recheck in 10 min *
ECS RAD tb - gray
GLY EVAP TEMP IN - AUTO
POT H2O HTR - MNA

13 PCM BIT RATE - LOW
CYI LOS UP TLM - CMD RSET, then NORM
(00:22:46) VHF AM A - SIMPLEX
VHF AM B - off (ctr)

~~(00:25:00) Perform UV Photography, pg L/2-19~~

DATE 5/28/71

DATE

14 FC PURGE CHECK

H2/O2 PURGE (6) - ON (monitor)
Observe Flow rate inc
Reset MA (as req'd)
H2 PURGE LINE HTR - OFF

15 EPS MONITORING CHECK

Cryogenic Pressure - Quantity Check
H2 PRESS (3) - 225-260 psia
O2 PRESS (3) - 865-935 psia
SURGE TK PRESS - 865-935 psia
CRYO FANS - OFF; ON as req'd

FC Power Plant Check
FC HTRS(3) - on(up)
FC RAD tb (3) - gray
FC REAC tb (3) - gray
FC IND sel - 1, 2, 3
H2 FLOW - 0.03-0.15 lb/hr
O2 FLOW - 0.25-1.2 lb/hr
MOD SKIN TEMP - 390-440° F
MOD COND EXH TEMP - 150-175° F
FC pH HI tb - gray
FC RAD TEMP LO tb - gray

D-C Voltage-Amperage Check
MN BUS TIE (2) - OFF (verify)
FC MNA tb - 1 & 2 gray, 3 bp
FC MNB tb - 1 & 2 bp, 3 gray
FC 1, 2, & 3 (check amps)
MAIN BUS A, B, (26.5-31 vdc)
BAT BUS A, B, & BAT C (31.5-38 vdc < 3 amp)
PYRO BAT A, B (36.5 - 37.5 vdc)
DC IND sel - MNB
SYS TEST 5B (BAT RLY BUS - 3.4-4.1 vdc)

A-C VOLTS - 113 to 117 all phases

DATE _____

DATE 5/5/71

16 ECS MONITORING CHECK

SUIT COMP ΔP - .3-.4 psid
O2 SURGE TANK PRESS - 865-935 psia
REPRESS O2 >865 psia
PRIM RAD tb - gray
*If PRIM RAD tb - 2 *
* ECS RAD FLOW AUTO CONT - 1 until*
* tb gray, then AUTO *
ECS RAD TEMP PRIM IN - 67-97° F
ECS RAD TEMP PRIM OUT - -20° to +63° F
PRIM GLY EVAP TEMP OUT - 38-50.5° F
PRIM GLY DISCH PRESS - 40-52 psig
SUIT TEMP - 45-55° F
SUIT PRESS/CABIN PRESS - 4.7-5.3 psia
PART PRESS CO2 < 7.6 mm Hg
POT H2O QTY - 10-100%
WASTE H2O QTY - 25-85%

17 SPS MONITORING CHECK

SPS PRPLNT TK TEMP ind - +45 to +75° F
*IF<45°F, SPS LINE HTRS - A *
IF>75°F, SPS LINE HTRS - off (ctr)
SPS PRESS IND sw - He, N2A, & N2B
SPS PRPLNT TK PRESS ind
He 3900 psia max
N2A 2900 psia max
N2B 2900 psia max
SPS PRESS IND sw - He
FUEL & OXID PRESS ind - 170 to 195 psia
SPS ENG INJ VLVS (4) - CLOSE
Check SPS OXID, FUEL & UNBAL QTY
OXID FLOW VLV PRIM - PRIM
SPS He VLV (1&2) - AUTO, tb - bp

18 GDC ALIGN

19 UNSTOW SEQ CAMERA BRACKET & ORDEAL

20 MOUNT ORDEAL BOX & INITIALIZE

DATE 3/29/71

DATE

21 SECONDARY GLYCOL LOOP CHECK

ECS IND sw - SEC
SEC COOL LOOP PUMP - AC1
GLY DISCH SEC PRESS - 39-51 psig
ACCUM SEC QTY IND - 30-55%
SEC COOL LOOP - EVAP
After 5 min:
SEC EVAP TEMP OUT - 38-50.5°F
SEC COOL LOOP EVAP - RSET 1 min, off (ctr)
SEC COOL LOOP PUMP - off (ctr)
ECS IND sw - PRIM

22 UNSTOW CAMERAS

DAC (T8,250,7) 12 fps, MAG A (B3)
Power cable (B3)
18mm lens (B3)
Rt. angle mirror (B3)
(Assemble & mount in L.H. rendezvous window)
(f4 3, 1/60/∞) 8 fr, MAG M
EL ~~(f8,250,30) 10 fr, MAG L~~ (B3)
Spotmeter
(Stow in LMP TSB)
W/ BRKT, Filter, MAG N (A1)
TV (ALC - PEAK, f44) (A1)
Power cable (A1)
Bracket (A1)
Monitor & cable (A1)
(Assemble, connect cables & hand to LMP)

SUNSET
(00:43:28)

23 OPTICS DUST COVER JETT

Install Optics eyepieces
G/N PWR OPTICS - on (up)
OPT ZERO - OFF, then ZERO (15 sec)
OPT ZERO - OFF
OPT MODE - MAN
OPT COUPLING CONT - DIRECT
OPT SPEED CONT - HI
OHC - MAX RIGHT (Obs eject thru SCT)
(SXT 40°, SCT 150° shaft angle)

DATE 3/29/71

24 IMU REFSMMAT Realign Check (P52),
P52 - (PAD REFSMMAT)

N71: __ __, __ __

N05: __ __ __ . __ __

N93:

X __ __ . __ __ __

Y __ __ . __ __ __

Z __ __ . __ __ __

GET: __ __:__ __:__ __

If IMU is realigned,
Realign GDC (CDR)
OOE
RETICLE BRIGHTNESS - DIM
Stow Optics Eyepieces

CRO AOS 25
(00:52:07)
CRO LOS
(00:58:17)
SUNRISE
(01:21:04)
US AOS 26
(01:28:12)

Increase S-BD volume
Two way S-BD VOICE Check
Report GYRO torquing angles

SCS ATT Ref Comp Check
V16 N20E
FDAI SELECT - 1
FDAI SOURCE - ATT SET
ATT SET - GDC
ATT SET dials - null FDAI 1 err needles
Key VERB when nulled (freeze display)
Record from DSKY:
R_____, P_____, Y_____
Record from ATT SET dials:
R_____, P_____, Y_____
FDAI SEL - 1/2

DATE 3/29/71

DATE

27 EXTEND DOCKING PROBE

cb DOCK PROBE (2) - close (verify)
DOCK PROBE EXTD/REL - EXTD/REL until full probe extension
(DOCK PROBE tb - gray at full extension)

	EXT	RET
FULL EXT	Gray	Gray
FULL RET	BP	BP
PART EXT	BP	Gray

DOCK PROBE EXTD/REL - RETRACT (tb-gray)

28 COPY TLI, TLI ABORT, & P37 PADS

29 SV UPDATES (MCCH)

30 cb SECS ARM (2) - close
Cue MSFN
SECS LOGIC (2) - on(up)
MSFN confirm GO for PYRO ARM

(01:35:00) Perform UV Photography, pg L/2-19

US LOS
(01:48:28)

SUNSET
(02:11:11)

DATE _____

DATE 5/28/71

ULTRAVIOLET PHOTO PROCEDURES (Earth Orbit)

1 Configure camera: (UV - land/water/clouds)
CM5/EL/105/UV, BRKT, CONT (f4.3, 1/60, ∞) (8 fr)
Ringslide
MAG N _____, fr#_____
Remove R12 Flight Data File stowage box
Remove CM5 Window Cover and mount camera

2 2 frames, filter 1, change shutter to B
2 frames, filter 2, exp time 20 sec
Change shutter to 1/250
2 frames, filter 3, change shutter to 1/500
2 frames, filter 4

Record fr#___ Record GET ___

3 Configure camera: (UV - color)
CM5/EL/105/CEX, CONT (f8, 1/250, ∞) (1 fr)
Ringslide
MAG M _____, fr#_____ Note: Use f11 for clouds.
1 frame, filter 4 Use f8 for land/water.
Record fr# _____

4 Note comments as to condition of window 5
Replace CM5 Window Cover.

5 Insert Darkslide
Configure camera: (T, D & E)
CM/EL/80/CEX (f8, 1/250, 30)
MAG M _____, fr#_____
Remove Darkslide

7/9/71

DATE

THIS PAGE INTENTIONALLY BLANK

DATE _____

DATE 5/28/71

L
2-21

TLI

X						X	2	4	0	2	3	TB6p
X	X	X				X	X	X	1	8	0	R
X	X	X				X	X	X	0	4	5	P TLI
X	X	X				X	X	X	0	0	1	Y
X	X	X				X	X	X	5	5	5	BT
						1	0	4	3	1	1	ΔVC'
+						+	3	5	5	9	9	VI
X	X	X				X	X	X	2	5	7	R
X	X	X				X	X	X	6	7	7	P SEP
X	X	X				X	X	X	3	2	0	Y
X	X	X				X	X	X	1	0	1	R
X	X	X				X	X	X	2	5	7	P EXTRACTION
X	X	X				X	X	X	0	4	0	Y
X	X					X	X	0	4	5	0	R2 Align
X	X					X	X	0	3	5	0	R2 Ign
X	X					X	X	1	0	2	4	ORDEAL Start
X	X	X				X	X	X	0	3	1	YAW

DATE 5/28/71

DATE

L
2-22

P27 UPDATE

PURP	V	V	V
GET	• • • •	• • • •	• • • •
304 01	INDEX	INDEX	INDEX
02			
03			
04			
05			
06			
07			
10			
11			
12			
13			
14			
15			
16			
17			
20			
21			
22			
23			
24			
N34 HRS	X X X	X X X	X X X
MIN	X X X X	X X X X	X X X X
NAV CHECK SEC	X X	X	X
N43 LAT	0	0	0
LONG			
ALT	+ 0	+ 0	+ 0

DATE 5/28/71

DATE 5/28/71

P30 MANEUVER

L/2-23

SET STARS

R_{ALIGN} ___ ___ ___

P_{ALIGN} ___ ___ ___

Y_{ALIGN} ___ ___ ___

ULLAGE ___

___

___

___

___

HORIZON/WINDOW ___

___

___

___

___

P37 FOR L/O+8

																PURPOSE	
																PROP/GUID	
					+											WT	N47
						0	0									P_{TRIM}	N48
						0	0									Y_{TRIM}	
					+	0	0									HRS	GETI
					+	0	0	0								MIN	N33
					+	0										SEC	
																ΔV_X	N81
																ΔV_Y	
																ΔV_Z	
					X	X	X									R	
					X	X	X									P	
					X	X	X									Y	
					+											H_A	N44
																H_P	
					+											ΔVT	
					X	X	X									BT	
					X											ΔVC	
					X	X	X	X								SXTS	
					+										0	SFT	
					+									0	0	TRN	
					X	X	X									BSS	
					X	X										SPA	
					X	X	X									SXP	
						0										LAT	N61
																LONG	
					+											RTGO	EMS
					+											VIO	
																GET	0.05G

GETI

X ΔVT

X LONG

GET 400K

5/28/71

DATE ___

DATE ___

P30 MANEUVER

SET STARS

R_{ALIGN} ___ ___ ___

P_{ALIGN} ___ ___ ___

Y_{ALIGN} ___ ___ ___

ULLAGE _____

_____

_____

_____

HORIZON/WINDOW _____

_____

_____

_____

P37 FOR L/0+8

0	0	X	0	0	GETI
X	6	0	7	6	ΔVT
X	−	1	7	5	LONG
0	2	7	5	6	GET_{400K}

							PURPOSE
							PROP/GUID
+							WT N47
	0	0		•			P_{TRIM} N48
	0	0		•			Y_{TRIM}
+	0	0					HRS GETI
+	0	0	0				MIN N33
+	0			•			SEC
					•		ΔV_X N81
					•		ΔV_Y
					•		ΔV_Z
X	X	X					R
X	X	X					P
X	X	X					Y
+					•		H_A N44
					•		H_P
+					•		ΔVT
X	X	X		•	•		BT
X					•		ΔVC
X	X	X	X				SXTS
+				•		0	SFT
+			•		0	0	TRN
X	X	X					BSS
X	X				•		SPA
X	X	X			•		SXP
	0			•			LAT N61
				•			LONG
+					•		RTGO EMS
+							VIO
			•	•			GET 0.05G

DATE _____

DATE 5/28/71

DATE 5/28/71

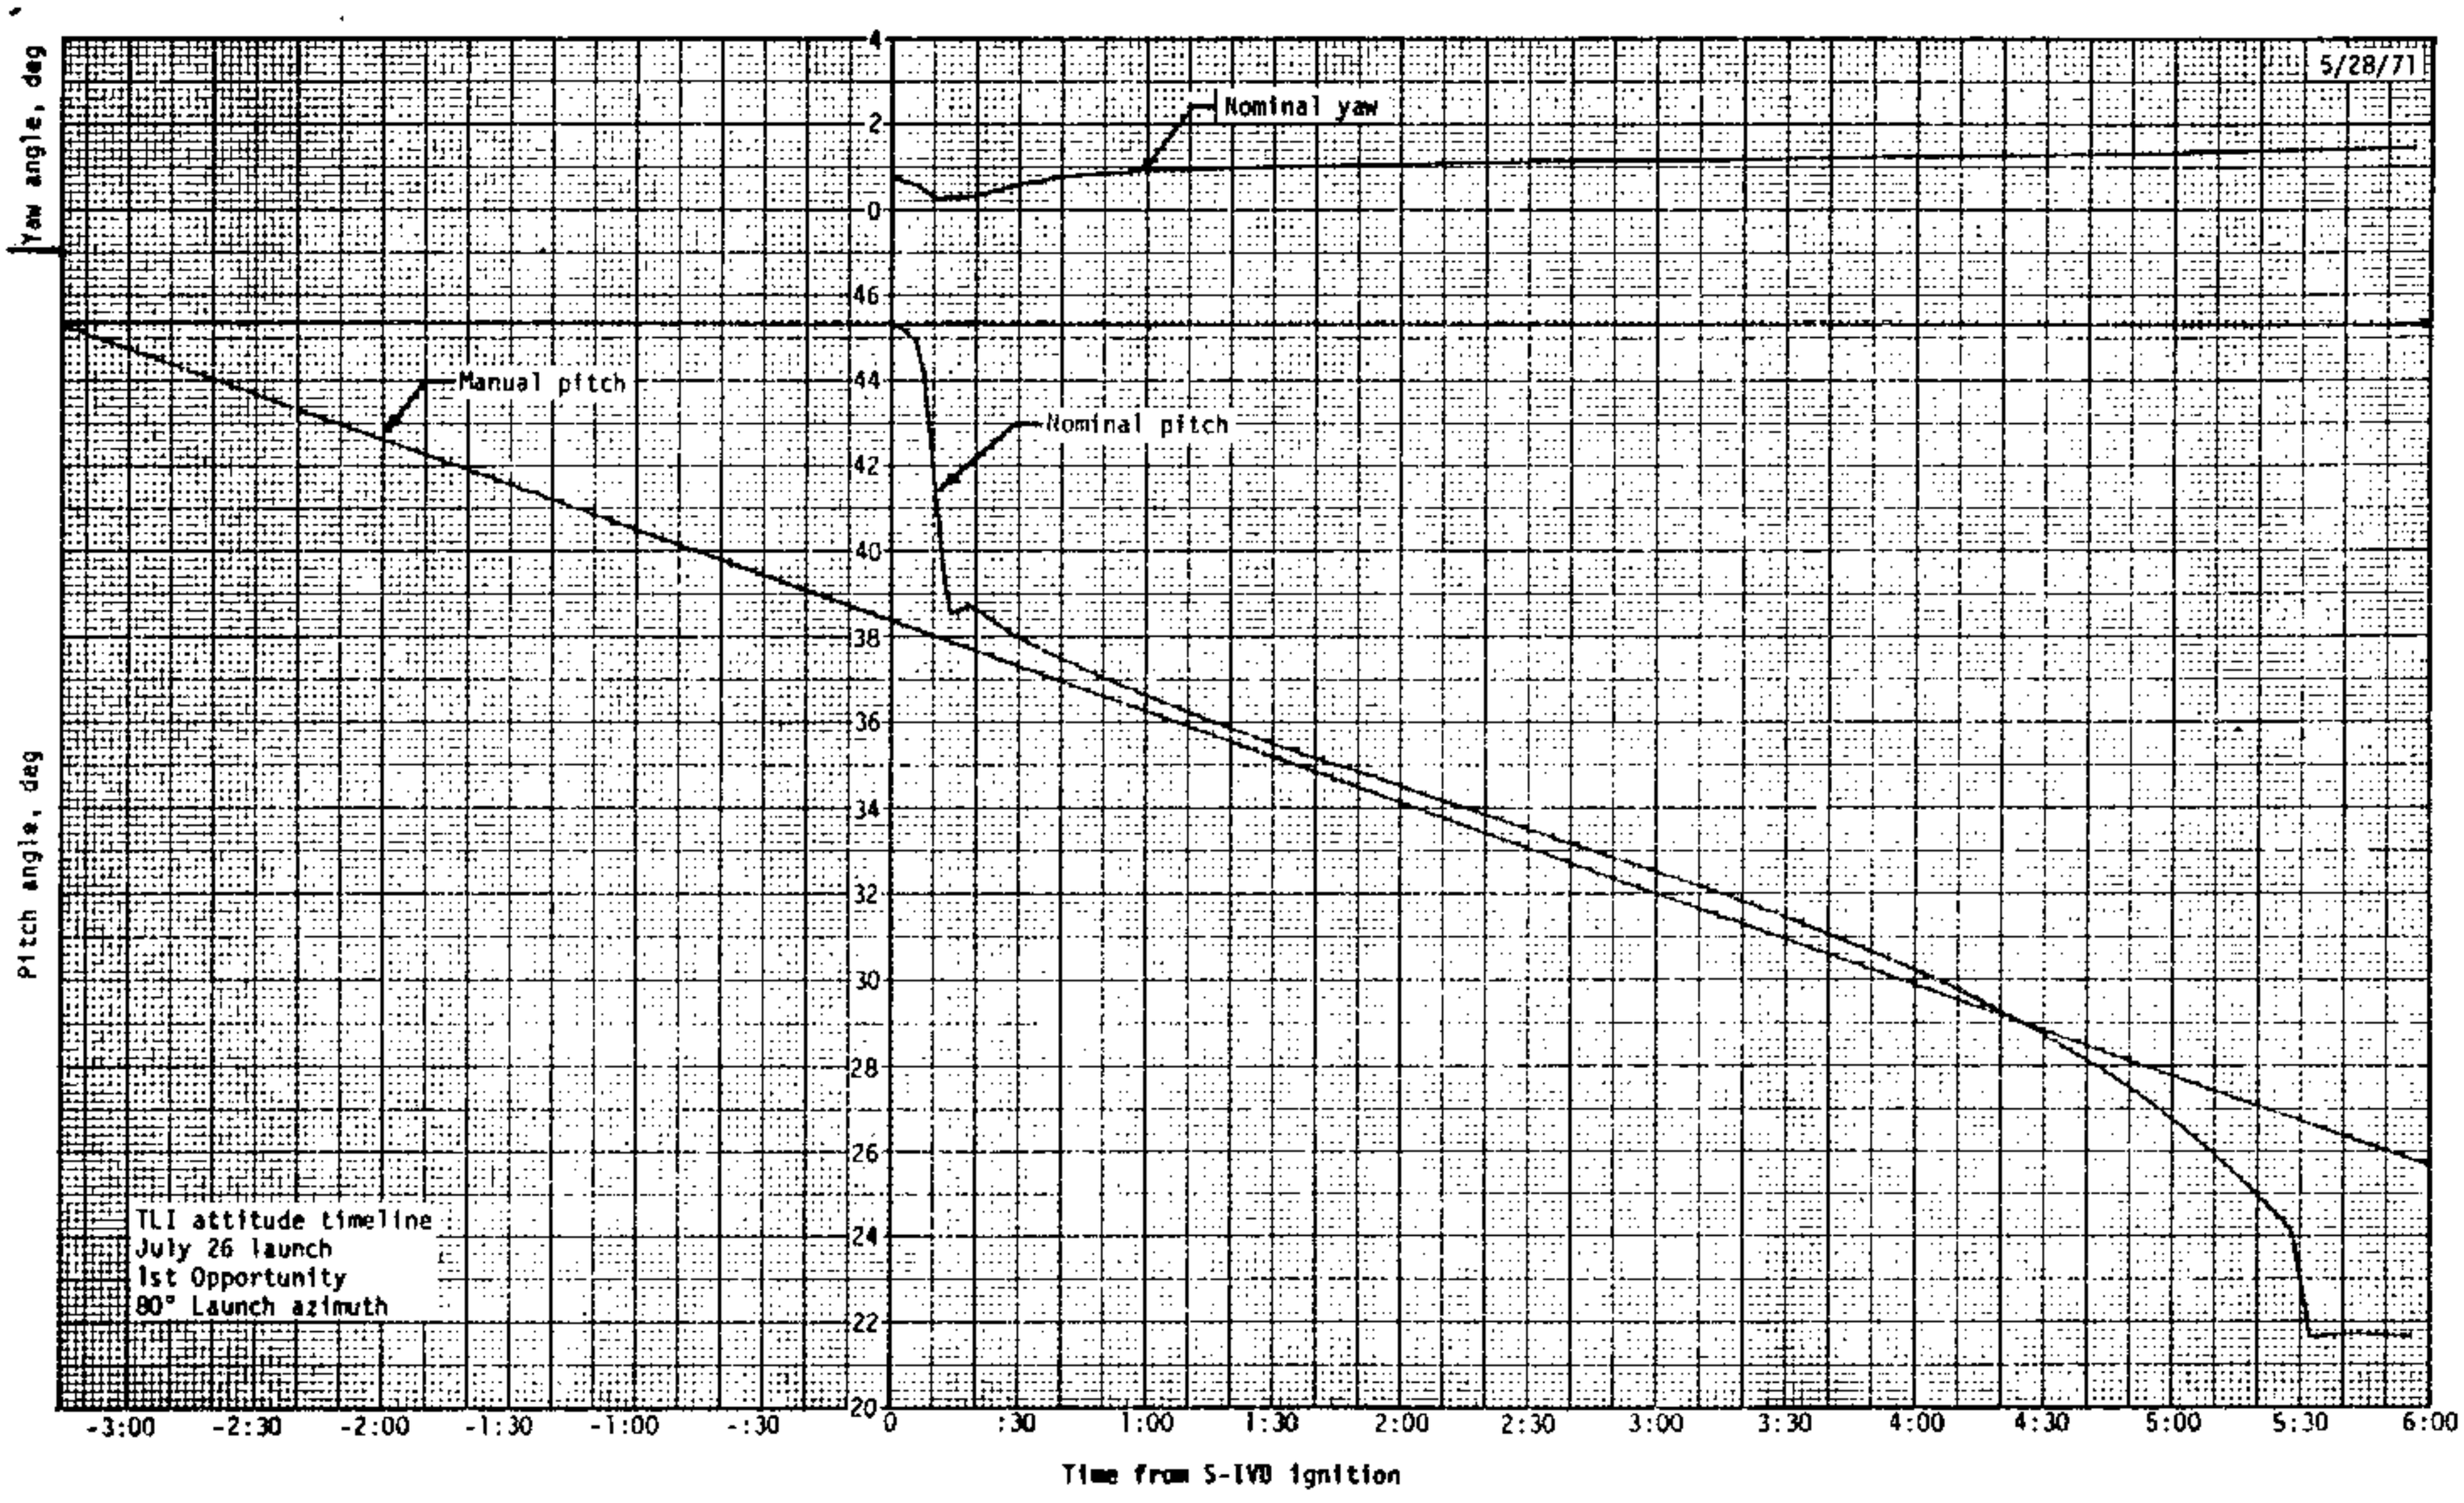

L
2-25

DATE _____

DATE _____

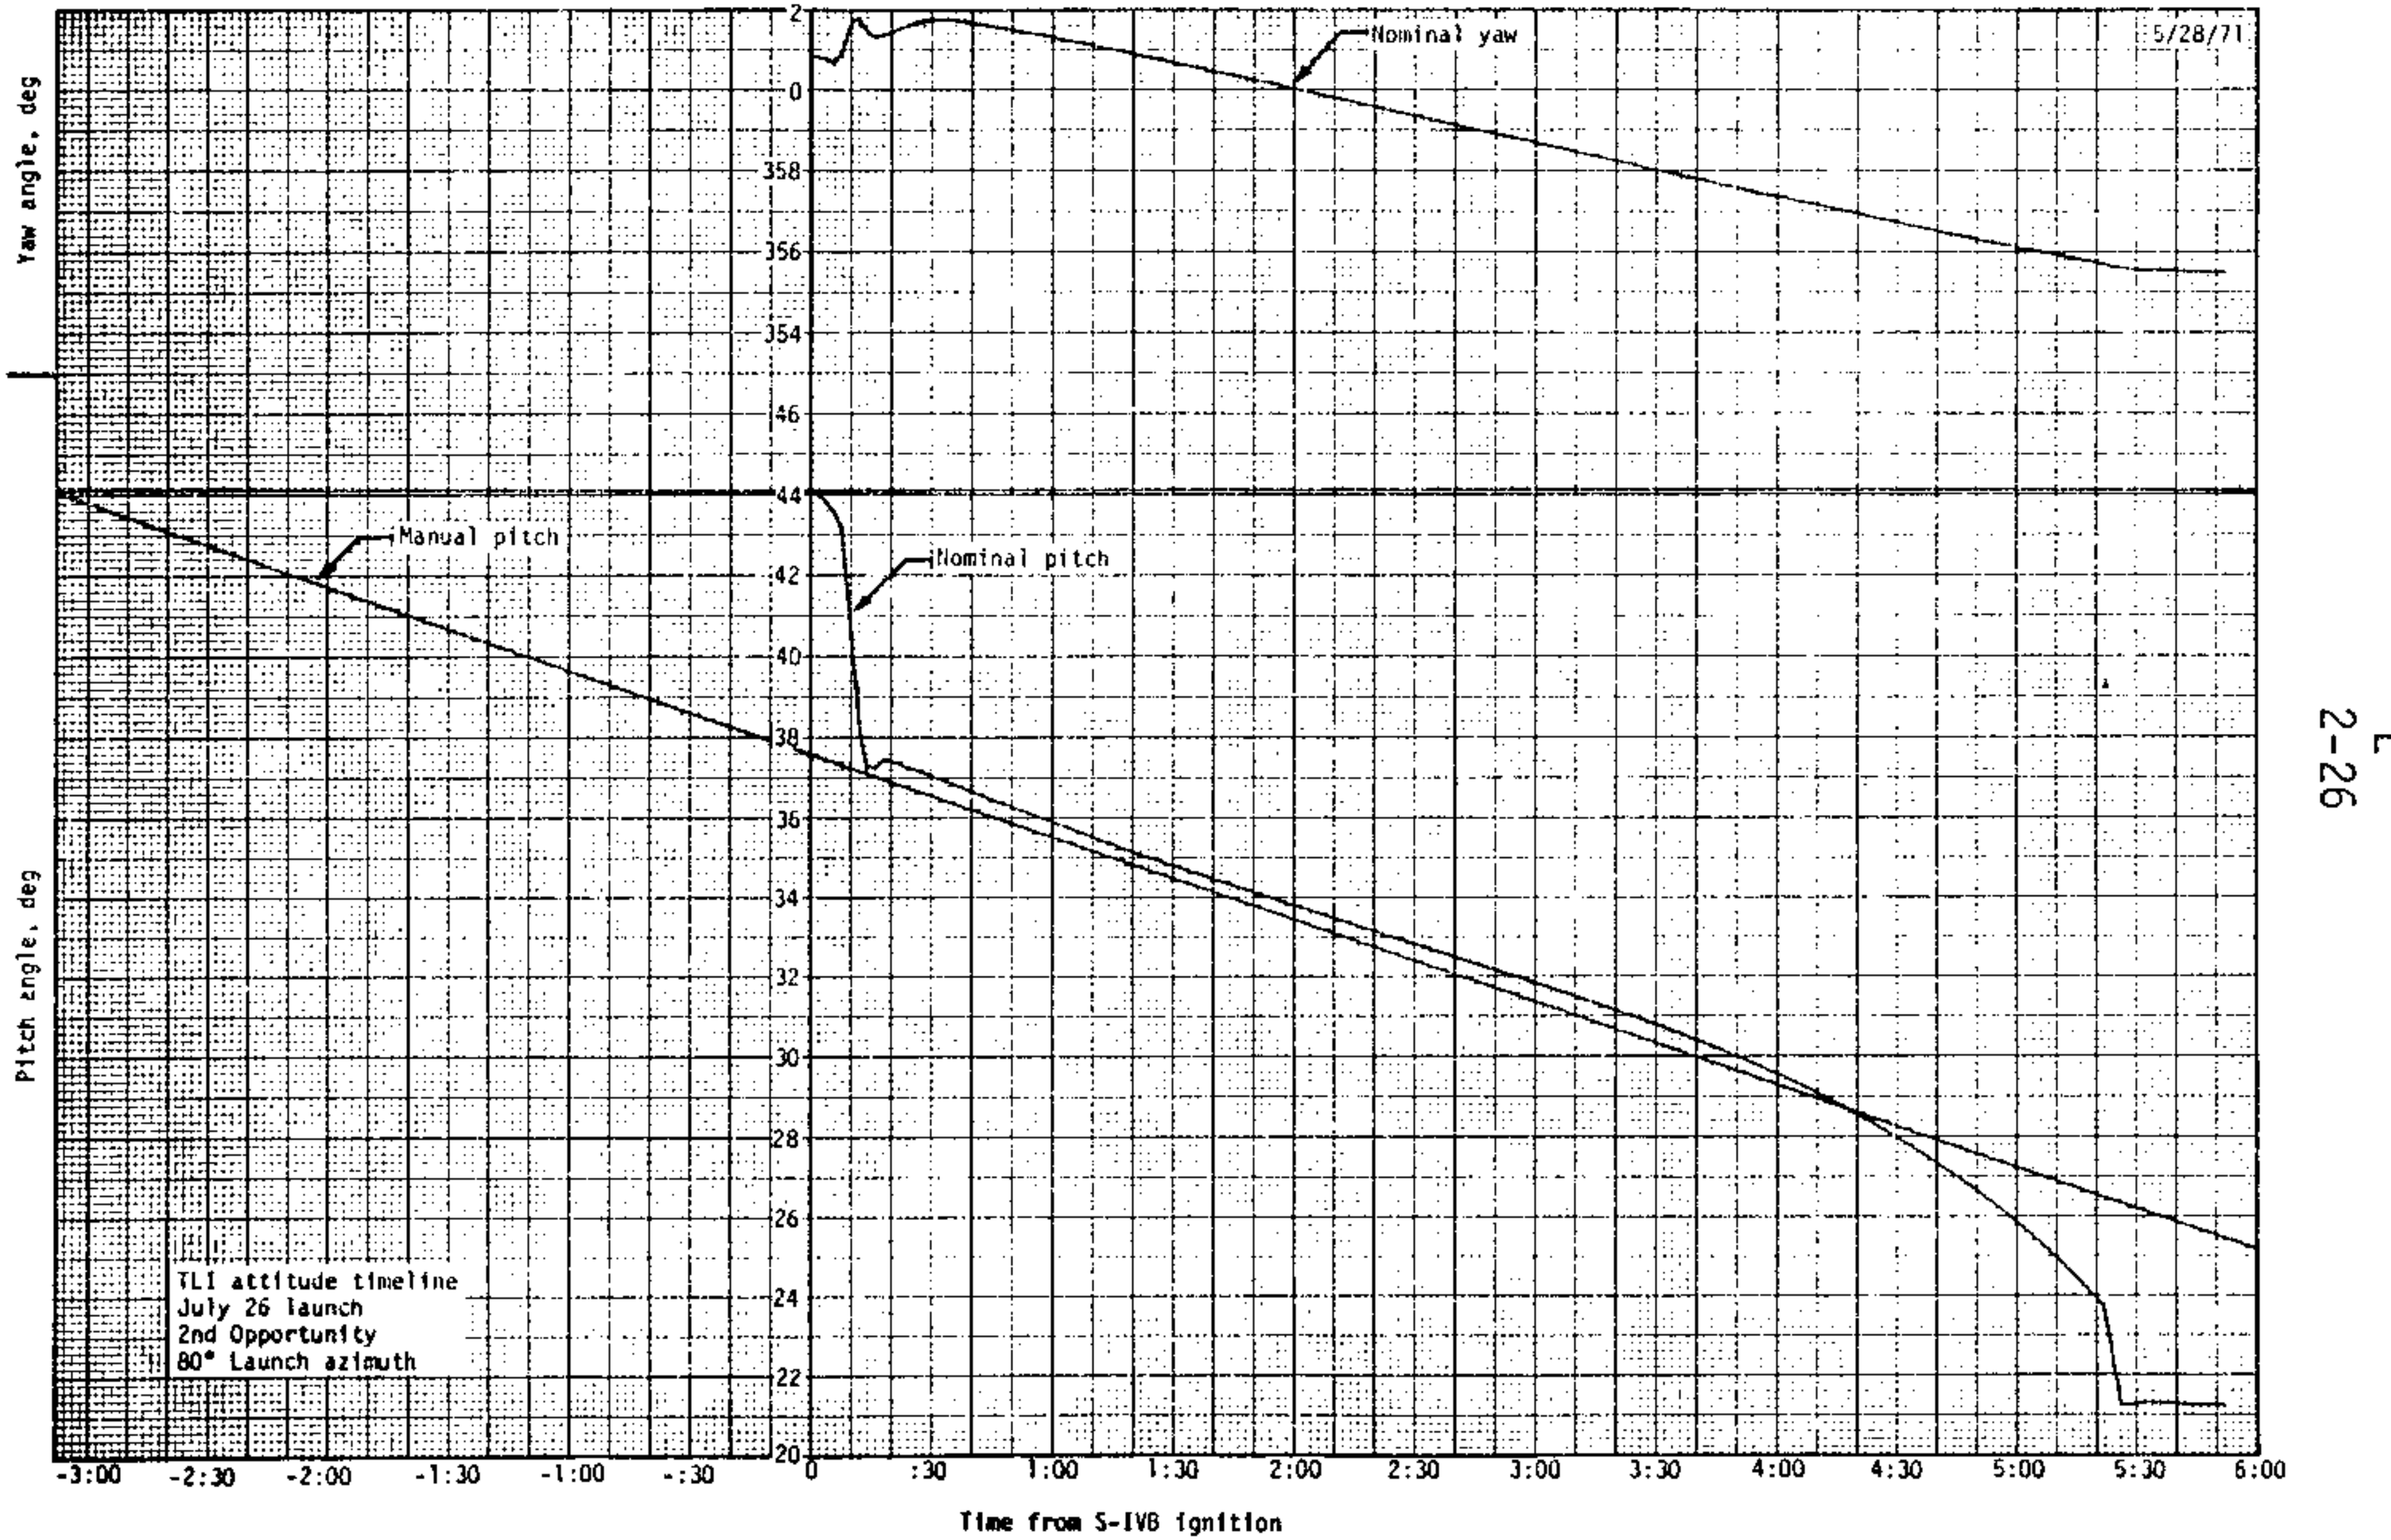

L
2-26

DATE 5/28/71

DATE 7/9/71

NOMINAL SIVB TLI 1

LAUNCH JULY 26, 1971

7/1/71

DET	θ	ψ	VI	Ḣ	H
0:00	45	0.7	25599	10	97
:30	38	0.4	26018	.7	97
1	37	0.9	26614	6	97
1:30	36	1.0	27299	62	97
2	35	1.1	28023	184	98
2:30	34	1.1	28784	379	99
3	33	1.1	29584	655	102
3:30	32	1.2	30426	1018	106
4	31	1.2	31315	1478	112
4:30	29	1.3	32258	2040	120
5	27	1.3	33262	2710	132
5:30	25	1.4	34338	3487	147
6:03	22	1.4	35599	4426	168

MANUAL SIVB TLI 1

LAUNCH JULY 26, 1971

7/1/71

DET	θ	ψ	VI	Ḣ	H
0:00	38.6	1	25599	10	97
:30	36.5	1	26018	.7	97
1	36.2	1	26614	6	97
1:30	35.0	1	27299	62	97
2	33.9	1	28023	184	98
2:30	32.7	1	28784	379	99
3	31.5	1	29584	655	102
3:30	30.4	1	30426	1018	106
4	29.2	1	31315	1478	112
4:30	28.0	1	32258	2040	120
5	26.8	1	33262	2710	132
5:30	25.7	1	34338	3487	147
6:03	24.8	1	35599	4426	168

TLI TRAJECTORY OPP 1
NOM & MAN

TLI TRAJECTORY OPP 2
NOM & MAN

NOMINAL SIVB TLI 2

LAUNCH JULY 26, 1971

7/1/71

DET	θ	ψ	VI	Ḣ	H
0:00	44	0.8	25594	10	98
:30	37	1.7	26202	-4	98
1:	36	1.3	26873	20	98
1:30	35	0.7	27579	106	99
2	34	0.0	28320	261	100
2:30	33	359.3	29099	493	101
3	32	358.7	29917	810	105
3:30	31	358.0	30779	1219	110
4	30	357.4	31690	1728	117
4:30	28	356.7	32658	2342	127
5	26	356.1	33691	3065	140
5:30	21	355.5	34800	3884	157
5:50	21	355.5	35591	4485	171

MANUAL SIVB TLI 2

LAUNCH JULY 26, 1971

7/1/71

DET	θ	ψ	VI	Ḣ	H
0:00	37.7	358	25599	10	98
:30	36.7	358	26202	-4	98
1	35.6	358	26873	20	98
1:30	34.6	358	27572	106	99
2	33.5	358	28320	261	100
2:30	32.4	358	29099	493	101
3	31.4	358	29917	810	105
3:30	30.3	358	30779	1219	110
4	29.3	358	31690	1728	117
4:30	28.2	358	32658	2342	127
5	27.2	358	33691	3065	140
5:30	26.1	358	34800	3884	157
5:50	25.5	358	35591	4485	171

DATE 7/9/71

NASA — MSC

TLI PREPARATION

XLUNAR - INJECT (verify)
EDS PWR - on (up)
Perform EMS ΔV TEST & NULL
BIAS CHECK, pg G/2-5
CRO AOS (02:24:41) — Set ΔVC
EMS FUNC - ΔV
GDC ALIGN
CRO LOS (02:31:14) — V48E, 31102, 01111
Key V83E
Set ORDEAL - 90/EARTH
SECS PYRO ARM (2) - on (up)
TRANS CONTROL PWR - ON
ROT CONTR PWR NORMAL (2) - AC/DC (verify)
ROT CONTR PWR DIRECT (2) - MNA/MNB
SC CONT - SCS (verify)
LV/SPS IND - SII/SIVB (verify)
cb DIRECT ULLAGE (2) - closed
Cycle CRYO FANS
Set DET - 51:00

P15 - TLI INITIATE/CUTOFF

V37E 15E

F 06 33 — GET of TB6 (hrs,min,sec)
Load GET of TB6
PRO

F 06 14 — VC/O (fps)
Load VC/O
PRO

06 95 — TFI, VG, VI (min-sec,fps,fps)

5/28/71

DATE

TLI, NOMINAL & MANUAL

LV GUID - IU (verify)
*If LV GUID lt - on: *
* LV GUID - CMC *
* RHC PWR DIRECT (2) - OFF*

TB6 (-09:38): UPLINK ACTY lt - on
SII SEP lt - on (TIG-09:38)

TB6 + 10sec: UPLINK ACTY lt - out
SII SEP lt - out

51:00 (-09:00): Start DET counting up
*If LV GUID - CMC: *
* V16 N20E *
* MNVR to R2 Align = _____(45°)*

MONITOR LV TANK PRESS SEQUENCE

Nominal LOX ~ 40 psia
Nominal LH2 ~ 31 psia
*If ΔP > 36 psid (OXID > FUEL) *
*If ΔP > 26 psid (FUEL > OXID) *
*If LOX TK PRESS >50 psia *
* EMERGENCY CSM/LV SEP pg EMER/1-1*

ORDEAL FDAI #1 - ORB RATE
ORDEAL FDAI #2 - INERTIAL
ORDEAL MODE - HOLD/FAST
ORDEAL - 300/LUNAR
RHC #2 - ARMED

UP TLM CM - BLOCK (verify)
UP TLM IU - BLOCK (verify)

56:00 (-04:00): Slew FDAI #1 to PITCH = ~~16°~~ 17°
*If LV GUID - CMC: *
* Slew FDAI #1 to PITCH = 0° *
* V16 N20E *
* Insure R2 Align = _____(45°)*

Insure FDAI #1 PITCH = 18°

56:45 (-03:15) ORDEAL MODE - OPERATE/SLOW, IU or CMC
*If LV GUID - CMC: *
* MNVR to R2 Ign = _____ (38°)*

58:15 DSKY BLANKS (Ave G on)

58:20 06 95 TFI, VG, VI (min-sec,fps,fps)
(-01:40)

SCS TVC SERVO PWR #1 - AC1/MNA
SCS TVC SERVO PWR #2 - OFF (verify)
TAPE RCDR - HBR/RCD/FWD/CMD RESET
EMS MODE - NORMAL
58:36 (-01:24) SII SEP lt - on

*TLI Inhibit *
* before 59:42 - XLUNAR INJECT - SAFE*
* (recycle to TB5) *
* 59:42-00:12 - LV STAGE - SII/SIVB *
* (recycle to TB5) *
* after 00:12 - LV STAGE - SII/SIVB *
* (permanent inhibit)*

58:38 SIVB ULLAGE Begins

58:38 SUNRISE (02:48:47)

HAW AOS (02:49:29)

59:42 SII SEP lt - out (TIG - 18 sec)

HAW LOS (02:49:52)

DATE 5/28/71

DATE

59:52 SIVB FUEL LEAD
59:55 SIVB ULLAGE discontinues
Insure FDAI #1 PITCH = 0°
*If LV GUID - CMC: *
* FDAI #1 PITCH = 0°*

59:59 LV ENG 1 lt - on

00:00 SIVB IGNITION (__:__:__) GETI
00:02 LV ENG 1 lt - out
00:10 06 95 TFC, VG, VI (min-sec,fps,fps)

HAW AOS
(02:55:29)

MONITOR THRUST & ATTITUDE
MONITOR LV TANK PRESS
*If LV GUID - CMC: *
* Fly PITCH = 0° *
* YAW = _____(+1°)*

+45°/P,Y
±10°/sec P,Y
±20°/sec R

HAW LOS
(02:55:59)

V16 N62E
KEY RLSE before ECO
~~05:54~~ 06.03 SIVB ECO (lt on) (BEGIN TB7)

*EMER SIVB CUTOFF *
If no ECO at +2 sec and VI attained
* LV STAGE sw - SII/SIVB *
*If still no ECO, *
* THC - CCW & NEUTRAL in 1 sec *

Key VERB (freeze display)

Record TFC _____
VG _____
VI _____
ΔVC _____

~~06:04~~ 06.13 LV ENG 1 lt - out (TB 7 + 10 sec)

KEY RLSE
F 16 95 TFC (Static), VG, VI (min-sec,fps,fps)

08:26 SIVB MNVR TO ORB RT (HDS DN) (.3°/sec)

DATE _____

DATE 5/28/71

SCS TVC SERVO PWR #1 - OFF
PCM BIT RATE - LOW
MSFN AOS
(02:56:08)
EMS MODE - STBY
EMS FUNC - OFF
SECS PYRO ARM (2) - SAFE
FDAI #1 - INRTL
RHC #2 - LOCKED

PRO

F 37

OOE

When CMC ACTY lt out,
  Key V66E
CMP to LH couch
CDR to CTR couch
WASTE STOWAGE VENT vlv - CLOSED
HI GAIN ANT PWR - OFF (Verify)
cb HI GAIN ANT FLT BUS - close
cb HI GAIN ANT GRP 2 - close
T, D, & E, pg L/3-1

DATE 5/28/71

SATURN RATE CHANGE

V25 N1 E
3310E, 0E, XXXE, YYYYYE

SIVB RATE		SAT RATE +1 address 3311 XXX	SAT RATE +2 address 3312 YYYYY
.05°/sec	RPY	161	77616
.1	RPY	210	77567
.2	RPY	266	77511
*.3	RPY	344	77433
.3P,Y .5	R	476	77301

*USE FOR TLI

DATE

NORMAL SC/BOOSTER SEPARATIONS

1 PRE CSM SEPARATION

DIRECT O2 vlv - OPEN until
CAB PRESS = 5.7, then close
cb DOCK PROBE (2) - close (verify)
COAS PWR - on
ALIGN GDC SIVB MNVR (__:__:__)
*If LV GUID - CMC * SEP (__:__:__)
* mnvr to SEP ATT *
* Do not reload DAP*
Load RCS DAP
R1=11103, R2=01111
V46E OMNI ANT-C
Load N17 (SEP) & N22 (EXTRACTION)
V63E (Monitor SIVB Mnvr) (TB7 + 15 min)
*If error needles not nulled: *
* V60E (SIVB ±1.8°db)*
* V16 N20E *
* R22 = 300° - R20 *
* P22 = P20 + 180° *
* Y22 = 360° - Y20 *

	R	P	Y	
*N20	_____	_____	_____	*
*N22	_____	_____	_____	*

*Load new Docking Attitude *

2 CSM SEPARATION PREP

DOCK PROBE EXTD/REL - RETRACT (verify)
SM RCS PRPLNT tb (8) - gray (verify)
AUTO RCS SELECT (16) - MNA/MNB
Perform EMS NULL BIAS CHECK, pg G/2-5
Set ΔVC to -100.0
EMS FUNC - ΔV
FDAI SCALE - 5/1
MAN ATT (3) - RATE CMD
LIMIT CYCLE - OFF (verify)
ATT DB - MIN
RATE - LOW

DATE 3/29/71

NORM SC/BOOSTER SEP

TRANS CONT PWR - on (up) (verify)
ROT CONT PWR NORMAL (2) - AC/DC (verify)
ROT CONT PWR DIRECT (2) - MNA/MNB (verify)
ATT SET tw - R=0°, P=180°, Y=0°

Set up TV
Mount TV in R.H. rendezvous window
S BD AUX TV - TV
TV monitor power sw - ON
Adjust monitor for proper picture
Adjust lens aperture (f22), zoom and focus controls
S BD AUX TV - off (center)

NORM SC/BOOSTER SEP

CMC MODE - FREE (verify)
SC CONT - CMC
BMAG MODE (3) - RATE 2 (verify)
cb RCS LOGIC (2) - open
TVC SERVO PWR #1 - AC1/MNA
Set DET - 59:30
FC REAC v1v - LATCH

3 CSM SEPARATION
V49E F 06 22 (EXTRACT ATT)
THC - ARMED
RHC #2 - ARMED
cb SECS LOGIC (2) - closed (verify)
cb SECS ARM (2) - closed (verify)
SECS LOGIC (2) - on (up)(verify)
RCS CMD - ON
TAPE RCDR - HBR/RCD/FWD/CMD RESET
SECS PYRO ARM (2) - ARM
*If LV GUID - CMC *
* Insure rates nulled and *
* yaw drifting towards 0° *
* Load DAP 11103, 01111 *
* V46E, V60E, V63E *
GDC ALIGN
EMS FUNC - ΔV (verify)
EMS MODE - NORMAL
59:30 Start DET

3/29/71

59:50 CMC MODE - AUTO
59:58 Thrust +X and hold
00:00 CSM/LV SEP pb - push, hold, and release
LV TANK PRESS - full scale Low
*No Separation: *
* cb RCS LOGIC (2) - close *
* THC - CCW (leave in detent) *
* DET reset and counting up (auto) *
* LV TK PRESS - full scale low (SEP ind)*
* 00:03 THC - neutral *

00:03 THC - release (ΔV ~.5 fps)
SM RCS PRPLNT tb (8)-gray (verify)
SM RCS He tb (8)-gray (verify)
SM RCS SEC PRPLNT FUEL PRESS (4) - CLOSE
FC REAC vlv - NORM
O2 TK 3 ISOL vlv tb - gray (verify)

4 CSM TRANSPOSITION
V62E
MAN ATT (PITCH) - ACCEL CMD
00:15 Pitch up at .5°/sec
When Pitch error needle positive,
PRO F 50 18 OMNI ANT - B
PRO 06 18
MAN ATT (PITCH) - RATE CMD
F 50 18 (completion of mnvr)
ENTR
Thrust +X(4 sec)(ΔV ~.7 fps)
Load RCS DAP 11102, 01111
S BD AUX TV - TV (90 sec delay)
HI GAIN ANT TRACK - MAN
HI GAIN ANT PWR - POWER
Slew ANT to verify operation
HGA angles: P = -21°, Y = +275°
S BD ANT OMNI - HI GAIN
HI GAIN ANT TRACK - REACQ
TV TRANSMIT/STBY sw - TRANSMIT
Start DAC

3/29/71

DATE

DATE

5 DOCKING

Stabilize & align CSM
BMAG MODE (3) - ATT 1/RATE 2
At capture:
PROBE EXTD/RETR tb-bp (A, pg S/2-11) malf. DOCK
CMC MODE - FREE 2
Allow probe to damp S/C motions
(approx 10 sec)
Align Pitch and Yaw with THC (<3°)
(minimum possible)
DOCK PROBE RETRACT PRIM-1
*If no RETRACT in 30 sec: PRIM-2 *
*If still no RETRACT: SEC-1 *

After dock latches have engaged:
PROBE EXTD/RETR tb - gray
(A-1,5,9,;B-3,7,11)
SECS PYRO ARM (2) - SAFE
SECS LOGIC (2) - OFF
EDS PWR - OFF
cb EDS (3) - open
DOCK PROBE EXTD/REL - OFF
DOCK PROBE RETRACT (2) - OFF
cb DOCK PROBE (2) - open
TAPE RCDR - off (ctr)
PCM BIT RATE - LOW
DAC/TV-off
S BD AUX TV - off (center)

6 POST DOCKING

RATE - HIGH
ATT DB - MAX
COAS PWR - OFF
cb RCS LOGIC (2) - open (verify)
TVC SERVO PWR #1 - OFF
THC,RHC - locked
EMS MODE - STBY
EMS FUNC - OFF
BMAG MODE (3) - RATE 2 (verify)
COUCHES - CDR-90°,CMP-0°,LMP-180°
LM PWR - OFF (verify)
TUNNEL LIGHTS - ON ~~02 HTR~~
02 HTR 3 - AUTO

DATE _____ DATE 3/29/71

7 EQUALIZE CM/LM PRESSURE (Decal) (pg S/2-4)

8 REMOVE TUNNEL HATCH (Decal) (pg S/2-5)

9 VERIFY DOCKING LATCHES (Decal) (pg S/2-10)

10 CONNECT LM UMBILICALS (Decal) (pg S/2-11)

11 INSTALL TUNNEL HATCH (Decal) (pg S/2-8)

LM TUNL VENT v1v - LM/CM ΔP
LM TUNNEL LIGHTS - OFF

12 PRE LM SEP & EJECTION

cb SIVB/LM SEP (2) - close (verify)
ΔV CG - LM/CSM (verify)
EMS FUNC - ΔV SET/VHF RNG
Slew ΔV ind to +100.0
EMS FUNC - ΔV
TAPE RCDR - HBR/RCD/FWD/CMD RESET
Cycle CRYO FANS
Load RCS DAP 21101, X1111
Load N22 att (monitor APS mnvr, hatch window)
90.0°, 257.0°, 354.6°
V60E, V63E (DAC - 6 fps)
GDC ALIGN
DET - RESET
cb SECS ARM (2) - close (verify)
Cue MSFN
SECS LOGIC (2) - on (up)
Obtain GO from MSFN
SECS PYRO ARM (2) - ARM
TVC SERVO PWR #1 - AC1/MNA
RHC & THC - ARMED
V37E 47E F 16 83 ΔVX,Y,Z (.1fps)
EMS MODE - NORMAL

3/29/71

DATE —

Start DAC

13 LM SEP & EJECTION
SIVB/LM SEP - on (up)
(___:___:___)

00:00 Start DET
CMC MODE - AUTO
00:05 Thrust -X (3 sec)

14 POST LM EJECTION
PRO

F37 00E
When CMC Acty lt out,
Key V66E
SECS PYRO ARM (2) - SAFE
SECS LOGIC (2) - OFF
cb SECS ARM (2) - open
cb SIVB/LM SEP (2) - open
O2 TK 3 ISOL vlv tb - gray (verify)
MAP CAMR ON - OFF
PAN CAMR PWR - OFF
SM/AC PWR - OFF
LV/SPS IND sw - GPI
TVC SERVO PWR (2) - OFF
EMS MODE - STBY
EMS FUNC - OFF
TAPE RCDR - off (ctr)
Stop DAC
PCM BIT RATE - LOW
AUTO RCS SEL AC ROLL or BD ROLL (4) - OFF
O2 HTR 3 - OFF

DATE _____

DATE 3/29/71

MNVR TO SIVB VIEW ATT
V49E

13:00 GO/NO GO for S-IVB YAW mnvr
17:30 GO/NO GO for S-IVB EVASIVE mnvr

*NO APS EVASIVE at 23:00 *
*Thrust +X (6 sec) *
*Monitor SIVB thru Hatch Window *

*Time from *Ejection *(min:sec) *	Att for viewing SIVB after RCS EVASIVE mnvr		
	Roll	Pitch	Yaw
* 25:00	69.3°	237.5°	0.0°
* 30:00	90.0°	257.0°	1.0°

cb DIRECT ULLAGE (2) - open
TRANS CONT PWR - OFF
ROT CONTR PWR DIR (2) - OFF
RHC & THC - LOCKED
REPRESS PKG vlv - OFF
cb 02 ISOL/AUX BAT - open

*If no TLI: *
* SIVB - CSM/LM SEP (Earth orbit) *
*

*min-sec	Event	Inertial Att R	P	Y
*00:00	Ejection	____	____	____
*00:05	3 sec -X			
*00:22	Mnvr	90.0°	257.0°	354.6°
*03:00	6 sec -X			

3/29/71 DATE

DATE

ABORT PROCEDURES

MODE IA ABORT
(00:00 to 00:42) (10K)

00:00 TRANS CONTR - CCW then NEUTRAL
CM/SM SEP (2) - on (up)
ELS - AUTO
00:14 ELS LOGIC - on (up)
TWR JETT (2) - on (up)
APEX COVER JETT PB - PUSH
00:16 DROGUE DEPLOY PB - PUSH
00:18 CM RCS He DUMP PB - PUSH
Monitor altimeter
If <alidade - DEPLOY MAINS
>alidade - NO ACTION

00:28 If <10,000 ft - DEPLOY MAINS

Note: Alidade set for 3800 ft true altitude prior to Launch

GO TO LANDING PHASE pg L/4-8

MODE IB ABORT
(00:42 to 16.5 nm)

00:00 TRANS CONTR - CCW then NEUTRAL
CM/SM SEP (2)-on (up)
ELS - AUTO
00:11 CANARD DEPLOY - PUSH

00:14 ELS LOGIC - on (up)
RCS CMD - ON

GO TO LANDING PHASE pg L/4-8

MODE IC ABORT
(16.5 nm to TWR JETT)

00:00 TRANS CONTR - CCW then NEUTRAL
CM/SM SEP (2) - on (up)
RCS CMD - ON

00:11 CANARDS DEPLOY
CM RCS PRESS - on (up)
RCS TRNFR - CM
RCS IND - CM (1 or 2)
C/W MODE - CM

S/C PLATFORM GO/NO GO (Excessive Rates)
KEY RLSE to N44, Check HA

HA>32nm & PLAT GO	HA<32nm or PLAT NO GO
TWR JETT sw(2)-on(up)	Estab. +5°/SEC
MAN PITCH - RATE CMD	pitch rate
ENT ATT R0°,P135°,Y0°	EXCESSIVE + PITCH RATES
BMAG (3)- ATT1/RATE 2	
EMS FUNC - ENTRY	*ROLL 90° *
EMS MODE - NORMAL	*USE YAW THRUSTERS TO *
At .05G Lt,	*CONTROL RATE *
.05G sw - on (up)	*ROLL BACK TO HEADS DN*
Fly Max Lift	
	θ (.05G)_____
	GET DROGUE_____

GO TO LANDING PHASE pg L/4-8

LET FAILS TO JETTISON
LEGS CUT/NO MOTOR FIRE (pyro audible)
LES MOTOR FIRE PB - push
NO RESPONSE to ABORT SYS TWR JETT switches
cb SECS ARM (2) - close (verify)
cb SECS LOGIC (2) - close (verify)
cb EDS (3) - close (verify)
SECS LOGIC (2) - on (up) (verify)
SECS PYRO ARM (2) - on (up) (verify)
EDS PWR - on (up) (verify)
ABORT SYS TWR JETT (2) - on (up) (verify)
NO TWR JETT - continue to orbit
ABORT SYS TWR JETT (2) - off (ctr)

MODE II RCS ABORT
(TWR JETT to MODE III)

00:00 TRANS CONTR - CCW (4 sec min)
No BECO-Reset THC,Req. RSO Shutdown
*Reset & start DET *

00:03 *CSM/LV SEP - PUSH*
*RCS CMD - ON *

THC - ARMED
00:05 TRANS CONTR - NEUTRAL THEN +X

00:24 TRANS CONTR +X OFF
KEY RLSE to N44, Check TFF
If TFF>2 min, Yaw 45° (LEFT) out-of-plane
BMAG MODE (3) - ATT1/RATE 2
cb MNA&B BAT C (2) - closed
CM/SM SEP - on (up)
CM RCS PRESS - on (up)
RCS TRNFR - CM
C&W MODE - CM
Entry ATT - (R=0°,P=120°,Y=0°)(Compl by 1:40)
CSM/LM FNL SEP (2) - on (up)
EMS FUNC - ENTRY GET 300K_____
EMS MODE - NORMAL θ (.05G)_____
GET DROGUE_____

At .05G lt - on
.05G sw - on (up)
EMS ROLL - on (up)
Fly Max. Lift
N62E VI, HDOT, H

DATE 3/29/71

GO TO LANDING PHASE pg L/4-8

MODE III SPS ABORT
(ΔR= -400 NM to INSERTION)

00:00 TRANS CONTR - CCW (4 Sec Min)
*NO BECO - RESET THC, *
* LV STAGE sw - SII/SIVB*
*Reset & start DET *

00:03 *CSM/LV SEP - PUSH*
*RCS CMD - ON *

THC - ARMED
00:05 TRANS CONTR - NEUTRAL THEN +X
LV/SPS IND sw - GPI

00:24 TRANS CONTR +X OFF
N50E ΔR,HP,TFF (.1nm,min-sec)
BMAG MODE (3) - ATT1/RATE2
If ΔR>0:
MNVR to retro att (R=180°,P=194°,Y=0°)
(Scribe on horiz, BEF, Hds up)
SCS TVC P&Y - AUTO (verify)
EMS MODE - NORMAL
ΔV THRUST A - NORMAL
02:05 DIRECT ULLAGE PB - PUSH
THRUST ON PB - PUSH
Burn to VC (ΔR=0)
ΔV THRUST (2) - OFF

If TFF>2min,Yaw 45°(LEFT)
out-of-plane
cb MNA&B BAT C(2) - closed
CM/SM SEP - on (up)
CM RCS PRESS - on (up)
RCS TRNFR - CM
C&W MODE - CM
Mnvr to entry att (R=0°,P=105°,Y=0°)
(BEF, Hds Dn, Full Lift)
CSM/LM FNL SEP (2) - on (up)
Note TFF

GETI _____
(6999.9)
ΔV _____
VC _____
θ _____
Δtb _____
GET 300K _____
θ (.05G) _____
GET Drogue _____

DATE 5/28/71

MODE II, MODE III

EMS MODE - STBY
EMS FUNC - ENTRY
EMS MODE - NORMAL
At .05G lt - on
.05G sw - on (up)
EMS ROLL - on (up)
At .2G lt - on
Roll left 55°
Fly Half Lift

GO TO LANDING PHASE pg L/4-8

MODE III, MODE IV

DATE 3/29/71

MODE IV SPS TO ORBIT
(VI ~ 22,695, HDOT ~ +97, H ~ +93)

00:00 TRANS CONT - CCW (4 sec min)
*NO BECO-RESET THC, *
* LV STAGE sw - SII/SIVB *
*RESET & START DET *

00:03 *CSM/LV SEP - PUSH*
*RCS CMD - ON *

THC - ARMED
00:05 TRANS CONTR - NEUTRAL THEN +X
LV/SPS IND sw - GPI

00:24 TRANS CONTR - +X OFF

Perform PITCH PROFILE or FIXED ATTITUDE BURN:

PITCH PROFILE (AUTO TVC, tw trim)
BMAG MODE (3) - ATT1/RATE2
EMS MODE - NORMAL
SCS TVC (2) - AUTO (verify)
ΔV THRUST A - NORMAL
DIRECT ULLAGE PB - PUSH
<01:30 THRUST ON PB - PUSH
BMAG MODE (PITCH) - RATE 1
FLY HDOT with thumbwheel
Burn to (hp >70 nm +6 sec BT)
* or (ha = 200 nm & +HDOT) *
ΔV THRUST (2) - OFF
EMS MODE - STBY

or FIXED ATTITUDE BURN (Scribe on horiz, SEF, Hds Dn)
BMAG MODE (3) - ATT1/RATE2
EMS MODE - NORMAL
SCS TVC (2) - AUTO (verify)
ΔV THRUST A - NORMAL
DIRECT ULLAGE PB - PUSH
02:05 THRUST ON PB - PUSH
BURN to VC (hp >70nm)
ΔV THRUST (2) - OFF
EMS MODE - STBY

GETI _____
6999.9
ΔV _____
VC _____
θ _____
Δtb _____

Record VI _____ (fps)
H DOT _____ (fps)
H PAD _____ (.1nm)

KEY RLSE

Record HA _____ (.1nm)
HP _____ (.1nm)
TFF _____ (min-sec)

PRO

V37E 00E
When CMC ACTY lt out:
V66E
V45E
Load DAP, V48: R1=11102, R2=01111
V46E
V83E (check θ)
PRO

CSM WT _____
P TRIM _____
Y TRIM _____

US LOS
(00:16:06)

GO TO INSERTION CHECKLIST pg L/2-11

DATE 5/5/71

LANDING PHASE (30K, DESCENDING)

30K' ELS LOGIC - on (up)
ELS - AUTO

24K' Twr jett (auto)
*TWR JETT (2) - on (up) *
*CSM/LM FNL SEP(2)-on(up) *
Apex cover jett (auto)
*APEX COVER JETT PB-PUSH) *
(WAIT 2 SECS)
Drogues deployed (auto)
DROGUE DPLY PB-PUSH
If Both drogues Fail:
*ELS - Man *
*STABILIZE CM *
5K' MAIN DPLY PB - PUSH
*ELS - AUTO *

LANDING PHASE — 49 sec

23.5K' Cabin Pressure increasing
*If not increasing by 17K': *
*CABIN PRESS REL v1v (RH)-DUMP *

10K' Main parachutes deployed
MAIN DEPLOY PB - PUSH (within 1 sec)
VHF ANT - RECY
VHF AM A - SIMPLEX
VHF BCN - ON
CABIN PRESS REL v1v (2) - CLOSE
DIRECT O2 v1v - OPEN (verify)
RCS DUMP (Auto for Mode IA)
CM RCS LOGIC - on (up)
If main or pyro bus lost,
* use RHC's for burn, *
* not DUMP sw *
CM PRPLNT - DUMP (burn audible)
MONITOR CM RCS 1&2 for He press decrease
If no burn or press decrease,
* use both RHC's *
*DO NOT FIRE PITCH JETS *
CM PRPLNT - PURGE
*CM RCS He DUMP PB - PUSH *
RHC (2) - 30 secs, NO PITCH
CABIN PRESS REL v1v - BOOST/ENTRY

STRUT LOCKS (4) - UNLOCK
(275) cb FLT & PL BAT BUS A,B,&BAT C (3) - close
cb FLT & PL MNA & B (2) - open
(5) cb BAT RLY BUS (2) - open
cb RAD HTRS OVLD (2) - open
(8) cb SPS P&Y (4) - open

3K' CM RCS PRPLNT (2) - OFF (terminates purge)
CABIN PRESS REL vlv (RH) - DUMP
FLOOD Lts - POST LDG
ELS - AUTO (verify)
ELS LOGIC - ON (verify)

800' CAB PRESS REL vlv - CLOSE (latch off)
MN BUS TIE (2) - OFF

Go to POSTLANDING PROCEDURES, pg L/9-2

DATE 3/29/71

PRE-TLI ABORT
FROM ORBIT

PRE-TLI ABORT FROM ORBIT

1 MNVR TO SEP ATT
LV GUID - CMC
Pitch SIVB to Hds up, BEF, 15°
window mk on horizon
Then, LV GUID - IU for orb rate

2 LOAD RCS DAP
R1 = 11102, R2 = 01111
V46E

3 DON MAE WESTS & FOOT RESTRAINTS

4 FINAL STOWAGE
ORDEAL
(377) GLY TO RAD SEC vlv - BYPASS (verify)
Verify EVA COUCH STRUT disengaged
(382) Cool pnl installed
Y-Y struts (2) extended
Stow Data Box R-12
Attach both strut unlock lanyards
WASTE MGMT DRAIN vlv - OFF

5 SYSTEMS TEST PANEL CONFIGURATION
SYS TEST METER -5B (BAT RLY BUS 3.4-4.1 vdc)
(101) CM RCS HTRS - OFF (verify)
WASTE H2O DUMP HTR - OFF
URINE DUMP HTR - OFF
(100) LEB FLOOD & INTGL LIGHTING - OFF

6 PYRO BATT CK
(250) cb PYRO A SEQ A - close (verify)
cb PYRO B SEQ B - close (verify)
DC IND - PYRO BAT A(B)
*If PYRO BAT A(B) < 35 vdc *
*cb PYRO A(B) seq A(B) - open *
cb PYRO A(B)BAT BUS A(B) TO PYRO
* BUS TIE - close *
(275) cb MNA BAT C - close
cb MNB BAT C - close
DC IND - MNB

7 CONFIGURE PNL 8

All cb's closed except:
DOCKING PROBE (2) - open (verify)
CM RCS HTRS (2) - open (verify)
FLOAT BAG (3) - open (verify)
SECS ARM (2) - open (verify)
ELS/CM-SM SEP (2) - open (verify)
PL VENT - open (verify)

8 CM RCS ACTIVATION

(8) cb ELS/CM-SM SEP (2) - close
cb SECS ARM(2) - close
Cue MSFN
SECS LOGIC (2) - on(up)
MSFN confirm GO for PYRO ARM (if poss)
SECS PYRO ARM (2) - ARM
CM RCS PRPLNT 1&2 tb(2) - gray (verify)
CM RCS PRESS - ON
RCS IND sw - CM1, then 2
He PRESS stabilizes at 3300-3500
psia after 15 minutes
MANF PRESS 287-302 psia
SECS PYRO ARM (2) - SAFE

9 Set DET (counting up to deorbit burn)

10 CSM/LV SEPARATION PREP

SM RCS PRPLNT tb (8) - gray (verify)
AUTO RCS SELECT (16) - MNA/MNB
Set ΔVC to -100.0
EMS FUNC - ΔV
FDAI SCALE - 5/1
MAN ATT (3) - RATE CMD
LIMIT CYCLE - OFF (verify)
ATT DB - MIN
RATE - LOW
TRANS CONT PWR - on (up) (verify)
ROT CONT PWR NORMAL (2) - AC/DC (verify)
ROT CONT PWR DIRECT (2) - MNA/MNB (verify)
CMC MODE - FREE (verify)
SC CONT - CMC
BMAG MODE (3) - RATE 2 (verify)
cb RCS LOGIC (2) - close (verify)
TVC SERVO PWR #1 - AC1/MNA
FC REAC vlv - LATCH

DATE 3/29/71

DATE

11 CSM/LV SEPARATION

THC - ARMED
RHC #2 - ARMED
cb SECS LOGIC (2) - closed (verify)
cb SECS ARM (2) - closed (verify)
SECS LOGIC (2) - on (up) (verify)
RCS CMD - ON
TAPE RCDR - HBR/RCD/FWD/CMD RESET
SECS PYRO ARM (2) - ARM
GDC ALIGN
EMS FUNC - ΔV (verify)
EMS MODE - NORMAL

38:00 V37E 47E
39:50 CMC MODE - AUTO
39:58 Thrust +X and hold
40:00 CSM/LV SEP pb - push, hold, and release
(-20:00min) LV TANK PRESS - full scale Low

*No Separation: *
* THC - CCW (leave in detent) *
* DET reset and counting up (auto) *
* LV TK PRESS - full scale low (SEP ind)*
*00:03 THC - +X, neutral & hold *
*00:24 THC - release *

SM RCS PRPLNT tb(8) - gray (verify)
SM RCS He tb (8) - gray (verify)
SM RCS SEC PRPLNT FUEL PRESS (4) - CLOSE
FC REAC vlv - NORM
~40:24 ΔV = 5 fps
THC - release
SECS PYRO ARM (2) - SAFE
cb EDS (3) - open
PCM BIT RATE - LOW

12 Go to SPS DEORBIT & ENTRY, pg L/8-1

*If time permits, after mnvr to Burn Att: *
* Perform EMS ENTRY CHECK, pg L/5-2 & *
* EMS ΔV TEST & NULL BIAS CHECK, pg G/2-5*

DATE 3/29/71

DATE

TLI 90 MIN ABORT
(Return to targeted splash point;
SPS burn at SIVB C/O +90 min)

V37E 47E

If abort decision occurs after CSM/LV separation, go to 00:14.

SECS LOGIC (2) - on (up)(verify)
SECS PYRO ARM (2) - ARM

(TLI+25min)

00:00 TRANS CONTR - CCW (4 sec)
DET RESET (verify)

00:03 SIVB/CSM SEP
LV ENG 1 Lt - out
CSM/LV SEP PB - PUSH
*RCS CMD-ON *
THC - ARMED

00:05 TRANS CONTR - NEUTRAL THEN +X
LV/SPS IND sw - GPI

00:14 TRANS CONTR +X - OFF
PITCH UP to LOCAL VERT (+X axis toward the earth)
RATE - LOW
BMAG MODE (3) - ATT1/RATE 2
EDS PWR - OFF
SECS PYRO ARM (2) - SAFE
SECS LOGIC (2) - OFF
cb SECS ARM (2) - open
cb EDS (3) - open

01:00 TRANS CONTR +X (8 to 10 sec)
V37E 00E
RATE - HIGH

MNVR TO RETRO ATT
R _____ (Block Data)
P _____ (Block Data)
Y _____ (Block Data)

DATE 3/29/71

TLI 90 MIN ABORT

RETRO UPDATE (NO COMM - use Block Data)

GETI _____ θ .05G _____

ΔV _____ GET DROGUE _____
VC _____ ENTRY R _____
Δtb _____ P _____
GET 400K _____ Y _____

If time permits, go to G&N thrusting procedures;
if time critical, continue with SCS ΔV.
(Circle is marking EPS Group 5, two close (verify)

XX:XX Set DET counting up to GETI
GDC ALIGN
EMS FUNC - ΔV SET/VHF RNG
SET ΔVc ABORT SET ΔVc = 129
EMS FUNC - ΔV

TVC CHECK & PREP

(8) cb STAB CONT SYS (all) - close cb SPS pilot
cb SPS (10) - close
MAN ATT (3) - RATE CMD
LIMIT CYCLE - on (up)
ATT DB - MIN
RATE - LOW
TRANS CONT PWR - ON
SCS TVC (2) - RATE CMD
ΔV CG - CSM/LM
TVC GMBL DRIVE P&Y - AUTO

(54:00) MN BUS TIE (2) - ON
(-06:00) TVC SERVO PWR #1 - AC1/MNA
TVC SERVO PWR #2 - AC2/MNB
ROT CONTR PWR NORMAL (2) - AC
ROT CONT PWR DIRECT (2) - OFF
BMAG MODE (3) - ATT1/RATE2
SC CONT - SCS
RHC #2 - ARMED

(55:00) PRIMARY TVC CHECK
(05:00) GMBL MOT P1-Y1 - START/ON (LMP Confirm)
Verify TRIM CONTROL & SET
Verify MTVC
SCS TVC (2) - AUTO
THC - CW
Verify NO MTVC

SEC TVC CHECK
GMBL MOT P2-Y2 - START/ON (LMP Confirm)
SET GPI TRIM
Verify MTVC
THC NEUTRAL
Verify GPI returns to trim
Verify NO MTVC
ROT CONT PWR NORM (2) - AC/DC
ROT CONT PWR DIRECT (2) - MNA/MNB
FDAI SCALE - 5/5
LIMIT CYCLE - OFF
~~RATE - HIGH~~
UPDATE DET
SPS He vlvs (2) - AUTO (verify)

(58:00)
(-02:00) ΔV THRUST A(~~B~~) - NORMAL
V37E 47E
THC - ARMED
RHC (2) - ARMED
(59:30) TAPE RCDR - HBR/RCD/FWD/CMD RESET
(-00:30) EMS MODE - NORMAL

DATE 3/29/71

00:00 ~~ULLAGE & THRUST ON PB - PUSH~~
~~SPS THRUST Lt - ON~~
00:03 ~~ΔV THRUST B(A) - NORMAL~~
~~ULLAGE & THRUST ON PB - PUSH~~

~~MONITOR THRUSTING~~
~~Pc 95-105 psia~~
EMS COUNTING DOWN
SPS INJ VLVS (4)2 - OPEN
SPS He vlvs tb-gray
SPS FUEL/OXID PRESS - 170-195 psia
~~PUGS - BALANCED~~

DATE

00:XX ECO

ΔV THRUST A&B - OFF
VERIFY THRUST OFF
SPS INJ VLVS (4) - CLOSED
SPS He vlvs tb (2) - bp
GMBL MTRS (4) - OFF (LMP Confirm)
TVC SERVO PWR 1&2 - OFF
MN BUS TIE (2) - OFF

19 F 16 83 ΔV XYZ (CM) (.1fps)
RECORD ΔVC _____
EMS FUNC - OFF ΔVX _____
EMS MODE - STBY ΔVY _____
ΔVZ _____

ATT DB - MAX
TRANS CONT PWR - OFF
ROT CONTR PWR DIRECT (2) - OFF
BMAG MODE (3) - RATE 2
TAPE RCDR - off (ctr)
PCM BIT RATE - LOW
PRO
F37 00E
When CMC Acty lt out:
V66E

Go to ENTRY PREP & SUPERCIRC ENTRY PROCEDURE
pg E/1-1

DATE _____ DATE 3/29/71

L
5-1

EARTH ORBIT ENTRY VEHICLE PREPARATION

1 INITIAL STOWAGE COMPLETED

2 CMC POWER UP pg G/2-2

3 IMU POWER UP pg G/2-1

4 SCS POWER UP pg G/2-4

5 P51 - IMU ORIENTATION pg G/6-1

6 LOAD DAP
V48E T1102, 01111, PRO, PRO, PRO

7 DON MAE WESTS & FOOT RESTRAINTS

8 (__:__:__) P27 (SV,REFSMMAT), MNVR & ENTRY PAD UPDATES

9 ECS CKS
O2 SUPPLY REFILL pg S/1-7
PGA verification, (if suited)S/1-11
ECS Monitor Ck pg S/1-5
(382) EVAP H2O CONT PRI vlv - AUTO
EVAP H2O CONT SEC vlv - AUTO
SUIT HEAT EXCH SEC GLY - FLOW

10 EPS CKS #1, 3, 4 (5 if req'd) pg S/1-2

11 SPS CK (If req'd) pg S/1-1

12 RCS CKS
SM RCS Monit Ck pg S/1-1
CM RCS Monit Ck pg S/1-1

13 C&W SYS CK pg S/1-17

14 CMC SELF CK pg G/2-3

15 DSKY COND LT TEST pg G/1-23

DATE 3/29/71

EARTH ORBIT ENTRY VEHICLE PREP

EARTH ORBIT ENTRY
VEHICLE PREP

16 LOGIC SEQUENCE CK
(8) cb SECS LOGIC (2) - close (verify)
cb SECS ARM (2) - close
cb ELS/CM-SM SEP (2) - close
ELS LOGIC - on (up)
ELS - AUTO
Coordinate next 3 steps with MSFN
SECS LOGIC (2) - on (up)
MSFN confirm GO for PYRO ARM as req'd
SECS LOGIC (2) - OFF
cb SECS ARM (2) - open
ELS LOGIC - OFF
ELS - MAN
cb ELS/CM-SM SEP (2) - open

17 (__:__:__) P52-IMU REALIGN pg G/6-2 (OPTION 3)
Record gyro torquing angles
R _____
P _____
Y _____
*If >1°, recycle P52 *
If confirmed, use SCS for
* EMS entry *

18 GDC ALIGN
If drift >10°/hr, change rate source

19 EMS ENTRY CHECK
EMS FUNC - OFF
(8) cb EMS (2) - close
EMS MODE - STBY
EMS FUNC - EMS TEST 1 (wait 5 sec)
EMS MODE - NORMAL (wait 10 sec)
Check ind lts - off
RANGE ind - 0.0
Slew hairline over notch
in self-test pattern
EMS FUNC - EMS TEST 2 (wait 10 sec)
.05G lt - on (all others out)
EMS FUNC - EMS TEST 3
.05G lt - on
RSI lower lt - on (10 sec later)
Set RANGE counter to 58 nm±0.0

DATE 3/29/71

EMS FUNC - EMS TEST 4
.05G lt - on (all others out)
G-V trace within pattern to lwr rt corner @9G
RANGE ind counts down to 0±0.2
EMS FUNC - EMS TEST 5
.05G lt - on
RSI upper lt - on (10 sec later)
RANGE ind - 0.0
Scribe traces vertical line 9g to 0.28±0.1
ALIGN SCROLL TO ENTRY PATTERN (on 37K ft/sec line)
EMS FUNC - RNG SET
G-V scroll assy traces vert. line 0.28g to 0±0.1
EMS MODE - STBY

20 Perform EMS ΔV TEST & NULL BIAS CHECK, Pg G/2-5

21 PRIMARY WATER EVAP ACTIVATION
GLY EVAP H2O FLOW - AUTO
GLY EVAP STM PRESS - AUTO
PRI ECS GLY PUMP - AC1 (verify)

22 SEC WATER EVAP ACTIVATION
ECS IND sel - SEC
SEC COOL LOOP PUMP - AC2
GLY DISCH SEC PRESS - 39-51 psig
SEC COOL LOOP EVAP - EVAP
SEC GLY EVAP OUT TEMP - 38-50.5°F
SUIT CKT HT EXCH - BYPASS 20 sec,OFF
ECS IND sel - PRIM

23 SET UP CAMERA
CM4/DAC/18/CIN - BRKT, MIR
(T16,250,7) 12 fps, MAG K

DATE 3/29/71

DATE

24 (-01:00h) CM RCS PREHEAT

Note: If sys test mtr 5c,d,6a,b,c,d all read 3.9 vdc (28°F) or more, omit preheat

(8) cb RCS LOGIC (2) - close
CM RCS LOGIC - on (up)
cb CM RCS HTRS (2) - close
(101) CM RCS HTRS - ON (LMP Confirm) (20 min or til lowest rdg is 3.9 vdc) (Monitor Manf press for press drop)

25 FINAL STOWAGE

ORDEAL
(377) GLY TO RAD SEC v1v - BYPASS (verify)
Verify EVA COUCH STRUT disengaged
(382) Cool pnl installed
Y-Y struts (2) extended
Stow Data Box R-12
Attach both strut unlock lanyards
Check for water in tunnel area
Stow gas separator (A8)
Stow Cl injector (R6)
WASTE MGMT DRAIN v1v - OFF
Remove & Stow URA, urine transfer hose and urine filter

26 (-00:40m) TERM. CM RCS PREHEAT

(101) CM RCS HTRS - OFF (LMP confirm)
CM RCS LOGIC - OFF
(8) cb CM RCS HTR (2) - open

27 SYSTEMS TEST PANEL CONFIGURATION

SYS TEST METER - 5B (BAT RLY BUS 3.4-4.1 vdc)
(101) CM RCS HTRS - OFF (verify)
WASTE H2O DUMP HTR - OFF
URINE DUMP HTR - OFF
(100) LEB FLOOD & INTGL LIGHTING - OFF

DATE 3/29/71

28 PYRO BATT CK

(250) cb PYRO A SEQ A - close (verify)
cb PYRO B SEQ B - close (verify)
DC IND - PYRO BAT A(B)
*If PYRO BAT A(B) < 35 vdc *
*cb PYRO A(B) seq A(B) - open *
cb PYRO A(B)BAT BUS A(B)TO PYRO
* BUS TIE - close*
(275) cb MNA BAT C - close
cb MNB BAT C - close
DC IND - MNB

29 CONFIGURE PNL 8

All cb's closed except:
CM RCS HTRS (2) - open (verify)
DOCKING PROBE (2) - open (verify)
FLOAT BAG (3) - open (verify)
SECS ARM (2) - open (verify)
EDS BAT (3) - open (verify)
ELS/CM-SM SEP (2) - open (verify)
PL VENT - open (verify)

30 FINAL GDC DRIFT CK (if req'd)

If drift >10°/hr, Suspect GDC,
Do not use RSI & FDAI #2

31 CM RCS ACTIVATION

(8) cb ELS/CM-SM SEP (2) - close
cb SECS ARM (2) - close
Cue MSFN
SECS LOGIC (2) - on(up)
MSFN confirm GO for PYRO ARM (if poss)
SECS PYRO ARM (2) - ARM
CM RCS PRPLNT 1&2 tb(2)-gray (verify)
CM RCS PRESS - on (up)
RCS IND sw - CM1, then 2
He PRESS stabilizes at 3300-3500
psia after 15 minutes
MANF PRESS 287-302 psia
SECS PYRO ARM (2) - SAFE

DATE 3/29/71 DATE

32 (Hybrid only) DOCKING RING JETTISON (if req'd)
(Deorbit-20:00m)
SECS PYRO ARM (2) - ARM
YAW 45° out of plane
CSM/LM FNL SEP (2) - on (up)
SECS PYRO ARM (2) - SAFE

33 P27 & ENTRY PAD UPDATE

HYBRID RCS DEORBIT & ENTRY, pg L/6-1
SM RCS DEORBIT & ENTRY, pg L/7-1
SPS DEORBIT & ENTRY, pg L/8-1

DATE _____

DATE 3/29/71

L/5-7

E. O. ENTRY UPDATE

X						X						AREA
X	X	-				X	X	-				ΔV TAILOFF
X	X	X				X	X	X				R 0.05G EMS
X	X	X				X	X	X				P 0.05G
X	X	X				X	X	X				Y 0.05G
+						+						RTGO EMS
+						+						VIO
X	X					X	X					RET 0.05G
	0						0					LAT N61
												LONG
X	X					X	X					RET 0.2G
												DRE (55°) N66
R	R					R	R					BANK AN
X	X					X	X					RET RB
X	X					X	X					RETBBO
X	X					X	X					RETEBO
X	X					X	X					RETDROG
X	X	X				X	X	X				(90°/fps) CHART
X	X					X	X					DRE (90°) UPDATE
POST BURN												
X	X	X				X	X	X				P 0.05G
+						+						RTGO EMS
+						+						VIO
X	X					X	X					RET 0.05G
X	X					X	X					RET 0.2G
												DRE ±100 nm N66
R	R					R	R					BANK AN
X	X					X	X					RETRB
X	X					X	X					RETBBO
X	X					X	X					RETEBO SEC
X	X					X	X					RETDROG TO MAIN

L/5-8	E. O. ENTRY UPDATE	
X ±	X ±	AREA
X X - .	X X - .	ΔV TAILOFF
X X X	X X X	R 0.05G EMS
X X X	X X X	P 0.05G
X X X	X X X	Y 0.05G
+ .	+ .	RTGO EMS
+	+	VIO
X X .	X X .	RET 0.05G
0 .	0 .	LAT N61
.	.	LONG
X X .	X X .	RET 0.2G
.	.	DRE (55°) N66
R R /	R R /	BANK AN
X X .	X X .	RET RB
X X .	X X .	RETBBO
X X .	X X .	RETEBO
X X .	X X .	RETDROG
X X X .	X X X .	(90°/fps) CHART
X X .	X X .	DRE (90°) UPDATE
POST BURN		
X X X	X X X	P 0.05G
+ .	+ .	RTGO EMS
+	+	VIO
X X .	X X .	RET 0.05G
X X .	X X .	RET 0.2G
.	.	DRE ±100 nm N66
R R /	R R /	BANK AN
X X .	X X .	RETRB
X X .	X X .	RETBBO
X X .	X X .	RETEBO
X X .	X X .	RETDROG

SEC TO MAIN

DATE 3/29/71

EARTH ORBIT BLOCK DATA

L/5-9

X	X									X	X					-				AREA
X	X	X						.		X	X	X						.		LAT
X	X							.		X	X							.		LONG
			:			:							:			:				GETI
X	X	X						.		X	X	X						.		ΔV_C
X	X									X	X					-				AREA
X	X	X						.		X	X	X						.		LAT
X	X							.		X	X							.		LONG
			:			:							:			:				GETI
X	X	X						.		X	X	X						.		ΔV_C
X	X									X	X					-				AREA
X	X	X						.		X	X	X						.		LAT
X	X							.		X	X							.		LONG
			:			:							:			:				GETI
X	X	X						.		X	X	X						.		ΔV_C
X	X									X	X					-				AREA
X	X	X						.		X	X	X						.		LAT
X	X							.		X	X							.		LONG
			:			:							:			:				GETI
X	X	X						.		X	X	X						.		ΔV_C
X	X									X	X					-				AREA
X	X	X						.		X	X	X						.		LAT
X	X							.		X	X							.		LONG
			:			:							:			:				GETI
X	X	X						.		X	X	X						.		ΔV_C

REMARKS:

EARTH ORBIT BLOCK DATA

X	X						X	X				–		AREA
X	X	X				.	X	X	X				.	LAT
X	X					.	X	X					.	LONG
			:		:					:		:		GETI
X	X	X				.	X	X	X				.	ΔV_C
X	X						X	X				–		AREA
X	X	X				.	X	X	X				.	LAT
X	X					.	X	X					.	LONG
			:		:					:		:		GETI
X	X	X				.	X	X	X				.	ΔV_C
X	X						X	X				–		AREA
X	X	X				.	X	X	X				.	LAT
X	X					.	X	X					.	LONG
			:		:					:		:		GETI
X	X	X				.	X	X	X				.	ΔV_C
X	X						X	X				–		AREA
X	X	X				.	X	X	X				.	LAT
X	X					.	X	X					.	LONG
			:		:					:		:		GETI
X	X	X				.	X	X	X				.	ΔV_C
X	X						X	X				–		AREA
X	X	X				.	X	X	X				.	LAT
X	X					.	X	X					.	LONG
			:		:					:		:		GETI
X	X	X				.	X	X	X				.	ΔV_C

REMARKS:

E.O. BLOCK DATA

DATE 3/29/71

P30 MANEUVER

L/5-11

SET STARS

R ALIGN ___ ___ ___

P ALIGN ___ ___ ___

Y ALIGN ___ ___ ___

ULLAGE ___

___

___

___

HORIZON/WINDOW ___

___

___

___

OTHER ___

___

___

DATE 3/29/71

							PURPOSE
		/					PROP/GUID
+							WT N47
	0	0					P TRIM N48
	0	0					Y TRIM
+	0	0					HRS GETI
+	0	0	0				MIN N33
+	0						SEC
							ΔV X N81
							ΔV Y
							ΔV Z
X	X	X					R
X	X	X					P
X	X	X					Y
+							H A N44
							H P
+							ΔVT
X	X	X					BT
X							ΔVC
X	X	X	X				SXTS
+						0	SFT
+					0	0	TRN
X	X	X					BSS
X	X						SPA
X	X	X					SXP
	0						LAT N61
							LONG
+							RTGO EMS
+							VIO
							GET 0.05G

P30 MNVR PAD

HYBRID RCS DEORBIT & ENTRY

VEHICLE PREP COMPLETE

P30 - EXTERNAL ΔV
V37E 30E

2 F 06 33 GETI (hr,min,.01sec)
(ACCEPT) PRO
(REJECT) LOAD DESIRED GETI

3 F 06 81 ΔVX,Y,Z (LV) (.1fps)
(ACCEPT) PRO
(REJECT) LOAD DESIRED DATA

4 F 06 42 HA,HP,ΔV (REQ) (.1nm,.1nm,.1fps)
Record ΔV _____
(ACCEPT) PRO
(REJECT) Reselect P30 or P27. Load new param.

5 F 16 45 M,TFI,MGA (marks,min-sec,.01°)
*MGA -00002: if *
* IMU not aligned*
SET DET
PRO

6 F 37 00E

7 SEPARATION CK LIST
PRIM GLY TO RAD - BYPASS (Pull)
REPRESS PKG vlv - FILL to 865-935,
then ON
O2 SM SUPPLY vlv - OFF
SURGE TK - ON (verify)
CAB PRESS REL vlv (2) - NORM
cb ELS/CM-SM SEP (2) - close (verify)
cb SECS ARM (2) - close (verify)
cb SECS LOGIC (2) - close (verify)
ROT CONTR PWR NORM (2) - AC/DC
ABORT SYS PRPLNT - RCS CMD
SM RCS SEC PRPLNT FUEL PRESS (4)-OPEN

DATE 3/29/71

8 CM RCS CHECK

AUTO RCS A/C ROLL (4) - OFF (verify)
cb RCS LOGIC (2) - closed (verify)
SC CONT - SCS
MAN ATT (3) - MIN IMP
RCS TRNFR - CM
AUTO RCS SEL (RING 1) - OFF
AUTO RCS SEL (RING 2) - MNB
TEST RING 2 THRUSTERS
AUTO RCS SEL (RING 1) - MNA
AUTO RCS SEL (RING 2) - OFF
TEST RING 1 THRUSTERS
AUTO RCS SEL (RING 2) - MNB
RCS TRNFR - SM
MAN ATT (3) - RATE CMD

9 RCS THRUSTING PREP

Load DAP
BMAG MODE (3) - RATE 2
SC CONT - CMC/AUTO

10 MNVR TO PAD BURN ATT (HDS DN)

V49E

R _____ (0°)
P _____ (180°)
Y _____ (0°)

11 PERFORM BORESIGHT & SXT STAR CHECK

V41 N91E
Stow optics eyepieces

12 V25 N17E (.01°)

Load Pad Data GMBL Angles
for CM BURN ATT
ATT SET tw - SET
to PAD DATA GMBL ANGLES
for CM BURN ATT

13 PWR REDUCTION
MN BUS TIE (2) - ON
HI GAIN ANT PWR - OFF
FC PUMPS (3) - OFF
FC 2 MNA - OFF
Verify loads balanced
VHF AM (A&B) - off (ctr)
(5) cb ECS RAD CONT/HTR (2) - open
cb RAD HTRS OVLD (2) - open
cb WASTE H2O/URINE DUMP HTRS(2)-open
POT H2O HTR - OFF
GLY EVAP TEMP IN - MAN

P41 - RCS THRUSTING

14 V37E 41E

15 F 50 18 REQ MNVR TO BURN ATT (HDS DN) (.01°)
(AUTO) BMAG MODE (3) - RATE 2
SC CONT - CMC/AUTO
PRO

16 06 18 AUTO MNVR TO FDAI RPY (.01°)

17 F 50 18 REQ TRIM (.01°)
ALIGN SC ROLL
(AUTO TRIM) PRO
ATT DB - MIN
RATE - LOW
BMAG MODE (3) - ATTI/RATE 2
If long Lambert (P37) burn
BMAG MODE (3) - RATE 2
ENTR

DATE 3/29/71

DATE

	55:00m			
18		06 85	VG X,Y,Z	(.1fps)
			RECHECK BORESIGHT STAR	
			TRANS CONTR PWR - on (up)	
			EMS MODE - STBY (verify)	
			EMS FUNC - ΔV SET/VHF RNG	
			SET ΔV for SM BURN = ΔV pad +100.0	
			EMS FUNC - ΔV	
			S BD OMNI ANT - C	
■			Cue MSFN	
			SECS LOGIC (2) - on (up)(verify)	
			MSFN confirm Go for PYRO ARM (if poss)	
			SECS PYRO ARM (2) - ARM	
			CM RCS LOGIC - on (up)	
	59:25			
19			DSKY BLANKS	
	59:30			
20		16 85	VG X,Y,Z (AVE G ON)	(.1fps)
			RHC's & THC - ARMED	
■			TAPE RCDR - HBR/RCD/FWD/CMD RESET	
			EMS MODE - NORMAL	

DATE _____

DATE 3/29/71

00:00

21 F 16 85 REQ NULL VG X,Y,Z (.1fps)
BURN EMS ΔV CTR TO 100
RESET DET & COUNT UP

THC - LOCKED
RATE - HIGH
SC CONT - SCS
PRIM GLY To RAD - BYPASS (verify)
MN BUS TIE (2) - ON (verify)

CM/SM SEP (2) - on (up)
MAN ATT PITCH - ACCEL CMD
MAN ATT ROLL & YAW - MIN IMP
BMAG MODE(3) - RATE 2

Hybrid V63E (N17, CM BURN ATT)
1 min *If CMC NO GO: *
* FDAI SOURCE - ATT SET*
* FDAI SEL - 1 or 2 *
* ATT SET - GDC *

C&W MODE - CM
RCS TRNFR - CM

Monitor V MNA/B:
If <25 vdc, go to EMERG POWER DOWN
MNVR TO CM BURN ATT(NULL ERR NEEDLES)
R 0°
(θ ~290) P _____ (~ 110° from SM BURN ATT)
Y 0°
CM RCS LOGIC - OFF
SECS PYRO ARM (2) - SAFE

DATE 3/29/71

22 CM RCS BURN
FDAI SCALE - 5/5
B/D ROLL & YAW - single ring
RHC #1-Continuous Pitch Down
RHC #2-Modulate Pitch to null needles
BURN VGZ TO ZERO
* If only 1 RHC *
* Pulse ± P=5° from retro att*
* Maintain rates <3°/sec *

DATE

23 BURN COMPLETION AT:
ΔV CTR= _____ or DET= _____

24 V82E

F 16 44 HA,HP,TFF (.1nm,min-sec)
Check HP <40nm:
If > Pad data, continue burn
until < Pad
PRO

25 F 16 85 VG X,Y,Z (.1fps)
Read VG residuals to MSFN
PRO

26 F 37 00E
When CMC ACTY lt out:
V66E
EMS FUNC - OFF
EMS MODE - STBY
MAN ATT (3) - MIN IMP
TRANS CONT PWR - OFF
BMAG MODE (3) - RATE 2
cb DIRECT ULLAGE (2) - open
TAPE RCDR - off (ctr)
PCM BIT RATE - LOW

27 EMS INITIALIZATION
If scroll not on 37K
* EMS FUNC - TEST 5 *
* Slew scroll to 37K*
EMS FUNC - RNG SET
Set RNG to PAD DATA RNG
EMS FUNC - Vo SET
Slew scroll to PAD DATA VIO
EMS MODE - STBY (verify)
EMS FUNC - ENTRY

28 RSI ALIGNMENT

FDAI SOURCE - ATT SET
ATT SET - GDC
EMS ROLL - on (up)
GDC ALIGN PB - PUSH & HOLD
YAW tw - Position RSI to LIFT DN
GDC ALIGN PB - RELEASE
EMS ROLL - OFF
ALIGN GDC TO IMU

P61 - ENTRY PREP

29 V37E 61E (AVE G ON)
05 09 01427 - ROLL REVERSED
*05 09 01426 - IMU UNSAT *

30 F 06 61 IMPACT LAT, LONG, HDS UP/DN (+/-)
(.01°,.01°,±00001)
PAD VALUES
LAT _____
LONG _____
HDS UP +1 _____
PRO

31 F 06 60 GMAX,V400K,GAMMA EI (.01G, fps,.01°)
Record
GMAX _____
V400K _____
GAMMA EI _____
PRO

DATE 3/29/71

32 F 16 63 RTOGO (.1nm) _____ PAD _____
VIO (fps) _____ PAD _____
TFE (min-sec) _____
If NO COMM, Set RTOGO & VIO in EMS
& initialize
(ACCEPT) PRO
(RECYCLE) V32E to 31 (TFE sensitive to oblateness)

DATE _____

P62 - CM/SM SEP & PRE-ENTRY MNVR

33 F 50 25 00041 REQUEST CM/SM SEP

MNVR TO ENTRY ATT
R 180° (Lift DN)
P
Y 0°
MAINTAIN HORIZ TRACK

PRO (Act ENTRY DAP Att Hold)

34 F 06 61 IMPACT LAT, LONG, HDS/DN
(.01°,.01°,-00001)

PRO (CMC Guidance)

35 POSS 06 22 FINAL ATT DISP, RPY (.01°)
(Only if X-axis beyond 45° of Vel vector)

P63 - ENTRY INIT

36 06 64 G,VI,RTOGO (.01G,fps,.1nm)
FDAI SCALE - 5/5
ROT CONTR PWR DIR(2) - MNA/MNB(verify)
TAPE RCDR - HBR/RCD/FWD/CMD RESET
HORIZ CK
Pitch error needle goes toward
zero approaching .05G time

DATE

DATE 3/29/71

P64 - ENTRY POST .05G

37 06 74 BETA, VI, G (.01°,fps,.01G)
Start DAC

RTOGO AT .05G AGREES WITH EMS-verify
HORIZ CK

.05G time
(+0__:__)
(__:__:__)

EMS MODE - BACKUP/VHF RNG
.05 G Lt - on
.05 G sw - on (up)
EMS ROLL - on (up)

Track horiz with 9° window mk
Maintain SCS control,
Lift DN until 1G

If CMC is GO:
MAN ATT(3) - RATE CMD
SC CONT - CMC
*If DAP NO GO: *
* SC CONT - SCS *
* Fly BETA *
*If CMC NO GO: *
* SC CONT - SCS *
* Fly EMS *

*If after 1G, both RCS ring *
* He press <1550 psia: *
* Roll 20°/sec & disable RCS*
* After peak G, enable RCS *
* & fly BETA = 90° *

NOTE: To monitor N68, Key V16 N68E
Compare RSI & FDAI
EMS GO/NO GO
G-V Plot within limits

DATE 3/29/71

DATE

P67 - ENTRY - FINAL PHASE (0.2G)

38 06 66 BETA,CRSRNG ERR,DNRNG ERR (.01°,.1nm,.1nm)
(+ is north & long)
KEY VERB
Record DNRNG ERR _____
KEY RLSE
Limit: ±100nm from PAD DRE
Monitor lift vector on RSI & FDAI
~~CM RCS: change rings when He PRESS <1150 psia~~

39 F 16 67 RTOGO,LAT,LONG (Vrel=1000fps)
(.1nm,.01°,.01°)
SC CONT - SCS
RTOGO NEG - LIFT UP
RTOGO POS - LIFT DOWN
Monitor altimeter
Record LAT,LONG,& voice to RECY at 10K'
Record EMS RTGO
EMS MODE - STBY
EMS FUNC - OFF
Stop DAC
DAC - T11

Go To EARTH/POST LANDING pg L/9-1

SM RCS DEORBIT & ENTRY

VEHICLE PREP COMPLETE

P30 - EXTERNAL ΔV
V37E 30E

1

2 F 06 33 GETI (hr,min,.01sec)
(ACCEPT) PRO
(REJECT) LOAD DESIRED GETI

3 F 06 81 ΔVX,Y,Z (LV) (.1fps)
(ACCEPT) PRO
(REJECT) LOAD DESIRED DATA

4 F 06 42 HA,HP,ΔV (REQ) (.1nm,.1nm,.1fps)
Record ΔV _____
(ACCEPT) PRO
(REJECT) Reselect P30 or P27. Load new param.

5 F 16 45 M,TFI,MGA (marks,min-sec,.01°)
*MGA -00002: if *
* IMU not aligned*
SET DET
PRO

6 F 37 00E

7 SEPARATION CK LIST
PRIM GLY TO RAD - BYPASS (Pull)
REPRESS PKG vlv - FILL to 865-935,
then ON
O2 SM SUPPLY vlv - OFF
SURGE TK - ON (verify)
CAB PRESS REL vlv (2) - NORM
cb ELS/CM-SM SEP (2) - close (verify)
cb SECS ARM (2) - close (verify)
cb SECS LOGIC (2) - close (verify)
ROT CONTR PWR NORM (2) - AC/DC
ABORT SYS PRPLNT - RCS CMD
SM RCS SEC PRPLNT FUEL PRESS (4)-OPEN

DATE 3/29/71

SM RCS
DEORBIT & ENTRY

8 CM RCS CHECK
AUTO RCS A/C ROLL (4) - OFF (verify)
cb RCS LOGIC (2) - closed (verify)
SC CONT - SCS
MAN ATT (3) - MIN IMP
RCS TRNFR - CM
AUTO RCS SEL (RING 1) - OFF
AUTO RCS SEL (RING 2) - MNB
TEST RING 2 THRUSTERS
AUTO RCS SEL (RING 1) - MNA
AUTO RCS SEL (RING 2) - OFF
TEST RING 1 THRUSTERS
AUTO RCS SEL (RING 2) - MNB
RCS TRNFR - SM
MAN ATT (3) - RATE CMD

9 RCS THRUSTING PREP
Load DAP
BMAG MODE (3) - RATE 2
SC CONT - CMC/AUTO

10 MNVR TO PAD BURN ATT (HDS DN)
V49E
R _____ (0°)
P _____ (180°)
Y _____ (0°)

11 PERFORM BORESIGHT & SXT STAR CHECK
V41 N91E
Stow optics eyepieces

12 P41 - RCS THRUSTING
V37E 41E

13	F	50	18 (AUTO)	REQ MNVR TO BURN ATT (HDS DN) BMAG MODE (3) - RATE 2 SC CONT - CMC/AUTO PRO	(.01°)
14		06	18	AUTO MNVR TO FDAI RPY	(.01°)

15	F	50	18	REQ TRIM	(.01°)
				ALIGN SC ROLL	
				(AUTO TRIM) PRO	
				ATT DB - MIN	
				RATE - LOW	
				BMAG MODE (3) - ATT1/RATE 2	
				If long Lambert (P37) burn	
				BMAG MODE (3) - RATE 2	
				ENTR	
	55:00m				
16		06	85	VG X,Y,Z	(.1fps)
				RECHECK BORESIGHT STAR	
				TRANS CONTR PWR - on (up)	
				EMS MODE - STBY (verify)	
				EMS FUNC - ΔV SET/VHF RNG	
				SET ΔV for SM BURN = ΔV pad +100.0	
				EMS FUNC - ΔV	
				S BD OMNI ANT - C	
	59:25				
17				DSKY BLANKS	
	59:30				
18		16	85	VG X,Y,Z (AVE G ON)	(.1fps)
				RHC's & THC - ARMED	
				TAPE RCDR - HBR/RCD/FWD/CMD RESET	
				EMS MODE - NORMAL	
	00:00				
19	F	16	85	REQ NULL VG X,Y,Z	(.1fps)
				BURN EMS ΔV CTR TO 100	
				RESET DET & COUNT UP	
20				V82E	
	F	16	44	HA,HP,TFF	(.1nm,min-sec)
				Check HP <40nm:	
				If > Pad data, continue burn	
				until < Pad	
				PRO	

DATE 3/29/71

DATE

21 F 16 85 VG X,Y,Z (.1fps)
Read VG residuals to MSFN
PRO

22 F 37 00E
When CMC ACTY lt out:
V66E

EMS FUNC - OFF
EMS MODE - STBY
MAN ATT (3) - MIN IMP
TRANS CONT PWR - OFF
SC CONT - SCS
BMAG MODE (3) - RATE 2
cb DIRECT ULLAGE (2) - open
TAPE RCDR - off (ctr)
PCM BIT RATE - LOW

23 EMS INITIALIZATION
If scroll not on 37K
* EMS FUNC - TEST 5 *
* Slew scroll to 37K*
EMS FUNC - RNG SET
Set RNG to PAD DATA RNG
EMS FUNC - Vo SET
Slew scroll to PAD DATA VIO
EMS MODE - STBY (verify)
EMS FUNC - ENTRY

24 RSI ALIGNMENT
FDAI SOURCE - ATT SET
ATT SET - GDC
EMS ROLL - on (up)
GDC ALIGN PB - PUSH & HOLD
YAW tw - Position RSI to LIFT DN
GDC ALIGN PB - RELEASE
EMS ROLL - OFF
ALIGN GDC TO IMU

25 MNVR TO CM/SM SEP ATT
MAN ATT (3) - RATE CMD
RATE - HIGH
YAW left 45° from Burn Att (315°)
BMAG MODE (3) - ATT 1/RATE 2

DATE _____ DATE 3/29/71

26 PWR REDUCT

MN BUS TIE (2) - ON
HGA PWR - OFF
FC PUMPS (3) - OFF
FC 2 MNA - OFF
Verify loads balanced
VHF AM (A&B) - off (ctr)
(5) cb ECS RAD CONT/HTR (2) - open
cb RAD HTRS OVLD (2) - open
cb WASTE H2O/URINE DUMP HTRS(2)-open
POT H2O HTR - OFF
GLY EVAP TEMP IN - MAN

P61 - ENTRY PREP

27 V37E 61E (AVE G ON)
05 09 01427 - ROLL REVERSED
*05 09 01426 - IMU UNSAT *

28 F 06 61 IMPACT LAT, LONG, HDS UP/DN (+/-)
(.01°,.01°,±00001)
PAD VALUES
LAT _____
LONG _____
HDS UP +1 _____
PRO

29 F 06 60 GMAX,V400K,GAMMA EI (.01G, fps,.01°)
Record
GMAX _____
V400K _____
GAMMA EI _____
PRO

DATE 3/29/71

30 F 16 63 RTOGO (.1nm) _____ PAD _____
VIO (fps) _____ PAD _____
TFE (min-sec) _____
If NO COMM, Set RTOGO & VIO in EMS
& initialize
(ACCEPT) PRO
(RECYCLE) V32E to 29 (TFE sensitive to oblateness)

DATE _____

P62 - CM/SM SEP & PRE-ENTRY MNVR

31 F 50 25 00041 REQUEST CM/SM SEP

PRIM GLY to RAD - BYPASS (verify)
EMS MODE - STBY (verify)
CM RCS LOGIC - on (up)
Cue MSFN
SECS LOGIC (2) - on (up)(verify)
MSFN confirm GO for PYRO ARM (if poss)
SECS PYRO ARM (2) - ARM
MN BUS TIE (2) - ON (verify)

CM/SM SEP (2) - on (up)
If docking ring still on:
  CSM/LM FNL SEP (2) - on(up)(verify)
MAN ATT(3) - MIN IMP
BMAG MODE(3) - RATE 2
C&W MODE - CM
RCS TRNFR - CM
CM RCS MANF PRESS - 287-302 psia
CM RCS LOGIC - OFF
SECS PYRO ARM (2) - SAFE
Monitor V MNA/B:
  If <25vdc go to EMERG POWER DOWN

YAW back to 0°
MNVR to ENTRY ATT
  R 180° (Lift DN)
  P
  Y 0°
MAINTAIN HORIZ TRACK

PRO (Act ENTRY DAP Att Hold)

32 F 06 61 IMPACT LAT, LONG, HDS/DN (.01°,.01°,-00001)

PRO (CMC Guidance)

33 POSS 06 22 FINAL ATT DISP, RPY (.01°)
(Only if X-axis beyond 45° of Vel vector)

DATE _____

DATE 3/29/71

P63 - ENTRY INIT

34 06 64 G,VI,RTOGO (.01G,fps,.1nm)
FDAI SCALE - 5/5
ROT CONTR PWR DIR (2) -MNA/MNB(verify)
TAPE RCDR - HBR/RCD/FWD/CMD RESET
HORIZ CK
Pitch error needle goes toward
zero approaching .05G time

P64 - ENTRY POST .05G

35 06 74 BETA, VI, G (.01°,fps,.01G)
Start DAC

RTOGO AT .05G AGREES WITH EMS-verify
HORIZ CK

.05G time
(+0__:__)
(__:__:__)

EMS MODE - BACKUP/VHF RNG
.05 G Lt - on
.05 G sw - on (up)
EMS ROLL - on (up)

Track horiz with 9° window mk
Maintain SCS control,
Lift DN until 1G

If CMC is GO:
MAN ATT(3) - RATE CMD
SC CONT - CMC
*If DAP NO GO: *
* SC CONT - SCS *
* Fly BETA *
*If CMC NO GO: *
* SC CONT - SCS *
* Fly EMS *

*If after 1G, both RCS ring *
* He press <1550 psia: *
* Roll 20°/sec & disable RCS*
* After peak G, enable RCS *
* & fly beta = 90° *

NOTE: To monitor N68, Key V16 N68E
Compare RSI & FDAI
EMS GO/NO GO
G-V Plot within limits

DATE 3/29/71

DATE

P67 - ENTRY - FINAL PHASE (0.2G)

36 06 66 BETA,CRSRNG ERR,DNRNG ERR (.01°,.1nm,.1nm)
(+ is north & long)
KEY VERB
Record DNRNG ERR _____
KEY RLSE
Limit: ±100nm from PAD DRE
Monitor lift vector on RSI & FDAI
~~CM RCS: change rings when He PRESS~~
~~<1150 psia~~

37 F 16 67 RTOGO,LAT,LONG (Vrel=1000fps)
(.1nm,.01°,.01°)
SC CONT - SCS
RTOGO NEG - LIFT UP
RTOGO POS - LIFT DOWN
Monitor altimeter
Record LAT,LONG,& voice to RECY at 10K'
Record EMS RTGO
EMS MODE - STBY
EMS FUNC - OFF
Stop DAC
DAC - T11

Go To EARTH/POST LANDING pg L/9-1

SPS DEORBIT & ENTRY

VEHICLE PREP COMPLETE (pg L/5-1 or pg L/4-10)

P30 - EXTERNAL ΔV

1 V37E 30E

2 F 06 33 GETI (hr,min,.01sec)
(ACCEPT) PRO
(REJECT) LOAD DESIRED GETI

3 F 06 81 ΔVX,Y,Z (LV) (.1fps)
(ACCEPT) PRO
(REJECT) LOAD DESIRED DATA

4 F 06 42 HA,HP,ΔV (REQ) (.1nm,.1nm,.1fps)
Set ΔV counter
(ACCEPT) PRO
(REJECT) Reselect P30 or P27. Load new param.

5 F 16 45 M,TFI,MGA (marks,min-sec,.01°)
*MGA -00002: If *
* IMU not aligned*
Set DET
PRO

F 37 00E

6 SEPARATION CK LIST
PRIM GLY TO RAD - BYPASS (pull)
REPRESS PKG vlv - FILL to 865-935,
then ON
O2 SM SUPPLY vlv - OFF
SURGE TK - ON (verify)
CAB PRESS REL vlv (2) - NORM
cb ELS/CM-SM SEP (2) - close (verify)
cb SECS ARM (2) - close (verify)
cb SECS LOGIC (2) - close (verify)
ROT CONTR PWR NORM (2) - AC/DC
ABORT SYS PRPLNT - RCS CMD
SM RCS SEC PRPLNT FUEL PRESS (4)-OPEN

DATE 3/29/71

7 CM RCS CHECK

AUTO RCS A/C ROLL (4) - OFF (verify)
cb RCS LOGIC (2) - closed (verify)
SC CONT - SCS
MAN ATT (3) - MIN IMP
RCS TRNFR - CM
AUTO RCS SEL (RING 1) - OFF
AUTO RCS SEL (RING 2) - MNB
TEST RING 2 THRUSTERS
AUTO RCS SEL (RING 2) - OFF
AUTO RCS SEL (RING 1) - MNA
TEST RING 1 THRUSTERS
AUTO RCS SEL (RING 2) - MNB
RCS TRNFR - SM
MAN ATT(3) - RATE CMD

8 SPS THRUSTING PREP

Cycle CRYO FANS
SPS GAUGING - ACI (verify)
PUG MODE - as req'd
Load DAP
BMAG MODE (3) - RATE 2
SC CONT - CMC/AUTO

9 MNVR TO PAD BURN ATT (HDS UP)

V49E

R _____ (180°)
P _____
Y _____ (0°)

10 PERFORM BORESIGHT & SXT STAR CHECK

V41 N91E
Stow Optics eyepieces

11 V37E 40E

12 F 50 18 REQUEST MNVR TO FDAI RPY ANGLES (.01°)
(AUTO) BMAG MODE (3) - RATE 2
SC CONT - CMC/AUTO
PRO

13 06 18 AUTO MNVR TO FDAI RPY ANGLES (.01°)

14 F 50 18 REQUEST TRIM MNVR TO FDAI RPY ANGLES
ALIGN S/C ROLL (.01°)
GDC ALIGN

TVC CHECK & PREP
(8) cb STAB CONT SYS (all) - close
cb SPS (12) - close
Set ΔVC (verify)
EMS FUNC - ΔV (verify)
MAN ATT (3) - RATE CMD
ATT DB - MIN
RATE - LOW
TRANS CONT PWR - ON
SCS TVC (2) - RATE CMD
ΔV CG - CSM
TVC GMBL DRIVE P&Y - AUTO
+54:00m MN BUS TIE (2) - ON
(-06:00) TVC SERVO PWR #1 - AC1/MNA
TVC SERVO PWR #2 - AC2/MNB
ROT CONTR PWR NORMAL (2) - AC
ROT CONT PWR DIRECT (2) - OFF
BMAG MODE (3) - ATT1/RATE 2
SC CONT - SCS
RHC #2 - ARMED

55:00m PRIMARY TVC CHECK
(-05:00) GMBL MOT P1-Y1 - START/ON (LMP Cnfrm)
Verify TRIM CONTROL & SET
Verify MTVC
IF SCS: SCS TVC (2) - AUTO
SC CONT - CMC (SCS)
THC - CW
Verify NO MTVC

SEC TVC CHECK
GMBL MOT P2-Y2 - START/ON (LMP Cnfrm)
SET GPI TRIM
Verify MTVC
THC NEUTRAL
Verify NO MTVC

DATE 3/29/71

DATE

Verify GPI returns to 0,0(CMC)
or trim (SCS)
ROT CONT PWR NORM (2) - AC/DC
ROT CONT PWR DIRECT (2) - MNA/MNB
(TRIM) BMAG MODE (3) - RATE 2
PRO
BMAG MODE (3) - ATT1/RATE 2 (verify)
ENTR

15 F 50 25 00204 GMBL TEST OPTION
(ACCEPT) SC CONT - CMC (verify)
PRO
Monitor GPI Response:
00,02,-02,00,02,-02,00, Trim
*TEST FAIL: *
*SC CONT - SCS *
SCS TVC(2) - AUTO
(REJECT) ENTR

16 06 40 TFI, VG, ΔVM (min-sec,.1fps)
*PROG ALARM - TIG Slipped *
*V5N9E 01703 *
*KEY RLSE TO 16 *

FDAI SCALE - 5/5
RATE - HIGH
UPDATE DET
SPS He vlvs(2)- AUTO (verify)

TIG-3 min
HORIZ CHK - Horiz on 3° window mk
(hds up)(Limit +3° PGNCS GO/NO-GO)
*If NO GO, set tw 180°,180°,0° *
* Track horiz with 7° window mk*
* (hds up) *
* At TIG-2 min, Align GDC *

58:00
(-02:00)
ΔV THRUST A(B) - NORMAL
THC - ARMED
RHC (2) - ARMED
TAPE RCDR - HBR/RCD/FWD/CMD RESET

59:25
(-00:35) DSKY BLANKS

DATE 3/29/71

DATE 3/29/71

59:30 (AVE G ON)
(-00:30) EMS MODE - NORMAL

06 40 TFI,VG,ΔVM (min-sec,.1fps)
CHECK PIPA BIAS <2fps for 5 sec

59:XX ULLAGE
(-00:XX) Horiz on 15° window mark (hds up)
*If no ULLAGE: *
* DIR ULLAGE PB - PUSH*
* Control Att with RHC*

MONITOR ΔVM (R3) COUNTING UP

59:55
(-00:05)
F 99 40 ENG ON ENABLE REQUEST
(AUTO IGN) PRO AT TFI >0 Sec
(BYPASS IGN) ENTR to 19 (prfrm switching in 18)
EXIT - V37E 00E

17 00:00 IGN *IF SCS: THRUST PB - PUSH*

06 40 TFC, VG, ΔVM (min-sec,.1fps,.1fps)

*F 97 40 SPS Thrust fail *
*ΔV THRUST B(A) - NORMAL *
*(RESTART) PRO to IGN *
(RECYCLE) ENTR to TIG-05sec

SPS THRUST Lt - ON
00:03 ΔV THRUST B(A) - NORMAL
IF SCS: +X & THRUST PB - PUSH

MONITOR THRUSTING
Pc 95-105 psia
EMS COUNTING DOWN
SPS INJ VLVS (4) - OPEN
SPS He vlvs tb-gray
SPS FUEL/OXID PRESS - 170-195 psia
PUGS - BALANCED

DATE 3/29/71

DATE

	00:XX		ECO
18	F 16 40		TFC (STATIC), VG, ΔVM (min-sec,.1fps) ΔV THRUST A&B - OFF VERIFY THRUST OFF SPS INJ VLVS (4) - CLOSED SPS He vlvs tb (2) - bp GMBL MTRS (4) - OFF (LMP Confirm) TVC SERVO PWR 1&2 - OFF PRO
19	F 16 85		VG XYZ (CM) (.1fps) NULL RESIDUALS RECORD ΔV COUNTER & RESIDUALS ΔVC _____ EMS FUNC - OFF VGX _____ EMS MODE - STBY VGY _____ TRANS CONT PWR - OFF VGZ _____ BMAG MODE (3) - RATE 2 cb DIRECT ULLAGE (2) - open cb SPS P & Y (4) - open TAPE RCDR - off (ctr) PRO
20	F 37		V82E
21	F 16 44		HA,HP,TFF (.1nm,min-sec) PRO
22	F 37		00E
23			When COMP ACTY lt out: V66E
24			MNVR TO CM/SM SEP ATT SC CONT - SCS YAW right 45° from Burn Att (315°) BMAG MODE (3) - ATT 1/RATE 2

3/29/71

DATE

DATE

25 PWR REDUCT

HI GAIN ANT PWR - OFF
FC PUMPS (3) - OFF
FC 2 MNA - OFF
Verify loads balanced
VHF AM (A&B) - off (ctr)
(5) cb ECS RAD CONT/HTR (2) - open
cb RAD HTRS OVLD (2) - open
cb WASTE H2O/URINE DUMP HTRS(2)-open
POT H2O HTR - OFF
GLY EVAP TEMP IN - MAN

P61 - ENTRY PREP

26 V37E 61E (AVE G ON)
05 09 01427 - ROLL REVERSED
*05 09 01426 - IMU UNSAT *

27 F 06 61 IMPACT LAT, LONG, HDS UP/DN (+/-) (.01°,.01°,±00001)
PAD VALUES
LAT _____
LONG _____
HDS DN -1
PRO

28 F 06 60 GMAX,V400K,GAMMA EI (.01G, fps,.01°)
Record
GMAX _____
V400K _____
GAMMA EI _____
PRO

29 F 16 63 RTOGO (.1nm) _____ PAD _____
VIO (fps) _____ PAD _____
TFE (min-sec) _____
If NO COMM, Set RTOGO & VIO in EMS
& initialize
(ACCEPT) PRO
(RECYCLE) V32E to 28 (TFE sensitive to oblateness)

DATE 3/29/71

DATE

P62 - CM/SM SEP & PRE-ENTRY MNVR

30 F 50 25 00041 REQUEST CM/SM SEP

PRIM GLY to RAD - BYPASS (verify)
EMS MODE - STBY (verify)
CM RCS LOGIC - on (up)
Cue MSFN
SECS LOGIC (2) - on (up) (verify)
MSFN confirm GO for PYRO ARM (if poss)
SECS PYRO ARM (2) - ARM
MN BUS TIE (2) - ON (verify)

CM/SM SEP (2) - on (up)
If docking ring still on:
  CSM/LM FNL SEP (2) - on(up)(verify)
MAN ATT(3) - MIN IMP
BMAG MODE(3) - RATE 2
C&W MODE - CM
RCS TRNFR - CM
CM RCS MANF PRESS - 287-302 psia
CM RCS LOGIC - OFF
SECS PYRO ARM (2) - SAFE
Monitor V MNA/B:
  If <25vdc go to EMERG POWER DOWN

YAW back to 0°
MNVR to ENTRY ATT
  R 0° (Lift UP)
  P Horiz on 29° mark(400K)
  Y 0°
MAINTAIN HORIZ TRACK

PRO (Act ENTRY DAP Att Hold)

31 F 06 61 IMPACT LAT, LONG, HDS/DN
(.01°,.01°,-00001)

DATE 3/29/71

DATE

EMS INITIALIZATION

If scroll not on 37K
* EMS FUNC - TEST 5 *
* Slew scroll to 37K*
EMS FUNC - RNG SET
Set RNG TO PAD DATA RNG
EMS FUNC - Vo SET
Slew scroll to PAD DATA VIO
EMS MODE - STBY (verify)
EMS FUNC - ENTRY

RSI ALIGNMENT

FDAI SOURCE - ATT SET
ATT SET - GDC
EMS ROLL - on(up)
GDC ALIGN PB - PUSH & HOLD
YAW tw - Position RSI thru 45° &
back to LIFT UP
GDC ALIGN PB - RELEASE
EMS ROLL - OFF
Align GDC to IMU
EMS FUNC - ENTRY (verify)
PRO (CMC Guidance)

32 POSS 06 22 FINAL ATT DISP, RPY (.01°)
(Only if X-axis beyond 45° of Vel vector)

P63 - ENTRY INIT

33 06 64 G,VI,RTOGO (.01G,fps,.1nm)
FDAI SCALE - 5/5
ROT CONTR PWR DIR (2)-MNA/MNB(verify)
TAPE RCDR - HBR/RCD/FWD/CMD RESET
HORIZ CK
Pitch error needle goes toward
zero approaching .05G time

DATE 3/29/71

DATE

P64 - ENTRY POST .05G

134 06 74 BETA, VI, G (.01°,fps,.01G)
Start DAC

RTOGO AT .05G AGREES WITH EMS-verify
HORIZ CK

.05G time
(+0__:__)
(__:__:__)

EMS MODE - BACKUP/VHF RNG
.05 G Lt - on

If CMC is GO:
MAN ATT (3) - RATE CMD
SC CONT - CMC
*If DAP NO GO: *
* SC CONT - SCS *
* Fly BETA *
*If CMC NO GO: *
* SC CONT - SCS *
* Track horiz with 29° *
* window mk *
* Maintain Lift UP until .2G*
* Fly EMS *

*If after 1G, both RCS ring *
* He press <1550 psia: *
* Roll 20°/sec & disable RCS*
* After peak G, enable RCS *
* & fly BETA = 90° *

.05 G sw - on (up)
EMS ROLL - on (up)

NOTE: To monitor N68, Key V16 N68E
Compare RSI & FDAI
If CMC or PAD cmds Lift DN,
* MNVR Lift DN *
EMS GO/NO GO
G-V Plot within limits

DATE _____

DATE 3/29/71

P67 - ENTRY - FINAL PHASE (0.2G)

35 06 66 BETA,CRSRNG ERR,DNRNG ERR (.01°,.1nm,.1nm)
(+ is north & long)
KEY VERB
Record DNRNG ERR ____
KEY RLSE
Limit: ±100nm from PAD DRE
Monitor lift vector on RSI & FDAI
~~CM RCS: change rings when He PRESS < 1150 psia~~

36 F 16 67 RTOGO,LAT,LONG (Vrel=1000fps)
(.1nm,.01°,.01°)
SC CONT - SCS
RTOGO NEG - LIFT UP
RTOGO POS - LIFT DOWN
Monitor altimeter
Record LAT,LONG,& voice to RECY at 10K'
Record EMS RTGO
EMS MODE - STBY
EMS FUNC - OFF
Stop DAC
DAC - T11

Go To EARTH/POST LANDING pg L/9-1

DATE 3/29/71

DATE ____

EARTH/POST LANDING

Start Watch

RRT (__:__) STEAM PRESS - pegged at 90K (00:00)
50K'(__:__) CABIN PRESS REL vlv (2) - BOOST/ENTRY (00:52)
SECS PYRO ARM (2) - ARM
Check Altimeter

40K'(__:__) * CM UNSTABLE *(01:08)
*RCS CMD - OFF *
* 40K' APEX COVER JETT PB-PUSH *
DROGUE DEPLOY PB - PUSH (2 sec
*after apex cover jett) *

30K' ELS LOGIC - on (up) (01:24)
ELS - AUTO
Start DAC

24K'(__:__) RCS disable (auto) (01:38)
RCS CMD - OFF

Apex cover jett (auto)
APEX COVER JETT PB - PUSH
(WAIT 2 SECS)
Drogue parachutes deployed (auto)
DROGUE DEPLOY PB - PUSH

If Both Drogues Fail:
*ELS - MAN *
*Stabilize CM *
5K' MAIN DPLY PB - PUSH
*ELS - AUTO *

23.5K' Cabin Pressure increasing
*If not increasing by 17K': *
CABIN PRESS REL vlv (RH) - DUMP

10K'(__:__) Main parachutes deployed (Drogues +48s)(02:29)
(Cab Press = 10 psia)
MAIN DEPLOY PB - PUSH (within 1 sec)
VHF ANT - RECY
VHF AM A - SIMPLEX
VHF BCN - ON
DIRECT O2 vlv - OPEN (if suited)

DATE 3/29/71

EARTH/POST LANDING

CABIN PRESS REL vlv (2) - CLOSE
CM RCS LOGIC - on (up)
If main or pyro bus lost,
* use RHC's for burn, *
* not DUMP sw *
CM PRPLNT - DUMP (burn audible)
Monitor CM RCS 1&2 for He press decrease
If no burn or press decrease,
* use both RHC's *
*DO NOT FIRE PITCH JETS *
CM PRPLNT - PURGE
*CM RCS He DUMP PB - PUSH *
RHC (2) - 30 secs, NO PITCH
Stow DAC
STRUT LOCKS (4) - UNLOCK
If night landing:
cb FLOAT BAG #3, FLT/PL (1 cb) - close
PL BCN LT - LOW
(275) cb FLT & PL BAT BUS A,B,&BAT C (3) - close
cb FLT & PL MNA & B (2) - open
(5) cb BAT RLY BUS (2) - open
cb RAD HTRS OVLD (2) - open (verify)
(8) cb SPS P&Y (4) - open (verify)

3K' CM RCS PRPLNT (2) - OFF (terminates purge)
CABIN PRESS REL vlv (RH) - DUMP
ELS AUTO (verify)
ELS LOGIC - ON (verify)
FLOOD Lts - POST LDG

800' CAB PRESS RELF vlv - CLOSE (latch off)
MN BUS TIE (2) - OFF

DATE 3/29/71

POSTLANDING
STABILIZATION, VENTILATION, COMMUNICATIONS

1 Stabilization after landing
(229) cb MAIN REL PYRO (2) - close
MAIN RELEASE - on (up)
SECS PYRO ARM (2) - SAFE
SECS LOGIC (2) - OFF
No contact with recovery forces
*VHF AM A&B - off (ctr) *
*VHF AM RCV ONLY - A *

(8) cb PL VENT - close
cb FLOAT BAG (3) - close
(278) cb UPRIGHT SYS COMPRESS (2) - close
If Stable II:
FLOAT BAG(3) - FILL till 2 min after upright, then - OFF
VHF AM A/B & BCN - OFF while inverted
If Stable I:
After 10 Min Cooling Period,
FLOAT BAG (3) - FILL 7 min, then OFF

2 Post Stabilization And Ventilation
PL BCN LT - BCN LT LOW (night landing)
PL VENT v1v - UNLOCK (Pull into detent)
Remove PL VENT Exh Cover
PL VENT - HIGH or LOW
If req'd:
PL DYE MARKER - ON
Release restraints
(275) cb MNA BAT BUS A & BAT C (2) - open
cb MNB BAT BUS B & BAT C (2) - open
cb FLT & PL BAT C - open
(250) cb PYRO A SEQ A - open
cb PYRO B SEQ B - open
Verify voltage > 27.5 vdc
*If < 27.5 vdc: *
* cb FLT & PL-BAT BUS A&B (2) -open*
* cb FLT & PL BAT C (1) - close *
* GO TO LOW POWER CHECKLIST *
Unstow and install PLV DISTRIB DUCT
Deploy grappling hook and line if req'd

DATE 3/29/71

DATE

NOMINAL EGRESS & POWER DOWN
PL VENT - OFF
cb Pnl 250 (all) - open
Charge hatch counterbalance
Open side hatch (after Cailer installed)
ACTR HNDL SEL - N
GN2 v1v HNDL - VENT (pull)
GN2 v1v HNDL - PRESS (push)
Check Pressure Guage (mid-white)
repeat vent/press to obtain mid-white

UNAIDED EGRESS PROCEDURES

PREPARATION

Disconnect umbilicals
Neck dams on (if suited)
Configure couch(s) - 270°
Armrests stowed
Unstow survival kits
Connect lanyards, (green to S/C, white to crew)

STABLE I

PL VENT - OFF
cb Pnl 250 (all) - open
Charge hatch counterbalance
Open side hatch
ACTR HNDL SEL - N
GN2 vlv HNDL - VENT (pull)
GN2 vlv HNDL - PRESS (push)
Check Pressure Guage (mid-white)
repeat vent/press to obtain mid-white
Remove raft from kit No. 2
Put raft overboard & pull inflation lanyard
Pass hardware kit to raft
Egress, inflate life vest, board raft
If no ventilation or CM 02 supply,
* initiate egress within 2-1/2 hrs*

STABLE II

PWR (3) - OFF
SUIT PWR (3) - OFF
PRESS EQUAL vlv - OPEN
Remove & stow hatch
Lower hardware rucksack down tunnel
Exit feet first; when clear of S/C inflate water wings
Remove life raft from kit No. 2 and inflate
If no ventilation or CM 02 supply,
* initiate egress within 2-1/2 hrs*

DATE _____

DATE 3/29/71

POST LANDING COMMUNICATIONS

VHF ANT - RECY (verify)
VHF BCN - ON (verify)
If no contact with recovery forces
perform VHF BEACON Check
MONITOR VHF BEACON transmission with
VHF AM B Rcvr and/or Survival Transceiver
*VHF Beacon not operating *
*connect Survival Transceiver to ant *
cable conn P112 behind VHF ant access pnl
*and place radio in BCN mode *

LOW POWER CHECKLIST

VHF BCN - OFF
VHF AM (3) - RCV
FLOOD LTS - OFF
VHF AM A&B - off (ctr)
VHF AM RCV ONLY - A (verify)
POSTLANDING VENT SYS: minimize use
SURV RADIO - plug into VHF BCN ANT cable conn P112 behind VHF ant access pnl & turn radio on in BCN mode

DATE 3/29/71

DATE _____

EMER
1-1

EMERGENCY PROCEDURES

(Flight copies only)

see CSM SYSTEMS CHECKLIST

DATE 3/29/71