

A novel methodology for antenna design and optimization: *Variable Z₀* (ver. 2)

Richard A. Formato

Registered Patent Attorney & Consulting Engineer
Cataldo & Fisher, LLC, 400 TradeCenter, Suite 5900
Woburn, MA 01801 USA
rf2@ieee.org, rformato@cataldofisher.com

Abstract — This paper describes “Variable Z_0 ,” a novel and proprietary approach to antenna design and optimization. The new methodology is illustrated by applying it to the design of a resistively-loaded bowtie antenna and two broadband Yagi-Uda arrays. *Variable Z₀* is applicable to any antenna design or optimization methodology. Using it will result in generally better antenna designs across any user-specified set of performance objectives.

Keywords — Variable Z_0 , Z_0 , characteristic impedance, feed system, antenna, antenna design, antenna optimization, design objectives, performance objectives, bandwidth, impedance bandwidth, broadband, ultra wideband, UWB, resistive loading, impedance loading, bowtie, Yagi, Yagi-Uda, Central Force Optimization, CFO, numerical optimization, optimization algorithm, metaheuristic

1. Introduction

This paper describes what the author believes to be a novel and proprietary antenna design methodology called “Variable Z_0 ,” Z_0 being the antenna feed system characteristic impedance. *Design* refers to the process of specifying a complete set of parameters that define an antenna meeting specific performance objectives. *Optimization* refers to specifying a complete set of parameters that define the antenna that *best* meets specific performance objectives. While *Variable Z₀* may be particularly useful for improving impedance bandwidth (IBW), the methodology can be used to meet any performance objectives, even ones that do not consider IBW at all.

Traditional antenna design and optimization methods, processes, or procedures (“methodology”) view Z_0 as a *fixed* design *parameter* with a constant value specified at the start of the methodology. Z_0 therefore is not a *variable* quantity whose value is determined *by* the methodology. This distinction is quite important, because traditional methodology excludes from the outset all designs that could provide better performance by using some other value of Z_0 . *Variable Z₀* improves on traditional methodologies by treating Z_0 as another design *variable* in the set of variable antenna parameters to be determined by the methodology. *Variable Z₀* is applied to the design of a numerically optimized ultra wideband (UWB) bowtie antenna and to two broadband Yagi-Uda arrays to illustrate its use.

2. Z_0 as a design *variable*

IBW is defined as the frequency band or bands within which Z_{in} , the antenna input impedance, is matched within specified limits to the feed system characteristic impedance, Z_0 . The required degree of matching can be specified in terms of the antenna’s actual input impedance (resistance, R_{in} , and reactance, X_{in}) as a function of frequency, or, as is more often the case, in terms of a maximum voltage standing wave ratio (VSWR). IBW typically is specified as VSWR // $Z_0 \leq 2:1$ (// denoting “relative to”), which is equivalent to a return loss (scattering parameter S_{11}) approximately less than -10 dB. Other

VSWR thresholds can be used instead, and frequently are. Zehforoosh *et al.* [1] describes the design of an UWB microstrip antenna and provides a good summary of Z_0 's significance as a design parameter in the context of IBW. As is usual in the traditional methodology, Z_0 in [1] is a fixed parameter, not a variable quantity as it is in *Variable Z_0* .

While *Variable Z_0* methodology is useful in any antenna design, its widest range of applicability likely will be in improving IBW, which consequently is emphasized in this paper. The literature is replete with examples of various design and optimization approaches to improving IBW. Hoofar's review of Evolutionary Programming (EP) in electromagnetic optimization [2] provides several antenna design examples involving IBW, all of which employ fixed Z_0 . An optimized dipole array design using fixed Z_0 is described in [3]. An extensive study of the impact of various antenna parameters on down-link performance appears in [4], but Z_0 is not one of those parameters. Boryssenko [5] presents an extensive discussion of methodologies for designing wideband antennas, yet Z_0 is not included as a design *variable*. The multiband and UWB printed bowties described in [6] and [7], respectively, both utilize fixed Z_0 as a design parameter. Other UWB bowtie configurations (slot [8], UWB balun-fed [9], and dual-band slot [10]) are all designed using constant values for Z_0 . Of course, the traditional practice of specifying Z_0 as a fixed parameter is not restricted to bowties. It is the approach used in all antenna design and optimization methodologies, as, for example, in [11] (broad-band array optimization) and [12] (Particle Swarm Optimized Vivaldi antenna). The state-of-the-art, which fixes Z_0 's value, limits achievable IBW (as well as meeting other performance objectives) because better results are obtainable when Z_0 is considered to be a design *variable* whose value is determined by the design or optimization process, instead of being a user-supplied constant at the outset of that process.

3. Design example: resistively loaded broadband bowtie

As discussed above, the bowtie antenna has been studied extensively, and it provides a simple structure to illustrate how better IBW can be achieved using *Variable Z_0* instead of traditional methodology. Its structure is shown schematically in Fig. 1. The antenna comprises two symmetrical wire triangles connected by a feed wire. The perfectly electrically conducting (PEC) wire has diameter $2a$, and the arm and feed wire lengths are L_{arm} and L_{feed} , respectively. The bowtie's flare angle (vertex angle) is 2α . The antenna is impedance-loaded with four symmetrically placed loading resistors of equal-value, R_{load} , that increase IBW at the expense of radiation efficiency (see [13] for a discussion of impedance loading). The resistors are inserted in series with the antenna wire a distance L_{load} from the vertex. Excitation is provided by an RF (radio frequency) source at the center of the feed wire.

The bowtie structure was modeled in free space with the Numerical Electromagnetics Code Ver 4.1D (NEC4, double precision) [14,15], the “modeling engine.” NEC4 is a widely used Method of Moments (MoM) modeling code for wire structures developed at Lawrence Livermore National Laboratory. The RF source is located at the origin of NEC's standard right-handed spherical polar coordinate system with the antenna the Y-Z plane and the feed wire along the Y-axis. For readers interested in NEC MoM modeling who do not have access to NEC4, freeware versions of NEC2 are available [16] (source code and executables). While NEC4 is particularly useful for wire structures like the bowtie, any suitable modeling engine, numerical, analytical or hybrid, can be used instead. The engine must be capable of accurately calculating all performance parameters that are used in evaluating how good a particular antenna design is.

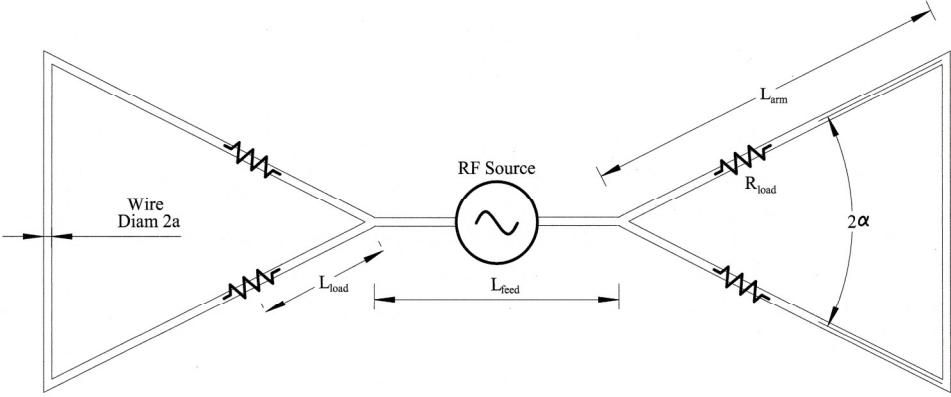


Fig. 1. Schematic diagram of the resistively loaded bowtie antenna.

4. Bowtie design variables

There are five bowtie design *variables*: L_{arm} , α , L_{load} , R_{load} , and, importantly and differently from traditional methodology, Z_0 . Each one of these quantities is allowed to vary in the design or optimization process. Their values are determined by meeting specific performance goals or by achieving the best performance using a designer-specified “fitness” or “objective” function that measures how well a particular set of values meets the desired performance goals. The key idea in *Variable* Z_0 is that the value of Z_0 be allowed to change during the design or optimization methodology because different values result in different antenna performance. It is likely that specific performance objectives can be met with multiple values of Z_0 , especially in the design setting. Even in the optimization setting there may be multiple values for a “best” design corresponding to multiple global optima, or that result from using a stochastic optimization algorithm or one that has converged to a local optimum.

Note that the wire radius a and the feed wire length L_{feed} are *not* included in the design variable list because these quantities are *fixed parameters*. As in the traditional design methodology, their values are assigned at the beginning of the design or optimization process, and they do not change as a result of that process. Z_0 is treated that way in traditional methodology, that is, Z_0 is assigned a value that does not change and is not determined by the methodology. Of course, neither a nor L_{feed} need be fixed. They could be allowed to vary with their values determined by how well the performance goals are met, because different values of a or L_{feed} might improve performance. However, in the bowtie design discussed here these quantities are held constant as examples of the fixed design parameters used in traditional methodology.

5. Optimization methodology

Any methodology can be used to design an antenna using *Variable* Z_0 (it is applicable regardless of the methodology). For the bowtie design example, CFO (Central Force Optimization) [17] was used. But any number of other commonly employed algorithms, such as Particle Swarm (PSO) [18], Ant Colony (ACO) [19], Group Search Optimizer (GSO) [20], or Differential Evolution (DE) [21], could be used instead. This “product by process” approach applies to any methodology, deterministic ones like CFO; stochastic metaheuristics like PSO, ACO, GSO or DE; analytic approaches such as extended Wu-King impedance loading [13]; or even “seat of the pants” optimization based on experience, intuition, or a “best guess.” The specific optimization methodology is irrelevant to the novelty of treating Z_0 as a design

variable instead of a fixed parameter. Thus, *Variable* Z_0 can be used advantageously with *any* design or optimization methodology.

The bowtie fitness function (to be maximized by CFO) is defined as

$$F(Z_0, R_{load}, L_{load}, L_{arm}, \alpha) = \frac{5 \cdot \min(G_{\max}) + \min(\epsilon)}{| \max(R_{in}) - Z_0 | \cdot \{ \max(VSWR // Z_0) - \min(VSWR // Z_0) \} \cdot \{ \max(X_{in}) - \min(X_{in}) \}}.$$

ϵ is the bowtie's radiation efficiency, G_{\max} its maximum gain, and $Z_{in} = R_{in} + jX_{in}$ ($j = \sqrt{-1}$) its input impedance, all as functions of frequency. The first term in the denominator drives the input resistance toward Z_0 (assumed purely resistive), while the second and third terms, respectively, minimize the VSWR and input reactance variability with frequency. A particular bowtie's fitness increases with increasing radiation efficiency and minimum maximum gain. It decreases with increasing mismatch between Z_0 and R_{in} and increasing variability in VSWR and input reactance. The coefficient 5 in the gain term was determined empirically. Of course, the antenna designer is free to specify any desired fitness function, with different fitnesses creating different decision space landscapes resulting in different antenna designs.

A parameter-free CFO implementation was used as described in [22-24] (only the fitness function is supplied as input to the algorithm; Appendix I contains a complete source code listing). Because there are five design variables, the decision space is 5-dimensional ($N_d = 5$) with the following hardwired

parameters: $N_t = 250$, $N_\gamma = 11$, $\max\left(\frac{N_p}{N_d}\right) = 8$, $F_{rep}^{init} = 0.5$, $\Delta F_{rep} = 0.1$, $F_{rep}^{\min} = 0.05$, $\alpha = 1$,

$\beta = 1$, $G = 2$, $\Delta t = 0.5$. Decision space adaptation was applied every 20th time step with an early termination criterion of fitness saturation for 25 consecutive steps (variation $\leq 10^{-6}$). The best fitness

returned by CFO was 1.5806×10^{-4} (probe #1) with $\frac{N_p}{N_d} = 2$ and $\gamma = 1$ at step 35.

The decision space was defined as follows: $0.01 \leq L_{arm} \leq 0.08$ m, $10^\circ \leq \alpha \leq 80^\circ$ (bowtie variables); $1 \leq \left\lfloor \frac{L_{load}}{L_{arm}} \right\rfloor \leq 9$, $1 \leq R_{load} \leq 1000$ Ω (loading variables); $50 \leq Z_0 \leq 1000$ Ω (*variable* feed system characteristic impedance). The *fixed* design parameters were $L_{feed} = 0.02$ m and wire radius $a = 0.0005$ m (note all dimensions in meters). These values, which are specified by the antenna designer, were determined based on experience.

The bowtie's performance was computed every 100MHz across the band $800 \leq f_{mhz} \leq 12,000$ (f_{mhz} being the frequency in megahertz) and the resulting data used to compute the fitness function. The NEC-4 model employed 9 segments in each of the six wires forming the bowtie triangles, and three segments in the feed wire. Gain was computed every 5 degrees from $0 \leq \theta \leq 90^\circ$ at $\phi = 0^\circ$ (see [14,15] for coordinate system details). Note that the range for L_{load} is specified as an integer ratio to L_{arm} because NEC loads a wire by segment *number* ("LD" cards), not by coordinate. The distance L_{arm} consequently must be converted to an integer for use in NEC4.

5. Bowtie results

Design values for the *Variable* Z_0 CFO-optimized loaded bowtie appear in Fig. 2. Its computed performance from 800 to 12,000 MHz is summarized in Fig. 3. Post-processing extended the frequency range from 200 to 15,000 MHz with data computed every 15 MHz (Appendices II and III contain the computed data). Figures 8 and 11-15 plot the results, and Fig. 16 shows the NEC4 input file. Fig. 17 shows the antenna geometry as visualized using 4nec2 [16(i)] (rectangles are loading resistors). In order to compare *Variable* Z_0 to the traditional methodology, another CFO run was made holding Z_0 constant. The same run parameters and decision space boundaries were employed, except $50 \leq Z_0 \leq 50 \Omega$ to fix its value. Results of the comparison run appear in Figs. 4 and 5.

As a preliminary matter, the NEC4 model must be validated using the *unloaded* antenna's average free space power gain test (AGT) as discussed at [15, Part I, p. 101]. Radiation patterns were computed from 200 to 15,000 MHz at 5° and 10° increments, respectively, for $0 \leq \theta \leq 90^\circ$ and $0 \leq \phi \leq 180^\circ$ with power gain averaged over π steradians. The AGT plot for the *Variable* Z_0 bowtie appears in Fig. 6, and in Fig. 7 for the fixed Z_0 design.

The average power gain for the *Variable* Z_0 bowtie is between about 1.05 and 1.1 over most of the band with a peak near 1.18. Values within 20% of unity usually are considered adequate for model validation, so that in this case there is confidence in the bowtie data throughout the entire frequency range. By comparison, the average gain for the fixed $Z_0 = 50 \Omega$ design shows a sharp increase above 1.2 for frequencies beyond about 14,000 MHz, so that confidence in those data is considerably less.

The primary objective of this design example is minimizing VSWR, which is plotted for the optimized *Variable* Z_0 antenna in Fig. 8. The bowtie structure computed by CFO was modeled with and without resistive loading and its VSWR computed relative to the optimum CFO-computed feed system Z_0 of 715Ω . Interestingly, this value for Z_0 , which was determined as a result of its being *variable* in

L_{arm}	0.051 m
α	39.4°
$\left \frac{L_{load}}{L_{arm}} \right $	6
L_{load}	0.03117 m
R_{load}	166.93Ω
Z_0	715Ω

Fig. 2. *Variable-* Z_0 CFO-optimized bowtie.

Parameter	Minimum	Maximum
$VSWR // 715 \Omega$	1.06	6.43
R_{in}	111.51Ω	729.32Ω
X_{in}	-286Ω	335.73Ω
ϵ	24.25 %	98.88 %
G_{max}	-3.34 dBi	4.71 dBi

Fig. 3. *Variable-* Z_0 bowtie performance 800-12,000 MHz.

L_{arm}	0.08 m
α	30°
$\left[\frac{L_{load}}{L_{arm}} \right]$	9
L_{load}	0.07555
R_{load}	1000 Ω
Z_0	50 Ω fixed

Fig. 4. CFO-optimized fixed $Z_0 = 50 \Omega$ bowtie.

the optimization process, is unusual and quite far from the “standard” values that are much lower (mostly $\sim 50 \Omega$). Of course, impedance-matching the optimized value of Z_0 to a “standard” value, say, 50Ω , requires a sufficiently broadband matching network, for example, a broadband transformer, lumped or distributed matching network, tapered transmission line, and so on, with some matching devices being better than others depending on the frequency range.

Fig. 9 plots the fixed Z_0 bowtie’s VSWR, which is much higher than it is for the *Variable Z_0* antenna across the entire band. At no point is $VSWR \leq 2:1$, and for the most part it is $> 5:1$. Since IBW is the primary performance measure in this case, this example shows how the *Variable Z_0* methodology can lead to much better antenna designs because Z_0 then is determined by the design or optimization process instead of being assigned a value that cannot change.

Parameter	Minimum	Maximum
$VSWR // 50 \Omega$	2.67	13.58
R_{in}	119.38 Ω	676.71 Ω
X_{in}	-285.46 Ω	294.05 Ω
ϵ	43.76 %	91.85 %
G_{max}	-1.37 dBi	5.14 dBi

Fig. 5. Fixed $Z_0 = 50 \Omega$ bowtie performance 800-12,000 MHz.

Figure 10 summarizes the *Variable Z_0* bowtie’s IBW using the commonly employed threshold $VSWR // Z_0 \leq 2:1$. The antenna has several low-VSWR bands, two of which would be considered UWB because the fractional bandwidth is greater than 25% of the band’s center frequency, f_c . The loading resistance has the desired effect of increasing IBW, but it does so at the expense of radiation efficiency as shown in Figure 11. At low frequencies ϵ is quite low, and it decreases very quickly with decreasing frequency. But near 3000 MHz ϵ exhibits a sharp increase, with very reasonable values at higher frequencies. The unloaded PEC bowtie’s efficiency is 100 % and consequently is not plotted.

Figs. 12 and 13, respectively, plot the *Variable Z_0* antenna’s input resistance and reactance. As expected, the effect of adding resistive loading is to reduce fluctuations in these variables. Figures 14 and 15 plot the maximum and minimum gains, respectively. As expected, adding resistive loading generally

reduces maximum gain as expected, but, interestingly, it actually increases minimum gain in certain frequency ranges.

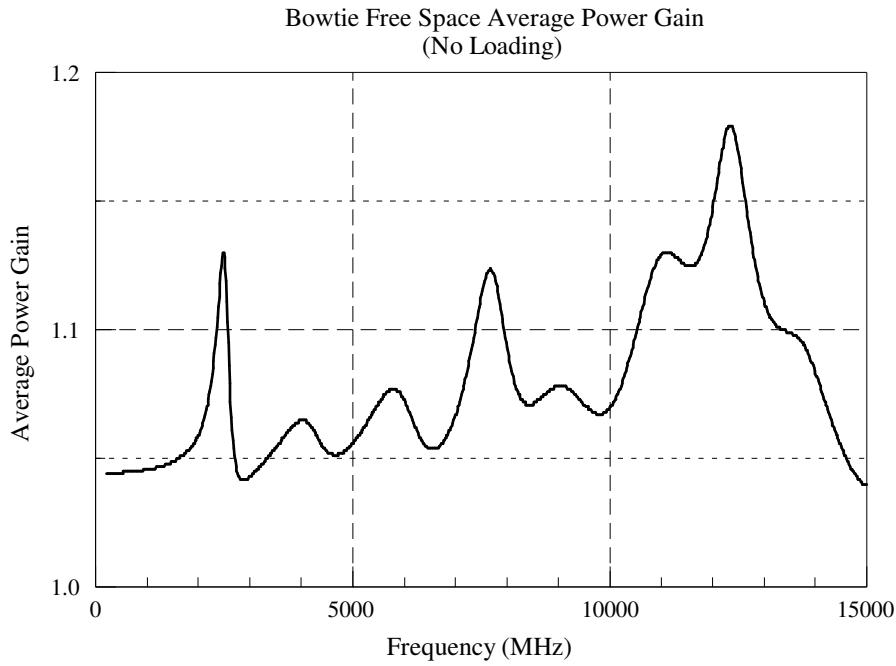


Fig.6. Variable- Z_0 bowtie NEC4 AGT plot ($Z_0 = 715 \Omega$).

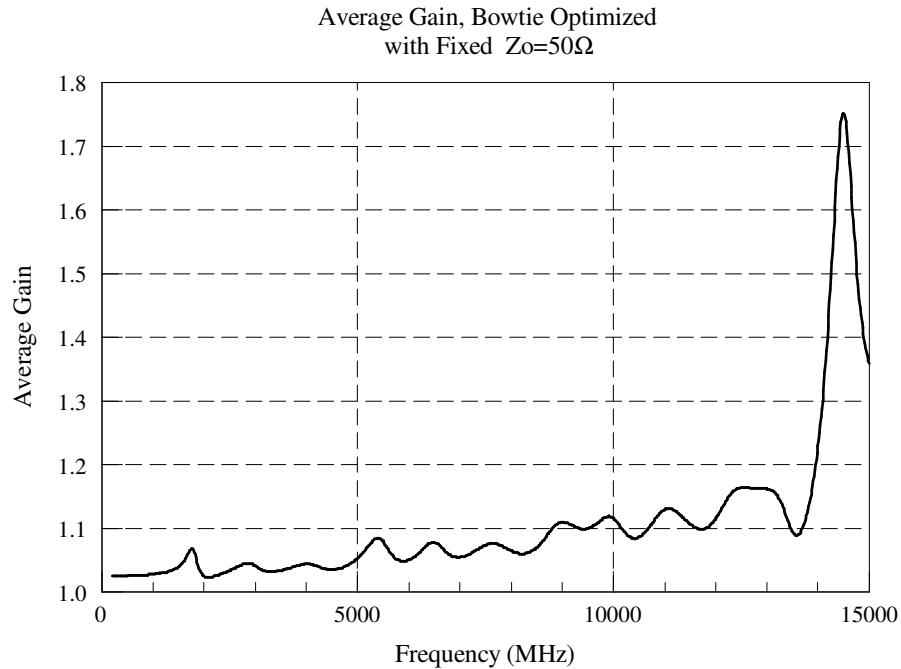


Fig.7. Fixed- Z_0 bowtie NEC4 AGT plot ($Z_0 = 50 \Omega$).

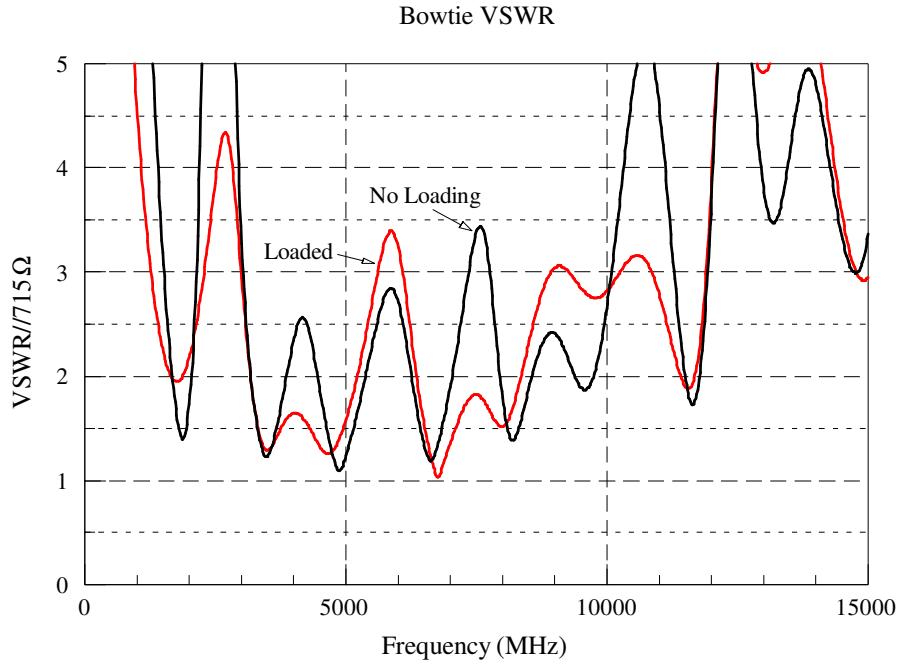


Fig.8. Variable- Z_0 bowtie VSWR ($Z_0 = 715 \Omega$).

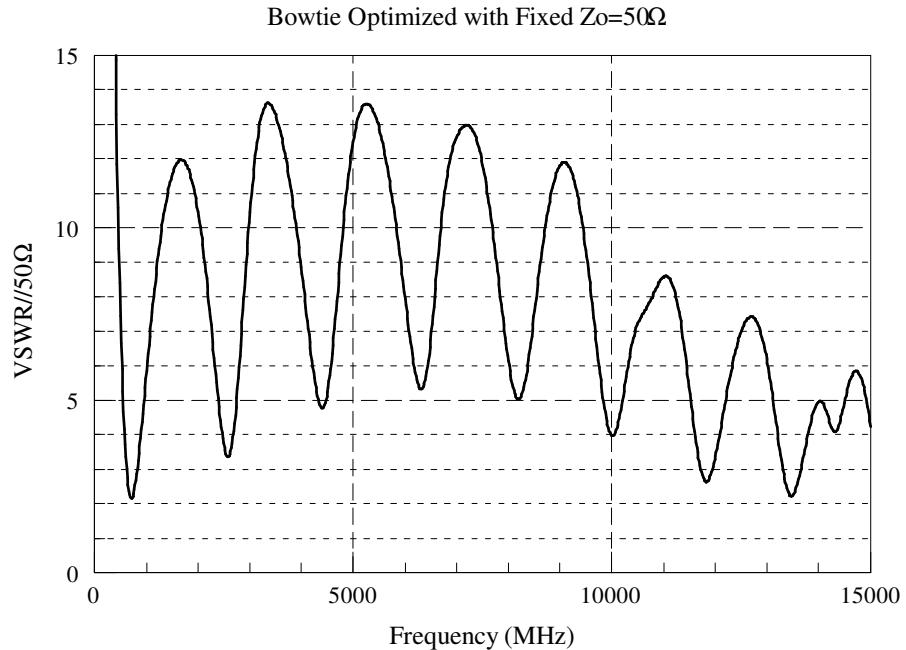


Fig.9. Fixed- Z_0 bowtie VSWR ($Z_0 = 50 \Omega$).

Resistively Loaded			No Loading		
Band Limits (MHz)	Width (MHz)	% of f_c	Band Limits (MHz)	Width (MHz)	% of f_c
1655-1865	210	11.9%	1685-2030	345	18.6%
3185-5210	2025	48.2%	3185-3860	675	18.9%
6365-8345	1980	26.9%	4460-5375	915	18.6%
11420-11675	255	2.21%	6260-7025	765	11.52%
-	-	-	7955-8555	600	7.27%
-	-	-	9395-9740	345	3.6%
-	-	-	11510-11765	255	2.19%

Fig.10. Variable- Z_0 bowtie VSWR//715 $\Omega \leq 2:1$ bands (f_c =band center).

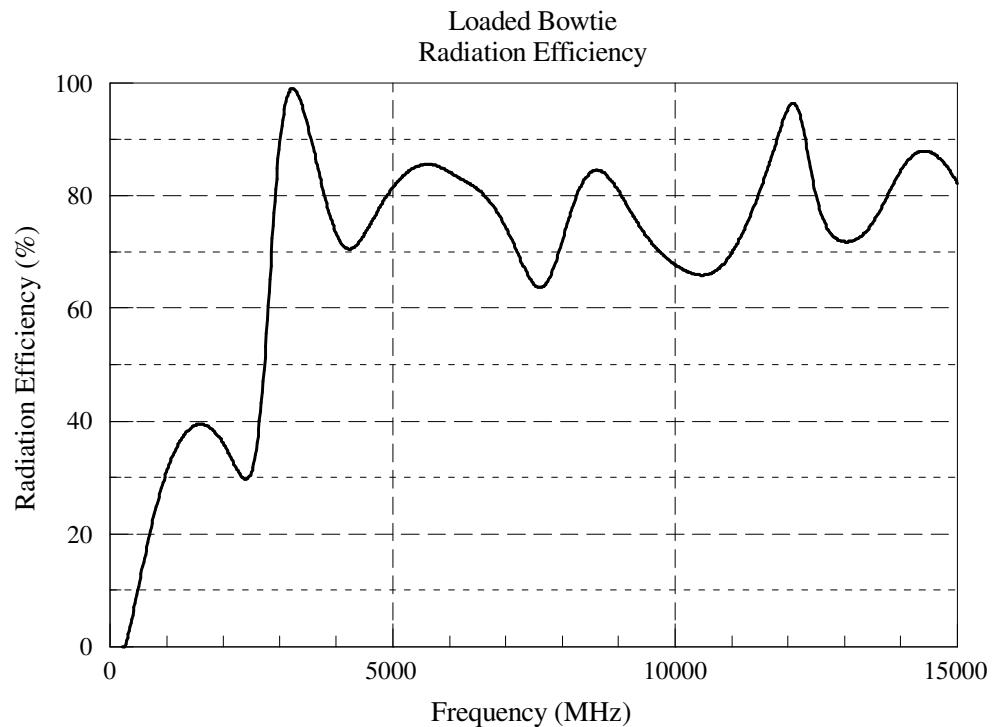


Fig.11. Variable- Z_0 Resistively loaded bowtie radiation efficiency.

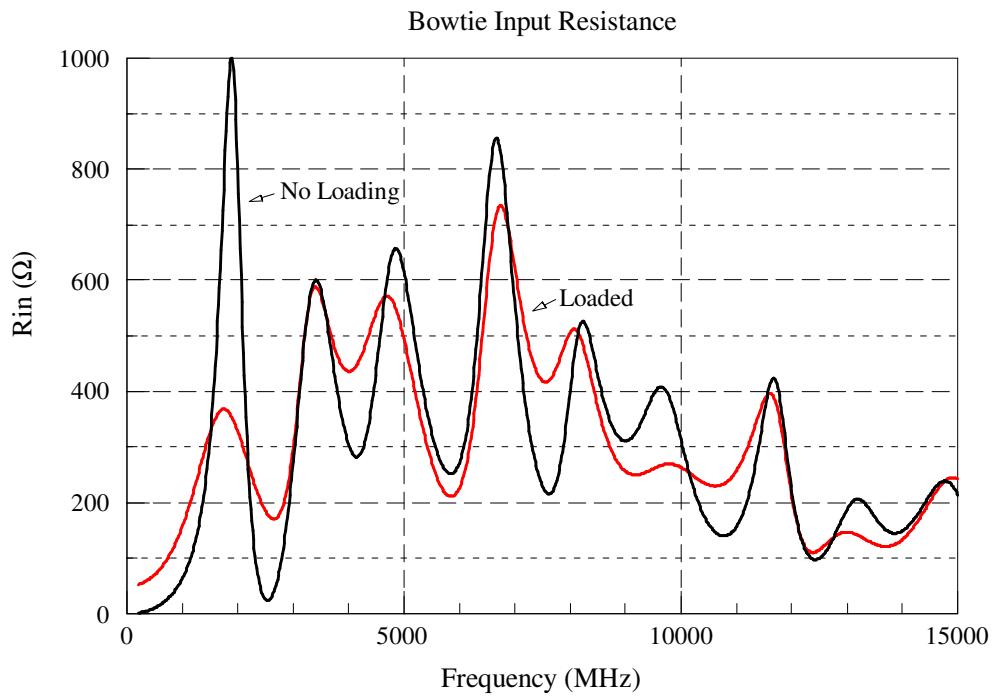


Fig.12. $Variable-Z_0$ bowtie input resistance.

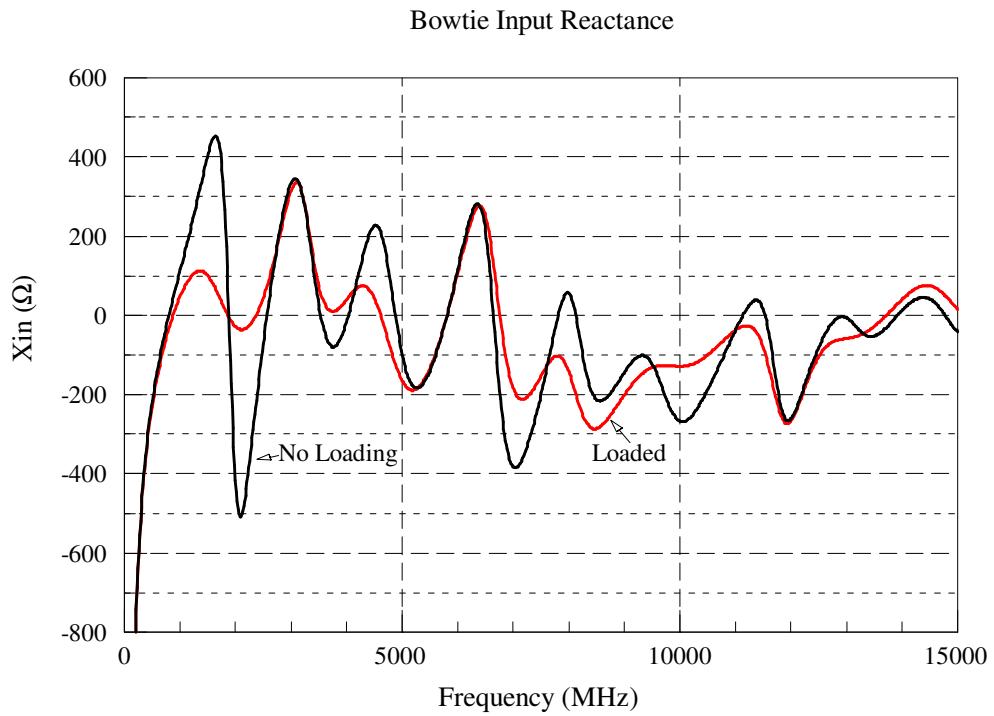


Fig. 13. $Variable-Z_0$ bowtie input reactance.

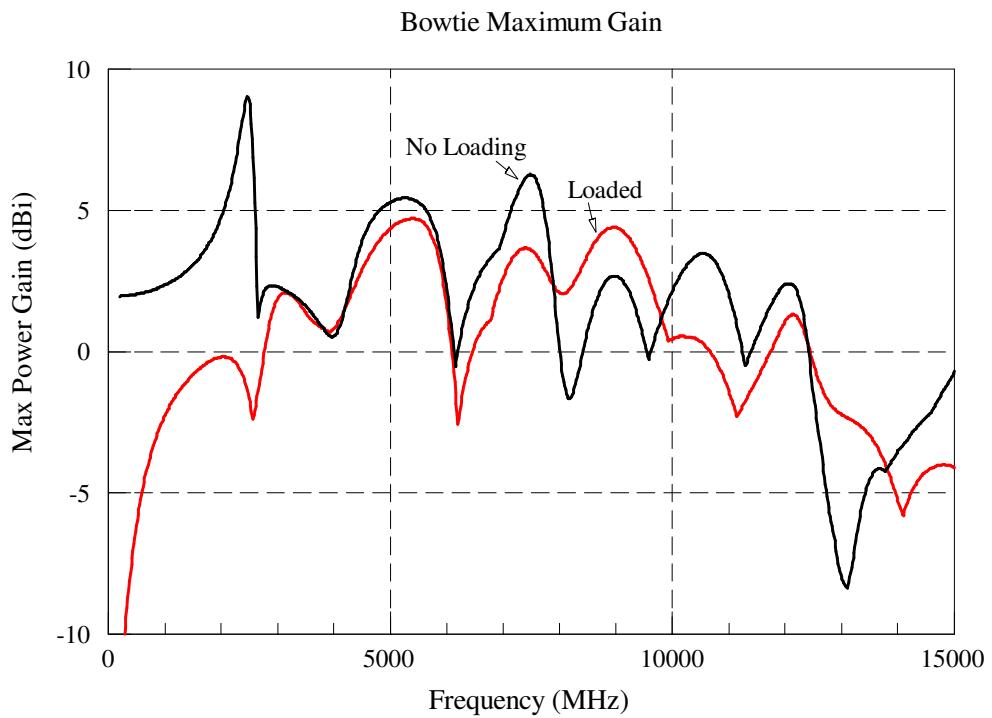


Fig. 14. $Variable-Z_0$ bowtie maximum power gain.

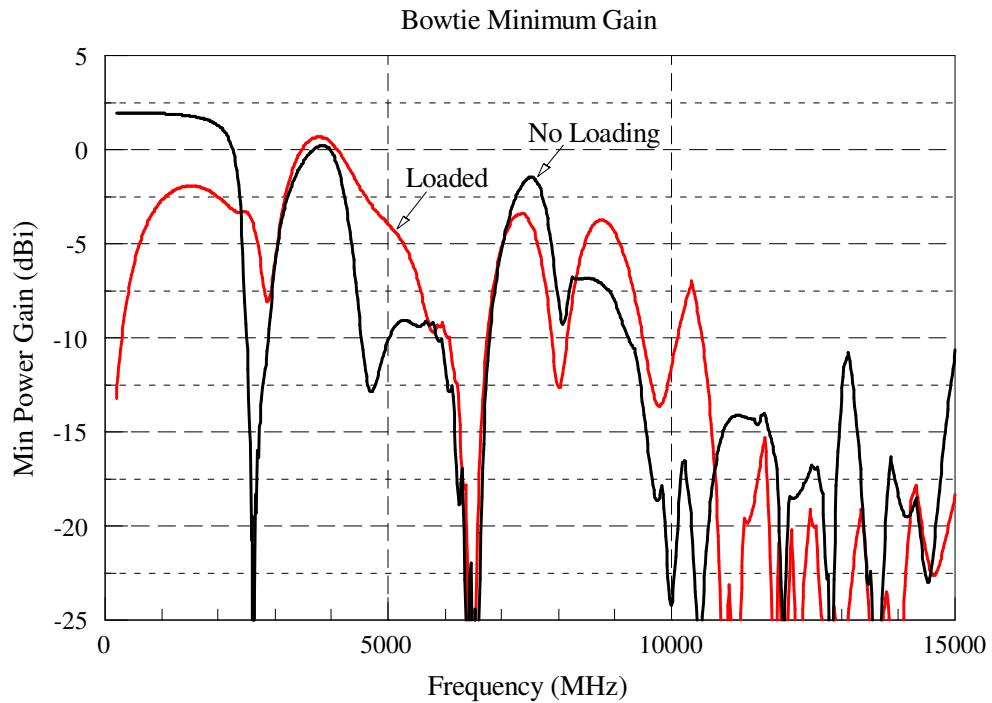


Fig. 15. $Variable-Z_0$ bowtie minimum power gain.

```

CM File: BESTBOWTIE.NEC
CM R-LOADED BOWTIE IN FREE SPACE WITH
CM Zo AS AN OPTIMIZATION PARAMETER.
CM Antenna in Y-Z plane.
CM Run ID: 07022011_221747
CM Fitness function:
CM [Min(Eff)+5*Min(Gmax)]/[|Zo-MaxRin|*(MaxVSWR-MinVSWR)*(MaxXin-MinXin)]
CM Arm Length = .051 meters
CM Bowtie HALF Angle = 39.4 degrees
CM Zo = 715 ohms
CM Rload = 166.93 ohms
CM Loaded Seg # = 6/9
CM File ID 07032011225840
CM Nd = 5, p = 1, j = 35
CE
GW1,3,0.,.01,0.,0.,.01,0.,.0005
GW2,9,0.,.01,0.,0.,.049,.032,.0005
GW3,9,0.,.01,0.,0.,.049,-.032,.0005
GW4,9,0.,.049,.032,0.,.049,-.032,.0005
GW5,9,0.,-.01,0.,0.,-.049,.032,.0005
GW6,9,0.,-.01,0.,0.,-.049,-.032,.0005
GW7,9,0.,-.049,.032,0.,-.049,-.032,.0005
GE
LD0,2,6,6,166.93,0.,0.
LD0,3,6,6,166.93,0.,0.
LD0,5,6,6,166.93,0.,0.
LD0,6,6,6,166.93,0.,0.
FR 0,1001,0,0,200.,15.
EX 0,1,2,1,1,0.
RP 0,19,1,1001,0.,0.,5.,0.,100000.
EN

```

Fig. 16. Variable- Z_0 bowtie NEC4 input file.

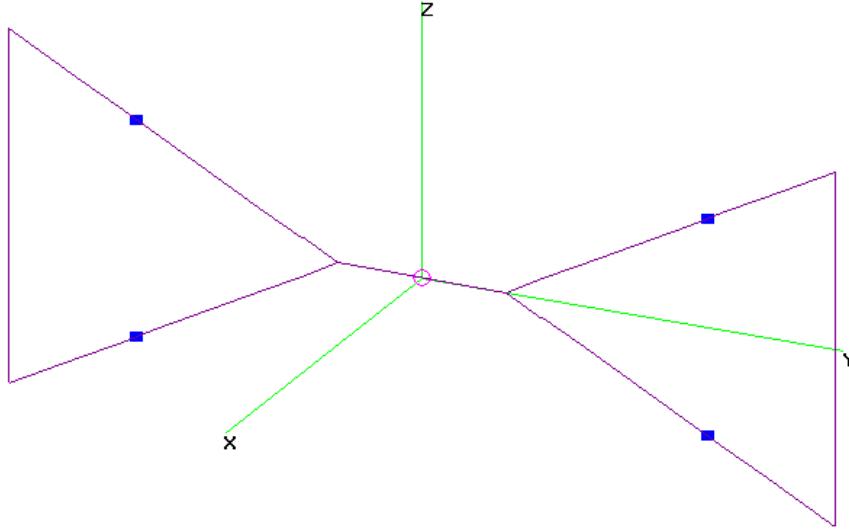


Fig. 17. Variable- Z_0 bowtie 4nec2 geometry display.

6. Design example: broadband Yagi-Uda arrays

The second *Variable Z_0* design example is two 6-element Yagi-Uda (“Yagi”) arrays. A Yagi comprises a single center-fed dipole driven element (DE), one or more reflectors (REF) on one side of DE (usually only one), and a group of directors on the other side (often many). DE is excited by the RF source, and all other elements are parasitic. Fig. 18 shows the array geometry as visualized by 4nec2 for Yagi design #1 (red circle is the RF source). All elements are parallel to the y-axis with the reflector on the axis. If the element radius is fixed (usually the same value for all elements), there are 11 geometric design variables, the 5 element spacings and their 6 lengths. Of course, in this case there is a twelfth design

variable, *viz.*, Z_0 . Fixing the element radius is an example of the traditional methodology in which certain design parameters are fixed at the outset, so that their values are not determined by the methodology. Fig. 19 shows the NEC4 input file for this antenna.

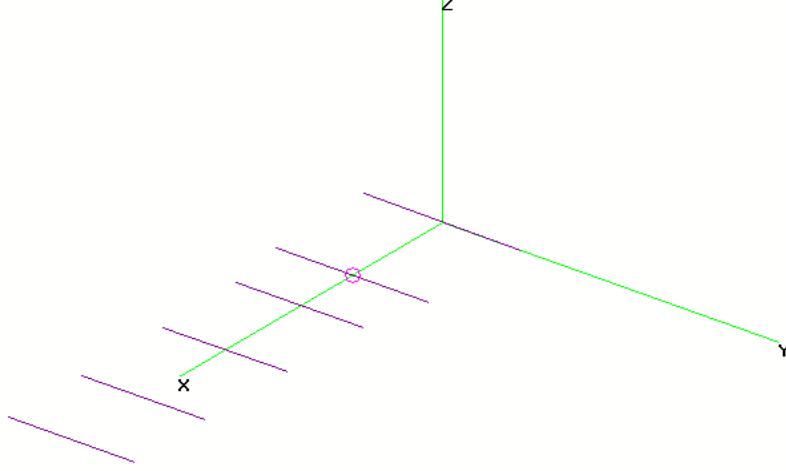


Fig. 18. 4nec2 geometry display for *Variable-Z₀* 6-element Yagi design #1.

```

CM File: YAGI.NEC
CM YAGI ARRAY IN FREE SPACE
CM Band center frequency, Fc = 299.8 MHZ
CM Run ID: 07102011_205004
CM Fitness function:
CM Gfwd(L)/5-2*VSWR(L)+Gfwd(M)-4*VSWR(M)+Gfwd(U)-2*VSWR(U)/5
CM where L,M,U are lower/mid/upper frequencies
CM Zo=65.75 ohms
CM File ID 07122011125139
CM Nd= 13, p= 20, j= 160
CE
GW1,9,0,,-.234,0.,.0.,.234,0.,.00635
GW2,9,,-.343,,-.228,0.,.343,,-.228,0.,.00635
GW3,9,,-.54,,-.19,0.,.54,,-.19,0.,.00635
GW4,9,,-.827,,-.186,0.,.827,,-.186,0.,.00635
GW5,9,1.137,,-.184,0.,.1.137,,-.184,0.,.00635
GW6,9,1.41,,-.189,0.,.1.41,,-.189,0.,.00635
GE
FR 0,1501,0,0,200,..1
EX 0,2,5,1,1,0.
RP 0,19,19,1001,0.,0.,5.,10.,100000.
EN

```

Fig. 19. *Variable-Z₀* Yagi design #1 NEC4 input file.

The antenna was CFO-optimized against the following fitness function (to be maximized):

$$F(Z_0, L_i, S_j) = c_1 \cdot G_{\text{fwd}}(f_L) - c_2 \cdot \text{VSWR}(f_L) + c_3 \cdot G_{\text{fwd}}(f_C) - c_4 \cdot \text{VSWR}(f_C) + c_5 \cdot G_{\text{fwd}}(f_U) - c_6 \cdot \text{VSWR}(f_U)$$

L_i , $i = 1, \dots, 6$ and S_j , $j = 1, \dots, 5$ are the element lengths and spacings, respectively. The constants c_i are empirically determined weighting coefficients; $G_{\text{fwd}}(f)$ the Yagi's forward directivity (along the +X-

axis, $\theta = 90^\circ$, $\phi = 0^\circ$); and f_L , f_C , and f_U , respectively, the lower, center, and upper frequencies defining the band within which the Yagi is optimized.

The same CFO parameters that were used for the loaded bowtie were used for the two Yagi designs, but with $\max\left(\frac{N_p}{N_d}\right) = 6$ for both antennas, and with $N_t = 250$, $N_t = 200$ for the first and second designs, respectively. Note that, although the Yagi problem contains 12 design *variables*, as a matter of programming convenience in dealing with array dimensions, CFO treats the problem as 13-D. The Yagi element REF is assigned a fixed “spacing” of zero because it is placed on the Y-axis, and this is the 13th “variable” (see the source code listing in Appendix I for details). For Yagi design #1, CFO’s best fitness was 14.62534041 (CFO probe #20) with $\frac{N_p}{N_d} = 4$ and $\gamma = 0.6$ at step 160, while for design #2 it was 0.93193733 (probe #28) with $\frac{N_p}{N_d} = 4$ and $\gamma = 0.2$ at step 168.

The decision space was $0.2 \leq L_i \leq 0.6\lambda$, $0.1 \leq S_j \leq 0.5\lambda$, where λ is the wavelength corresponding to the band center frequency f_C . The *variable* feed system impedance was bounded by $5 \leq Z_0 \leq 600 \Omega$. The first Yagi was optimized over the band 275-325 MHz and the second over 250-350 MHz (in both cases $\lambda \approx 1\text{m}$ @ f_C). In post processing, performance was computed from 200-350 MHz every 0.1 MHz. All array elements have the same radius 0.00635λ (0.5-inch diameter elements at 299.8 MHz). In the NEC4 model, lengths were rounded to three decimal places (except radius) and Z_0 to two. The fitness weighting coefficients are tabulated in Fig. 20.

Design #	c_1	c_2	c_3	c_4	c_5	c_6
1	0.2	2	1	4	1	0.4
2	0.2	4	1	8	1	0.8

Fig. 20. *Variable-* Z_0 Yagi fitness coefficients.

Fig. 21 plots the evolution of CFO’s best fitness for design #1, while Fig. 22 shows the convergence of CFO’s probes onto the maximum (D_{avg} is the average distance between the probe with the best fitness and all other probes). The best probe number as a function of time step appears in Fig. 23. These results are typical of CFO’s behavior, both on antenna problems and on established benchmark functions (see, for example, [25-27]).

The optimum feed system impedance computed by CFO was $Z_0 = 65.75 \Omega$ for design #1 and $Z_0 = 89.88 \Omega$ for design #2. Although Yagi arrays are generally considered “low” impedance antennas (typically $Z_{in} \approx 10 - 30 \Omega$), the optimized feed system Z_0 ’s are relatively high. These values, however, are more readily matched to the “standard” values of $50 - 75 \Omega$, which is a fortuitous outcome. The optimized array geometry is tabulated in Fig. 24. The spacings have been added to specify each element’s position (X – coordinate, “boom dist”) along the Yagi’s boom (+ X – axis).

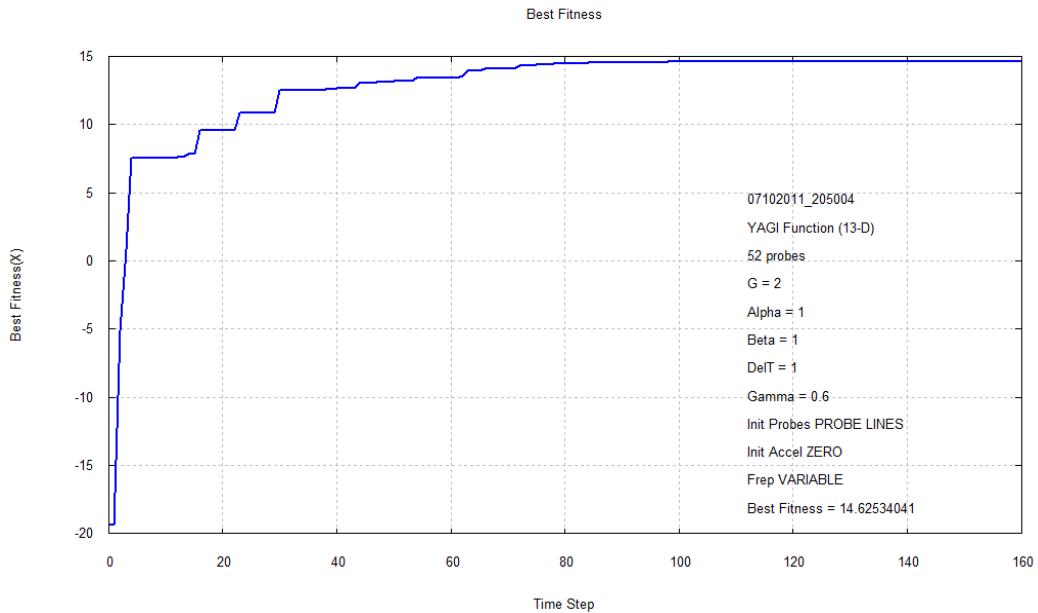


Fig. 21. $Variable-Z_0$ CFO fitness evolution for Yagi design #1.

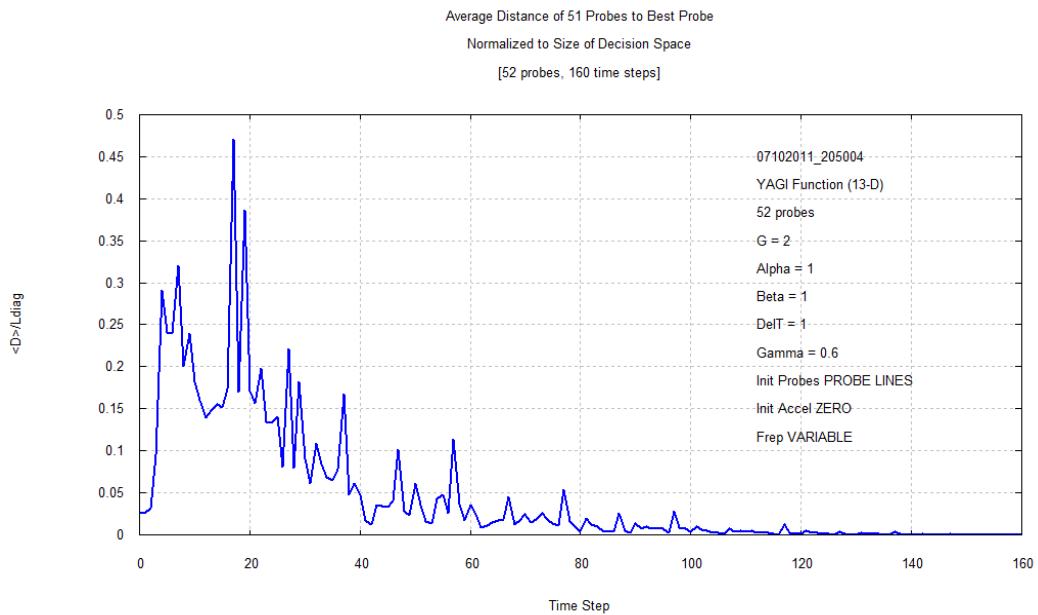


Fig. 22. $Variable-Z_0$ CFO D_{avg} evolution for Yagi design #1.

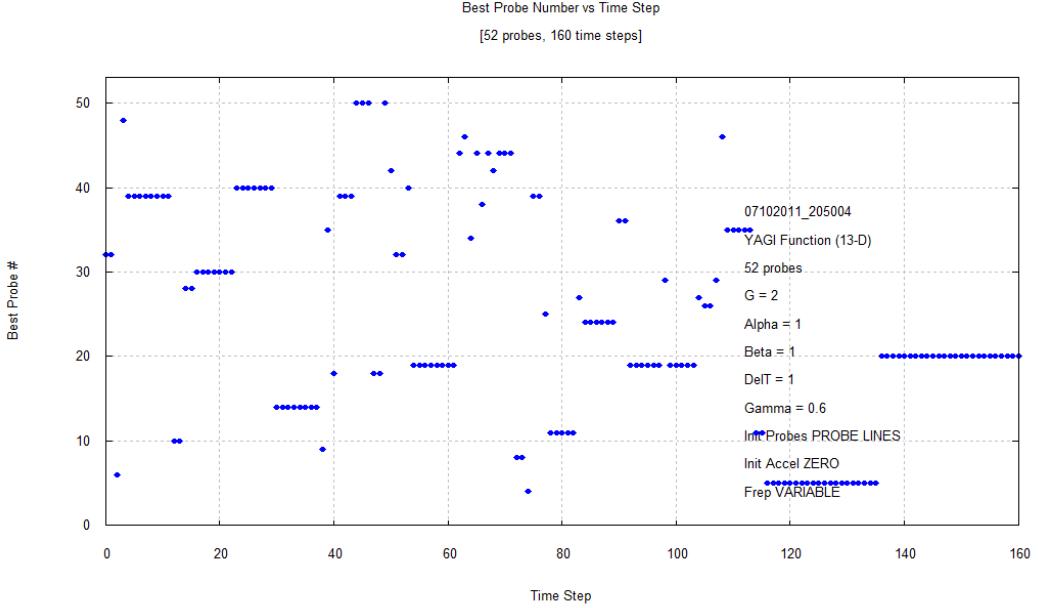


Fig. 23. $Variable-Z_0$ CFO best probe evolution for Yagi design #1.

element #	design #1 ($Z_0 = 65.75 \Omega$)		design #2 ($Z_0 = 89.88 \Omega$)	
	length (λ)	boom dist (λ)	length (λ)	boom dist (λ)
1(REF)	0.468	0	0.564	0
2 (DE)	0.456	0.343	0.500	0.305
3	0.380	0.540	0.370	0.434
4	0.372	0.827	0.360	0.715
5	0.368	1.137	0.364	0.921
6	0.378	1.410	0.344	1.238

Fig. 24. Geometry of $Variable-Z_0$ CFO-optimized Yagi arrays.

VSWR curves for the $Variable Z_0$ optimized Yagis appear in Fig. 25 (note, $0.994 \leq AGT \leq 0.998$ not plotted). For design #1, $VSWR//65.75\Omega \leq 2:1$ from 273.5 MHz to 319.6 MHz and from 329.3 MHz to 333.8 MHz with a peak of 2.2:1 between these bands at 324.8 MHz. As a practical matter, the 2:1 VSWR IBW can be reasonably considered to be 273.5-333.8 MHz (60.3 MHz) centered on 303.65 MHz, resulting in an IBW of 19.86%. This bandwidth is quite large for a Yagi, which usually is thought of as “narrowband” structure (typically, IBW of a few percent).

The performance of design # 2 is even better. Its VSWR is less than 2:1 from 249.7 to 322.7 MHz (73 MHz) centered at 286.2 MHz for an IBW of 25.5%, which is quite remarkable because this erstwhile “narrowband” device actually exhibits **UWB** performance without any impedance loading or other measures to increase bandwidth. Of course, for these two designs, matching the optimized feed system impedances of $Z_0 = 65.75 \Omega$ and $Z_0 = 89.88 \Omega$ to the usual 50Ω requires 1.32:1 and 1.8:1 broadband transformers, respectively (or other suitable matching device).

These interesting results highlight another consideration in antenna design, the effect of different fitness functions on the resulting antenna. Any change in the objective function, however slight, changes the decision space landscape, and, consequently, the “optimum” antenna in that new landscape. The

question is, How to specify an objective function that actually meets specific performance objectives?, a conundrum not easily answered. The best way to address it is with a *deterministic* optimizer instead of a *stochastic* one. Deterministic algorithms like CFO return the same result for every run with the same setup parameters, while stochastic metaheuristics, ACO or PSO, for example, yield different results with every run because they rely on variables whose values are unknowable in advance of their being calculated from a probability distribution.

The only way the antenna designer can know that changing the fitness function actually produced a better antenna, instead of being the result of an optimizer's inherent stochasticity, is by using a deterministic algorithm. If this run's Yagi is better than the last, is it because of those new coefficients, or, instead, luck of the draw? There simply is no way to know. The flip side is that a genuinely better objective function might produce a worse antenna if it is used with a stochastic optimizer.

Deterministic metaheuristics such as CFO are much better suited to real world problems like designing antennas, an issue discussed at greater length in [25] by way of an example (resistively loaded monopole). In the Yagi designs considered here, changing the fitness coefficients slightly produced significantly different antennas. Yet another set of coefficients will yield yet another optimal design, and a different fitness function altogether will result in possibly quite different antennas. In this regard, the *Variable Z_0* methodology is advantageous because it provides additional flexibility in meeting specific performance goals by creating a decision landscape with one more degree of freedom, a landscape that should be searched deterministically.

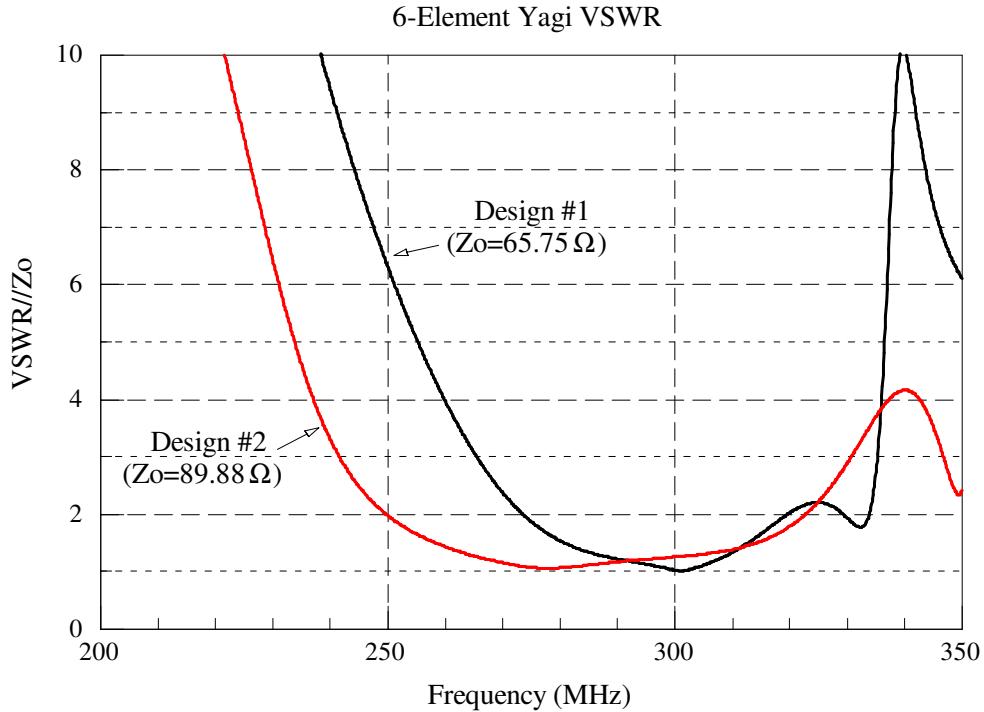


Fig. 25. *Variable- Z_0* CFO-optimized Yagi $VSWR//Z_0$.

Figs. 26-28, respectively, plot the two Yagis' G_{fwd} , R_{in} , and X_{in} . The gain for design #1 increases monotonically from 8.29 dBi at 273.5 MHz to 11.96 dBi at 333.8 MHz with a band-center gain of 9.73 dBi at 303.15 MHz. The corresponding values for design #2 are 7.66 dBi at 249.7 MHz, 9.5 dBi at 322.7 MHz, and 7.39 dBi at 286.2 MHz; and the gain is flatter than for design #1. These figures are quite good for a Yagi array with such large IBW. For example, the "A3" wideband Yagi design reported in [28] has $VSWR//50\Omega \leq 2:1$ from 262.5-309.8 MHz centered at 286.15 MHz (IBW 16.53%) with a maximum

in-band G_{fwd} of 10.24 dBi as computed by NEC4. This antenna was optimized using the traditional approach of fixing Z_0 at $50\ \Omega$ with a deterministic optimizer (DCLS). While the *Variable* Z_0 Yagis and the DCLS-optimized array cannot be compared “head-to-head” because different optimization objectives were used, their performances can be compared as being representative of the state-of-the-art for broadband array design. This comparison clearly shows that the *Variable* Z_0 approach can produce better antennas.

Turning to the input impedance, R_{in} is moderate across the band for both Yagis, but large fluctuations begin to appear at the high end. X_{in} also is moderate and increases monotonically across the band, almost linearly. Each Yagi exhibits a single resonance, design #1 at 301.05 MHz and design #2 at 274.7 MHz.

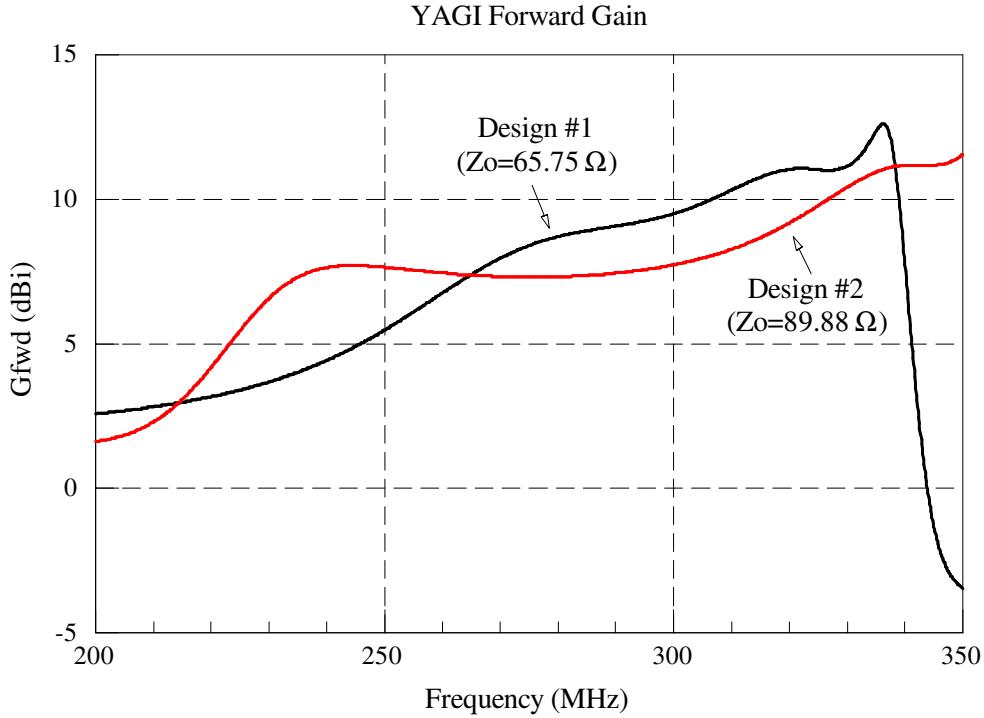


Fig. 26. *Variable*- Z_0 CFO-optimized Yagi G_{fwd} .

7. Conclusion

This paper describes *Variable* Z_0 , which, to the author’s knowledge, is a novel and proprietary methodology for antenna design and optimization. As an example, *Variable* Z_0 is applied to designing a CFO-optimized resistively-loaded bowtie antenna and two broadband Yagi-Uda arrays, both with good results. The resulting bowtie exhibits UWB properties in two bands useful for UWB systems, and one of the Yagis is UWB without any broadbanding mechanism such as impedance-loading. The performance of the *Variable* Z_0 Yagis compares very favorably to another state-of-the-art deterministically optimized array.

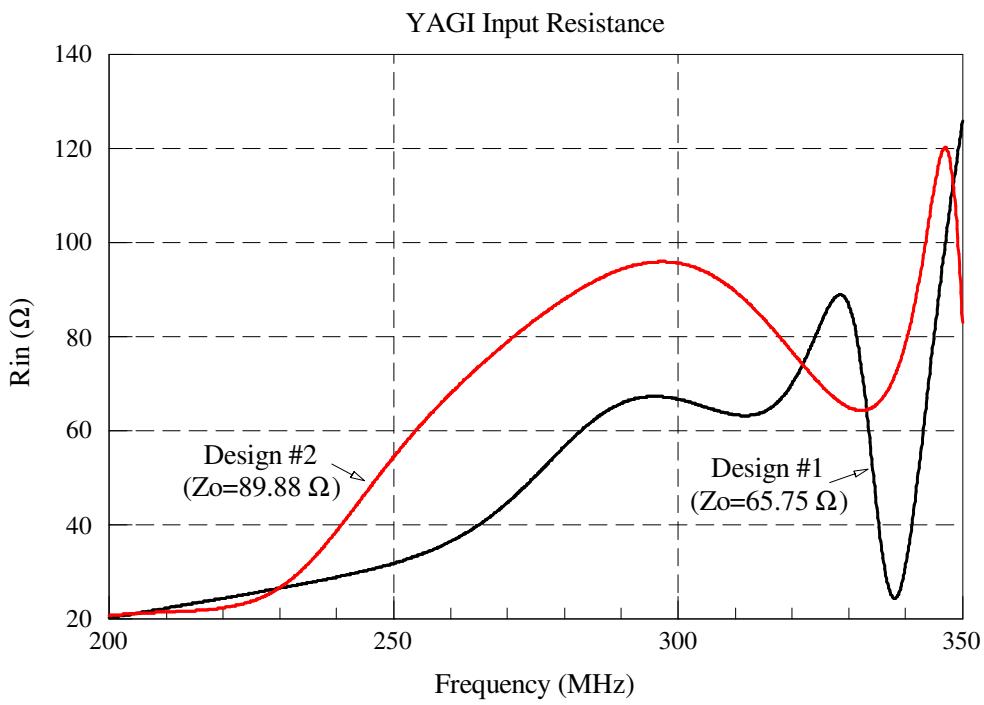


Fig. 27. Variable- Z_0 CFO-optimized Yagi R_{in} .

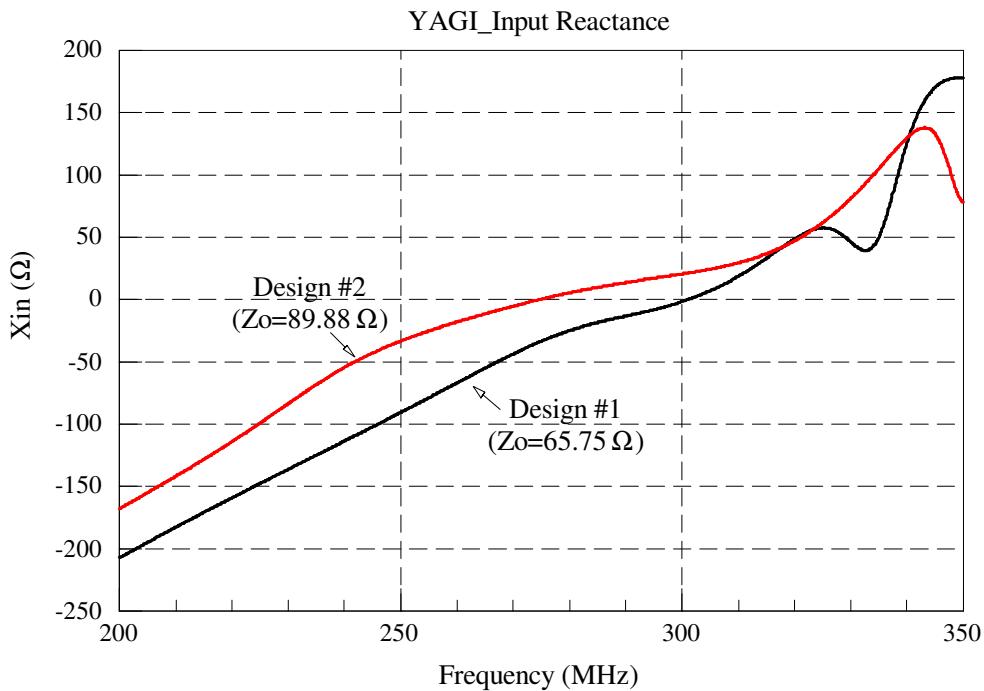


Fig. 28. Variable- Z_0 CFO-optimized Yagi X_{in} .

References

1. Zehforoosh, Y., Ghobadi, C., and Nourinia, J., "Antenna Design for Ultra Wideband Application Using a New Multilayer Structure," *PIERS Online*, vol. 2, no. 6, 2006, pp. 544-549.
2. Hoorfar, A., "Evolutionary Programming in Electromagnetic Optimization: A Review," *IEEE Transactions on Antennas and Propagation*, vol. 55, no. 3, March 2007, pp. 523-537.
3. Hashemi, S. M., Nayyeri, V., Soleimani, M., and Mallahzadeh, A-R., "Designing a Compact-Optimized Planar Dipole Array Antenna," *IEEE Antennas and Wireless Propagation Letters*, Vol. 10, 2011, pp. 243-246.
4. Yilmaz, O. N. C., Hamalainen, S., and Hamalainen, J., "Analysis of Antenna Parameter Optimization Space for GPP LTE," *IEEE 70th Vehicular Technology Conference Fall (VTC 2009-Fall)*, 2009, pp. 1-5 (doi: 10.1109/VETECF.2009.5379077)
5. Boryssenko, A. O., "Taxonomical and Heuristic Studies on UWB Antenna Design Strategies," *High Frequency Electronics Magazine*, August 2009, pp. 38-48.
6. Tawk, Y., Kaban, K. Y., El-Hajj, A., Christodoulou, C. G., and Costantine, J., "A Simple Multiband Printed Bowtie Antenna," *IEEE Antennas and Wireless Propagation Letters*, Vol. 7, 2008, pp. 557-560.
7. Kiminami, K., Hirata, A., and Shiozawa, T., Double-Sided Printed Bow-Tie Antenna for UWB Communications," *IEEE Antennas and Wireless Propagation Letters*, Vol. 3, 2004, pp. 152-153.
8. Chen, Y.-L., Ruan, C.-L., and Peng, L., "A Novel Ultra-Wideband Bow-Tie Slot Antenna in Wireless Communication Systems," *Progress in Electromagnetics Research Letters*, Vol. 1, 101-108, 2008.
9. Kim, Y.-G., Woo, D.-S., Kim, K. W., and Cho, Y.-K., "Design of Bow-Tie-Type UWB Antennas Using an Ultra-wideband Balun," *IEEE 2007 Antennas and Propagation Society International Symposium*, pp. 1989-1992, (doi: 10.1109/APS.2007.4395913)
10. Li, C. M., and Ye, L. H., "Improved Dual Band-Notched UWB Slot Antenna with Controllable Notched Bandwidths," *Progress in Electromagnetics Research*, vol. 115, 477-493, 2011.
11. Li, J.-F., Sun, B.-H., and Liu, Q.-Z., "PSO-Based Fast Optimization Algorithm for Broadband Array Antenna by Using the Cubic Spline Interpolation," *Progress in Electromagnetics Research Letters*, Vol. 4, 173-181, 2008.
12. Jolani, F., Dadashzadeh, G., Naser-Moghadasi, M., and Dadgarpour, A., "Design and Optimization of Compact Balanced Antipodal Vivaldi Antenna," *Progress in Electromagnetic Research C*, Vol. 9, 183-192, 2009.
13. Formato, R. A., "New Techniques for Increasing Antenna Bandwidth with Impedance Loading," *Progress in Electromagnetics Research B*, Vol. 29, 269-288, 2011.
14. Burke, G. J., and Poggio, A. J., "Numerical Electromagnetics Code (NEC) – Method of Moments," Parts I, II and III, January 1981, UCID-19934, Lawrence Livermore National Laboratory, Livermore, California, USA
15. Burke, G. J., "Numerical Electromagnetics Code – NEC-4, Method of Moments, Part I: User's Manual and Part II: Program Description – Theory," January 1992, UCRL-MA-109338, Lawrence Livermore National Laboratory, Livermore, California, USA
(<https://ipo.llnl.gov/technology/software/softwaretitles/nec.php>).
16. (i) "4nec2" antenna modeling freeware by Arie Voors, available online at <http://home.ict.nl/~arivoors/>. (ii) Unofficial Numerical Electromagnetic Code (NEC) Archives, online at <http://www.si-list.net/swindex.html>
17. Formato, R. A., "Central Force Optimization: A New Metaheuristic with Applications in Applied Electromagnetics," *Prog. Electromagnetics Research*, vol. PIER 77, pp. 425-491, 2007:
<http://www.jpier.org/pier/pier.php?paper=07082403>
(doi:10.2528/PIER07082403).
18. Kennedy, J., and Eberhart, R., "Particle Swarm Optimization," *Proc. IEEE Conf. On Neural Networks*, 4 (Nov/Dec), 1942-1948, 1995.
19. Dorigo, M., Maniezzo, V., and Colorni, A., "Positive feedback as a search strategy," Dipartimento di Elettronica, Politecnico di Milano, Italy, Tech. Rep. 91-016, 1991: http://iridia.ulb.ac.be/~mdorigo/pub_x_subj.html
20. He, S., Wu, Q. H., Saunders, J. R., "Group Search Optimizer: An Optimization Algorithm Inspired by Animal Searching Behavior," *IEEE Trans. Evol. Computation*, vol. 13, no. 5, pp. 973-990, Oct. 2009.
21. A. Chowdhury, A. Ghosh, R. Giri, and S. Das, "Optimization of Antenna Configuration with a Fitness-adaptive Differential Evolution Algorithm," *Progress In Electromagnetics Research B*, Vol. 26, 291-319, 2010.

22. Formato, R. A., "Parameter-Free Deterministic Global Search with Simplified Central Force Optimization," in **Advanced Intelligent Computing Theories and Applications (ICIC2010)**, Lecture Notes in Computer Science (D.-S. Huang, Z. Zhao, V. Bevilacqua and J, C, Figueroa, Eds.), LNCS 6215, pp. 309–318, Springer-Verlag Berlin Heidelberg, 2010.
23. Formato, R. A., "Improved CFO Algorithm for Antenna Optimization," *Prog. Electromagnetics Research B*, pp. 405-425, 2010. <http://www.jpier.org/pierb/pier.php?paper=09112309> (doi:10.2528/PIERB09112309).
24. Formato, R. A., "Central Force Optimization with Variable Initial Probes and Adaptive Decision Space," *Applied Mathematics and Computation*, Vol. 217, 2011, pp. 8866-8872.
25. Formato, R. A., "Issues in Antenna Optimization – A Monopole Case Study," March, 2011. <http://arXiv.org/abs/1103.5629>.
26. Formato, R. A, "Central Force Optimization Applied to the PBM Suite of Antenna Benchmarks," Feb., 2010. <http://arXiv.org/abs/1003.0221>.
27. Formato, R. A, "Comparative Results: Group Search Optimizer and Central Force Optimization," Feb., 2010. <http://arXiv.org/abs/1002.2798>.
28. Lisboa, A. C., Vieira, D. A. G., , Vasconcelos, J. A., Saldanha, R. R., and Takahashi, R. H. C., "Monotonically Improving Yagi-Uda Conflicting Specifications Using the Dominating Cone Line Search Method," *IEEE Trans. Magnetics*, vol. 45, no. 3, March 2009, pp. 1494-1497.

*14 July 2011
Brewster, Massachusetts*

© 2011 Richard A. Formato
All rights reserved worldwide.

Appendix I

```

'Program 'CFO_R_ONLY_LOADED_BOWTIE_YAGI_07-10-2011.BAS'
'Compiled with Power Basic/Windows Compiler 9.04.0122 (www.PowerBasic.com).
'CFO-OPTIMIZED R-LOADED (1 RESISTOR/ARM) BOWTIE IN FREE SPACE AND
'FS YAGI-UDA ARRAY BOTH WITH ZO AS AN OPTIMIZATION <<<VARIABLE>>>.
'LAST MOD 07-10-2011 ~2049 HRS EDT

***** YAGI FITNESS FUNCTION *****
THE USER CAN USE THE FOLLOWING FITNESS FUNCTION:
F=[A*(Max(Xin)-Min(Xin))]^B/[Zo-Max(Rin)]^C
WHERE THE COEFFICIENTS A, B, and C are USER-SPECIFIED IN THE FILE
YagiCoeff.TXT. THIS FILE MUST CONTAIN FOUR LINES WITH A, B, C,
AND D, RESPECTIVELY, ON ONE LINE EACH. IF THE FILE DOES NOT
EXIST, A DEFAULT FILE IS CREATED WITH A=20, B=2, C=3, D=4.
OR, SOME OTHER FITNESS MAY BE HARDWIRED IN THE YAGI FUNCTION.
CHECK THE SOURCE LISTING TO SEE WHICH IS BEING USED.

***** YAGI CFO SETUP PARAMETERS *****
THE TEXT FILE YAGI_CFO.CFG CONTAINS THREE CFO SETUP PARAMETERS:
Nt& (# time steps)
NumGammas%# gamma values)
MaxProbesPerDimension% (max # probes/dim on probe lines)
EACH ONE MUST BE ENTERED AS A NUMBER ON A SEPARATE LINE. IF THE
FILE YAGI_CFO.CFG DOES NOT EXIST, A DEFAULT VERSION IS CREATED.
THIS APPLIES ONLY TO THE YAGI MODEL. OTHER BUILT-IN BENCHMARK
FUNCTIONS USE THE HARDWIRED INTERNAL VALUES FOR THESE PARAMETERS.

***** IMPORTANT MODELING NOTE *****
THE YAGI ELEMENT SEGMENT LENGTH IN NEC CAN BE VARIABLE OR FIXED.
IF FIXED, THEN THE NUMBER OF SEGMENTS VARIES FROM ONE ELEMENT TO
THE NEXT, BUT ALL SEGMENTS ARE PERFECTLY ALIGNED, WHICH, AS A
GENERAL RULE IS RECOMMENDED IN THE NEC MODELING GUIDELINES. BUT
EXPERIENCE SUGGESTS THAT THIS IS NOT NECESSARILY THE BEST
APPROACH UNDER ALL CIRCUMSTANCES, SO VARIABLE LENGTH SEGMENTS
ARE ALLOWED AS WELL. SEGMENTATION MUST BE VALIDATED USING THE
NEC-RECOMMENDED AGT TEST. THE SETUP FILE 'YagiSeg.TXT' CONTAINS
TWO LINES. THE FIRST IS EITHER THE WORD 'VARIABLE' (NO QUOTES)
OR THE WORD 'FIXED,' WHICH DETERMINES WHETHER VARIABLE LENGTH OR
FIXED LENGTH SEGMENTS ARE USED. THE NEXT LINE IS THE SEGMENT
LENGTH IN WAVELENGTHS (RANGE 0.02-0.2). THIS FILE WILL BE
CREATED IF IT DOES NOT EXIST USING VARIABLE SEGMENT LENGTH AS
THE DEFAULT WITH 9 SEGMENTS PER ARRAY ELEMENT. NOTE THAT IF
FIXED SEGMENT LENGTH IS USED, EACH ELEMENT'S PHYSICAL LENGTH
IS ADJUSTED TO BE AN INTEGER NUMBER OF SEGMENTS IN ORDER TO
ALIGN EVERY SEGMENT.

***** BOWTIE FITNESS FUNCTION *****
THE HARDWIRED BOWTIE FITNESS FUNCTION IS:
F=[Min(Eff)+5*Min(Gmax)]/{[Zo-Max(Rin)]^2*[Max(VSWR)-Min(VSWR)]*
[Max(Vin)-Min(Xin)]}

***** BOWTIE CFO SETUP PARAMETERS *****
THE TEXT FILE BOWTIE_CFO.CFG CONTAINS THREE CFO SETUP PARAMETERS:
Nt& (# time steps)
NumGammas%# gamma values)
MaxProbesPerDimension% (max # probes/dim on probe lines)
EACH ONE MUST BE ENTERED AS A NUMBER ON A SEPARATE LINE. IF THE
FILE BOWTIE_CFO.CFG DOES NOT EXIST, A DEFAULT VERSION IS CREATED.
THIS APPLIES ONLY TO THE BOWTIE MODEL. OTHER BUILT-IN BENCHMARK
FUNCTIONS USE THE HARDWIRED INTERNAL VALUES FOR THESE PARAMETERS.

=====

NOTE: ALL PBM FUNCTIONS HAVE WIRE RADIUS SET TO 0.00001 LAMBDA

=====

'THIS PROGRAM IMPLEMENTS A SIMPLE VERSION OF "CENTRAL
FORCE OPTIMIZATION." IT IS DISTRIBUTED FREE OF CHARGE
TO INCREASE AWARENESS OF CFO AND TO ENCOURAGE EXPERI-
MENTATION WITH THE ALGORITHM.

'CFO IS A MULTIDIMENSIONAL SEARCH AND OPTIMIZATION
ALGORITHM THAT LOCATES THE GLOBAL MAXIMA OF A FUNCTION.
UNLIKE MOST OTHER ALGORITHMS, CFO IS COMPLETELY DETERMIN-
ISTIC, SO THAT EVERY RUN WITH THE SAME SETUP PRODUCES
THE SAME RESULTS.

'(c) 2006-2011 Richard A. Formato
'ALL RIGHTS RESERVED WORLDWIDE

'THIS PROGRAM IS FREWARE. IT MAY BE COPIED AND
'DISTRIBUTED WITHOUT LIMITATION AS LONG AS THIS
'COPYRIGHT NOTICE AND THE GNUPLOT AND REFERENCE
'INFORMATION BELOW ARE INCLUDED WITHOUT MODIFICATION,
'AND AS LONG AS NO FEE OR COMPENSATION IS CHARGED,
'INCLUDING "TIE-IN" OR "BUNDLING" FEES CHARGED FOR
'OTHER PRODUCTS.

=====

'THIS PROGRAM REQUIRES wgnuplot.exe TO DISPLAY PLOTS.
'Gnuplot is a copyrighted freeware plotting program
'available at http://www.gnuplot.info/index.html.

'IT ALSO REQUIRES A VERSION OF THE Numerical Electromagnetics
'Code (NEC) in order to run the PBM benchmarks, Bowtie and Yagi
'antenna models. If this file is not present, a runtime error
'occurs. Remove the code that checks for the NEC EXE is there
'there is no interest in the these functions.

=====

'CFO REFERENCES (author: Richard A. Formato unless otherwise noted)

'A Novel Methodology for Antenna Design and Optimization: Variable zo," July 2011, http://arxiv.org/abs/1107.1437.
'"Central Force Optimization with Variable Initial Probes and Adaptive Decision Space," Applied Mathematics and Computation,
Vol. 217, 2011, pp. 8866-8872, 2011.
'"New Techniques for Increasing Antenna Bandwidth with Impedance Loading," Progress In Electromagnetics Research B, vol. 29, pp. 269-288, 2011,
http://www.jpier.org/pierb/pier.php?paper=11021904.
'"Parameter-Free Deterministic Global Search with Simplified Central Force Optimization," in Advanced Intelligent Computing Theories and
Applications (ICIC2010), Lecture Notes in Computer Science (D.-S. Huang, Z. Zhao, V. Bevilacqua and J. C. Figueroa,Eds.), LNCS 6215, pp. 309-318,
Springer-Verlag Berlin Heidelberg, 2010 [book chapter].
'"Antenna Benchmark Performance and Array Synthesis using Central Force Optimization," IET (U.K.) Microwaves, Antennas & Propagation vol. 4, no. 5,
pp. 583-592, 2010. (doi: 10.1049/iet-map.2009.0147). [with G. M. Qubati and N. I. Dib].
'"Improved CFO Algorithm for Antenna Optimization," Prog. Electromagnetics Research B, pp. 405-425, 2010
http://www.jpier.org/pierb/pier.php?paper=09112309 (doi:10.2528/PIERB09112309).
```

```

'"Central Force Optimization and NEOs - First Cousins?," Journal of Multiple-valued Logic and Soft Computing, vol. 16, pp. 547-565, 2010.
'"Convergence Analysis and Performance of the Extended Artificial Physics Optimization Algorithm," Applied Mathematics and Computation (in press)
'[with L. Xie and J. Zeng].
'"Central Force Optimization with Variable Initial Probes and Adaptive Decision Space," Applied Mathematics and Computation, July 2011.
'"High-Performance Indoor VHF-UHF Antennas: Technology Update Report," National Association of Broadcasters (NAB), FASTROAD (Flexible Advanced Services for Television and Radio On All Devices), Technology Advocacy Program, 15 May 2010 [with M. W. Cross and E. Merulla]
'<http://www.nabfastroad.org/NABHighperformanceIndoorTVantennaRpt.pdf>
'"Central Force Optimisation: New Gradient-Like Metaheuristic for Multidimensional Search and Optimisation," Int. J. Bio-Inspired Computation, vol. 1, no. 4, pp. 217-238, 2009. (doi: 10.1504/IJBC.2009.024721).
'"Central Force Optimization: New Deterministic Gradient-Like Optimization Metaheuristic," OPSEARCH, Journal of the Operations Research Society of India, vol. 46, no. 1, pp. 25-51, 2009. (doi: 10.1007/s12597-009-0003-4).
'"Central Force Optimization: A New Computational Framework for Multidimensional Search and Optimization," in Nature Inspired Cooperative Strategies for Optimization (NICSO 2007), Studies in Computational Intelligence 129 (N. Krasnogor, G. Nicosia, M. Pavone, and D. Pelta, Eds.), vol. 129, Springer-Verlag, Heidelberg, 2008 [book chapter].
'"Central Force Optimization: A New Metaheuristic with Applications in Applied Electromagnetics," Prog. Electromagnetics Research, vol. PIER 77, pp. 425-491, 2007: <http://www.jpier.org/pier/pier.php?paper=07082403> (doi:10.2528/PIER07082403).
'"Are Near Earth Objects the Key to Optimization Theory?," Dec., 2009. <http://arxiv.org/abs/0912.1394.
'"Pseudorandomness in Central Force Optimization," Jan., 2010. <http://arxiv.org/abs/1001.0317.
'"Central Force Optimization Applied to the PBM Suite of Antenna Benchmarks," Feb., 2010, <http://arxiv.org/abs/1003.0221.
'"On the Utility of Directional Information for Repositioning Errant Probes in Central Force Optimization," May, 2010, <http://arxiv.org/abs/1005.5490.
'"Issues in Antenna Optimization - A Monopole Case Study," Mar., 2011. <http://arxiv.org/abs/1103.5629.
'"Central Force Optimization with Variable Initial Probes and Adaptive Decision Space," Applied Mathematics and Computation, vol. 217, 2011, pp. 8866-8872.
'=====
=====

#COMPILE EXE
#DIM ALL
%USEMACROS = 1
#include "Win32API.inc"
DEFEXT A-Z
'----- EQUATES -----
%IDC_FRAME1      = 101
%IDC_FRAME2      = 102
%IDC_Function_Number1 = 121
%IDC_Function_Number2 = 122
%IDC_Function_Number3 = 123
%IDC_Function_Number4 = 124
%IDC_Function_Number5 = 125
%IDC_Function_Number6 = 126
%IDC_Function_Number7 = 127
%IDC_Function_Number8 = 128
%IDC_Function_Number9 = 129
%IDC_Function_Number10 = 130
%IDC_Function_Number11 = 131
%IDC_Function_Number12 = 132
%IDC_Function_Number13 = 133
%IDC_Function_Number14 = 134
%IDC_Function_Number15 = 135
%IDC_Function_Number16 = 136
%IDC_Function_Number17 = 137
%IDC_Function_Number18 = 138
%IDC_Function_Number19 = 139
%IDC_Function_Number20 = 140
%IDC_Function_Number21 = 141
%IDC_Function_Number22 = 142
%IDC_Function_Number23 = 143
%IDC_Function_Number24 = 144
%IDC_Function_Number25 = 145
%IDC_Function_Number26 = 146
%IDC_Function_Number27 = 147
%IDC_Function_Number28 = 148
%IDC_Function_Number29 = 149
%IDC_Function_Number30 = 150
%IDC_Function_Number31 = 151
%IDC_Function_Number32 = 152
%IDC_Function_Number33 = 153
%IDC_Function_Number34 = 154
%IDC_Function_Number35 = 155
%IDC_Function_Number36 = 156
%IDC_Function_Number37 = 157
%IDC_Function_Number38 = 158
%IDC_Function_Number39 = 159
%IDC_Function_Number40 = 160
%IDC_Function_Number41 = 161
%IDC_Function_Number42 = 162
%IDC_Function_Number43 = 163
%IDC_Function_Number44 = 164
%IDC_Function_Number45 = 165
%IDC_Function_Number46 = 166
%IDC_Function_Number47 = 167
%IDC_Function_Number48 = 168
%IDC_Function_Number49 = 169
%IDC_Function_Number50 = 170
'----- GLOBAL CONSTANTS & SYMBOLS -----
GLOBAL YagiSegmentLength$, YagiCoefficients$
GLOBAL NumYagiElements% 'added 05/12/2011 instead of passing in function call
GLOBAL YAGIsecsPerRun, YagiSegmentLengthwVln, YagiFitnessCoefficients() AS EXT
GLOBAL BowtieSegmentLength$, BowtieCoefficients$
GLOBAL NumBowtieElements% 'added 05/12/2011 instead of passing in function call
GLOBAL BOWTIEsecsPerRun, BowtieSegmentLengthwVln, BowtieFitnessCoefficients() AS EXT
GLOBAL Xioffset() AS EXT 'offset array for Rosenbrock F6 function
GLOBAL XiMin(), XiMax(), DiagLength, StartingXiMin(), StartingXiMax() AS EXT 'decision space boundaries, length of diagonal
GLOBAL Aij() AS EXT 'array for Shekel's Foxholes function
GLOBAL EulerConst, Pi, Pi2, Pi4, TwoPi, FourPi, e, Root2 AS EXT 'mathematical constants
GLOBAL Alphabet$, Digits$, RunIDs$ 'upper/lower case alphabet, digits 0-9 & Run ID

```

```

GLOBAL Quote$, SpecialCharacters$ 'quotation mark & special symbols
GLOBAL Mu0, Eps0, c, eta0 AS EXT   'E&M constants
GLOBAL Rad2Deg, Deg2Rad, Feet2Meters, Meters2Feet, Inches2Meters, Meters2Inches AS EXT 'conversion factors
GLOBAL Miles2Meters, Meters2Miles, NautMi2Meters, Meters2NautMi AS EXT           'conversion factors
GLOBAL ScreenWidth&, ScreenHeight& 'screen width & height
GLOBAL xoffset&, yoffset&          'offsets for probe plot windows
GLOBAL FunctionNumber%
GLOBAL AddnoiseToPBM2$

'----- TEST FUNCTION DECLARATIONS -----
DECLARE FUNCTION F1(R(),Nd%,p%,j&)          'F1 (n-D)
DECLARE FUNCTION F2(R(),Nd%,p%,j&)          'F2 (n-D)
DECLARE FUNCTION F3(R(),Nd%,p%,j&)          'F3 (n-D)
DECLARE FUNCTION F4(R(),Nd%,p%,j&)          'F4 (n-D)
DECLARE FUNCTION F5(R(),Nd%,p%,j&)          'F5 (n-D)
DECLARE FUNCTION F6(R(),Nd%,p%,j&)          'F6 (n-D)
DECLARE FUNCTION F7(R(),Nd%,p%,j&)          'F7 (n-D)
DECLARE FUNCTION F8(R(),Nd%,p%,j&)          'F8 (n-D)
DECLARE FUNCTION F9(R(),Nd%,p%,j&)          'F9 (n-D)
DECLARE FUNCTION F10(R(),Nd%,p%,j&)         'F10 (n-D)
DECLARE FUNCTION F11(R(),Nd%,p%,j&)         'F11 (n-D)
DECLARE FUNCTION F12(R(),Nd%,p%,j&)         'F12 (n-D)
DECLARE FUNCTION u(Xi,a,k,m)                  'Auxiliary function for F12 & F13
DECLARE FUNCTION F13(R(),Nd%,p%,j&)         'F13 (n-D)
DECLARE FUNCTION F14(R(),Nd%,p%,j&)         'F14 (n-D)
DECLARE FUNCTION F15(R(),Nd%,p%,j&)         'F15 (n-D)
DECLARE FUNCTION F16(R(),Nd%,p%,j&)         'F16 (n-D)
DECLARE FUNCTION F17(R(),Nd%,p%,j&)         'F17 (n-D)
DECLARE FUNCTION F18(R(),Nd%,p%,j&)         'F18 (n-D)
DECLARE FUNCTION F19(R(),Nd%,p%,j&)         'F19 (n-D)
DECLARE FUNCTION F20(R(),Nd%,p%,j&)         'F20 (n-D)
DECLARE FUNCTION F21(R(),Nd%,p%,j&)         'F21 (n-D)
DECLARE FUNCTION F22(R(),Nd%,p%,j&)         'F22 (n-D)
DECLARE FUNCTION F23(R(),Nd%,p%,j&)         'F23 (n-D)
DECLARE FUNCTION F24(R(),Nd%,p%,j&)         'F24 (n-D)
DECLARE FUNCTION F25(R(),Nd%,p%,j&)         'F25 (n-D)
DECLARE FUNCTION F26(R(),Nd%,p%,j&)         'F26 (n-D)
DECLARE FUNCTION F27(R(),Nd%,p%,j&)         'F27 (n-D)
DECLARE FUNCTION ParrottF4(R(),Nd%,p%,j&)  'Parrott F4 (1-D)
DECLARE FUNCTION SGO(R(),Nd%,p%,j&)        'SGO Function (2-D)
DECLARE FUNCTION GoldsteinPrice(R(),Nd%,p%,j&) 'Goldstein-Price Function (2-D)
DECLARE FUNCTION StepFunction(R(),Nd%,p%,j&) 'Step Function (n-D)
DECLARE FUNCTION Schwefel226(R(),Nd%,p%,j&) 'Schwefel Prob. 2.26 (n-D)
DECLARE FUNCTION Colville(R(),Nd%,p%,j&)   'Colville Function (4-D)
DECLARE FUNCTION Griewank(R(),Nd%,p%,j&)   'Griewank (n-D)
DECLARE FUNCTION Himmelblau(R(),Nd%,p%,j&)  'Himmelblau (2-D)
DECLARE FUNCTION Rosenbrock(R(),Nd%,p%,j&)  'Rosenbrock (n-D)
DECLARE FUNCTION Sphere(R(),Nd%,p%,j&)     'Sphere (n-D)
DECLARE FUNCTION HimmelblauNLO(R(),Nd%,p%,j&) 'Himmelblau NLO (5-D)
DECLARE FUNCTION Tripod(R(),Nd%,p%,j&)    'Tripod (2-D)
DECLARE FUNCTION sign(x)                     'Auxiliary function for Tripod
DECLARE FUNCTION RosenbrockF6(R(),Nd%,p%,j&) 'Rosenbrock F6 (10-D)
DECLARE FUNCTION CompressionSpring(R(),Nd%,p%,j&) 'Compression Spring (3-D)
DECLARE FUNCTION GearTrain(R(),Nd%,p%,j&)   'Gear Train (4-D)
DECLARE FUNCTION PBM_1(R(),Nd%,p%,j&)      'PBM Benchmark #1
DECLARE FUNCTION PBM_2(R(),Nd%,p%,j&)      'PBM Benchmark #2
DECLARE FUNCTION PBM_3(R(),Nd%,p%,j&)      'PBM Benchmark #3
DECLARE FUNCTION PBM_4(R(),Nd%,p%,j&)      'PBM Benchmark #4
DECLARE FUNCTION PBM_5(R(),Nd%,p%,j&)      'PBM Benchmark #5
DECLARE FUNCTION BOWTIE(R(),Nd%,p%,j&)    'FREE-SPACE RLC-LOADED BOWTIE
DECLARE FUNCTION YAGI_ARRAY(R(),Nd%,p%,j&)  'FREE-SPACE YAGI ARRAY
'----- SUB DECLARATIONS -----
DECLARE SUB SieveOfEratosthenes(N&&,Primes&&(),NumPrimes&&)
DECLARE SUB IPD_Halton(Np%,Nd%,Nt&,R(),Gamma)
DECLARE SUB ReplaceCommentCard(NECFfile$)
DECLARE SUB CopyBestMatrices(Np%,Nd%,Nt&,R(),M(),Rbest(),Mbest())

```

```

DECLARE SUB CheckNECFiles(NECfileError$)
DECLARE SUB GetTestFunctionNumber(FunctionName$)
DECLARE SUB FillArrayAij
DECLARE SUB Plot3dbestProbeTrajectories(NumTrajectories%,M(),R(),Np%,Nd%,LastStep&,FunctionName$)
DECLARE SUB Plot2dbestProbeTrajectories(NumTrajectories%,M(),R(),Np%,Nd%,LastStep&,FunctionName$)
DECLARE SUB Plot2dindividualProbeTrajectories(NumTrajectories%,M(),R(),Np%,Nd%,LastStep&,FunctionName$)
DECLARE SUB Show2dprobes(R(),Np%,Nt&,j&,Frep,BestFitness,BestProbeNumber%,BestTimeStep&,FunctionName$,RepositionFactor$,Gamma)
DECLARE SUB Show3dprobes(R(),Np%,Nd%,Nt&,j&,Frep,BestFitness,BestProbeNumber%,BestTimeStep&,FunctionName$,RepositionFactor$,Gamma)
DECLARE SUB Statuswindow(FunctionName$,StatuswindowHandle???)  

SUB
DECLARE PlotResults(FunctionName$,Nd%,Np%,BestFitnessOverall,BestNpNd%,BestGamma,Neval&,Rbest(),Mbest(),BestProbeNumberOverall%,BestTimeStepoverall&,LastStepBestRun&,Alpha,Beta)  

SUB
DECLARE DisplayRunParameters(FunctionName$,Nd%,Np%,Nt&,G,DeltaT,Alpha,Beta,Frep,R(),A(),M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,RunCFO$,ShrinkingND%,CheckForEarlyTermination$)  

SUB
DECLARE SUB GetBestfitness(M(),Np%,StepNumber&,BestFitness,BestProbeNumber%,BestTimeStep&)  

SUB
DECLARE Tabulate1DprobeCoordinates(Max1DprobesPlotted%,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,R(),M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)  

SUB
DECLARE GetPlotAnnotation(PlotAnnotation$,Nd%,Np%,Nt&,G,DeltaT,Alpha,Beta,Frep,M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)  

SUB
DECLARE ChangeRunParameters(NumProbesPerDimension%,Np%,Nd%,Nt&,G,Alpha,Beta,DeltaT,Frep,PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$)  

SUB
DECLARE SUB CLEANUP  

SUB
DECLARE Plot1DprobePositions(Max1DprobesPlotted%,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,R(),M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)  

SUB
DECLARE SUB DisplayMmatrix(Np%,Nt&,M())  

SUB
DECLARE SUB DisplayMbestMatrix(Np%,Nt&,Mbest())  

SUB
DECLARE SUB DisplayMmatrixThisTimeStep(Np%,j&,M())  

SUB
DECLARE SUB DisplayAmatrix(Np%,Nd%,Nt&,A())  

SUB
DECLARE SUB DisplayAmatrixThisTimeStep(Np%,Nd%,j&,A())  

SUB
DECLARE SUB DisplayRmatrix(Np%,Nd%,Nt&,R())  

SUB
DECLARE SUB DisplayRmatrixThisTimeStep(Np%,Nd%,j&,R(),Gamma)  

SUB
DECLARE SUB DisplayXiMinMax(Ndx,XiMin(),XiMax())  

SUB
DECLARE SUB DisplayRunParameters2(FunctionName$,Nd%,Np%,Nt&,G,DeltaT,Alpha,Beta,Frep,PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$)  

SUB
DECLARE PlotBestProbeVsTimeStep(Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)  

SUB
DECLARE PlotBestFitnessEvolution(Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)  

SUB
DECLARE PlotAverageDistance(Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,R(),DiagLength, Gamma)  

SUB
DECLARE SUB Plot2Dfunction(FunctionName$,R())
SUB
DECLARE SUB Plot1Dfunction(FunctionName$,R())
SUB
DECLARE GetFunctionRunParameters(FunctionName$,Nd%,Np%,Nt&,G,DeltaT,Alpha,Beta,Frep,R(),A(),M(),DiagLength,PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$)  

SUB
DECLARE SUB InitialProbeDistribution(Np%,Nd%,Nt&,R(),PlaceInitialProbes$,Gamma)
SUB
DECLARE SUB RetrieveErrantProbes(Np%,Nd%,j&,R(),Frep)
SUB
DECLARE SUB Retrieveerrantprobes2(Np%,Nd%,j&,R(),A(),Frep)
SUB
DECLARE SUB CFO(functionName$,Nd%,Nt&,R(),A(),M(),DiagLength,BestFitnessOverall,BestNpNd%,BestGamma,Neval&,Rbest(),-Self-contained-Mbest(),BestProbeNumberOverall%,BestTimeStepoverall&,LastStepBestRun&,Alpha,Beta) -> NO USER-SPECIFIED PARAMETERS
SUB
DECLARE SUB IPD(Np%,Nd%,Nt&,R(),Gamma)
SUB
DECLARE SUB ResetDecisionSpaceBoundaries(Nd%)  

SUB
DECLARE SUB ThreeDplot(PlotFileName$,PlotTitle$,Annotation$,xCoord$,yCoord$,zCoord$,XaxisLabel$,YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,A$)
SUB
DECLARE SUB ThreeDplot2(PlotFileName$,PlotTitle$,Annotation$,xCoord$,yCoord$,zCoord$,XaxisLabel$,-YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,A$,xStart$,xStop$,yStart$,yStop$)
SUB
DECLARE SUB ThreeDplot3(PlotFileName$,PlotTitle$,Annotation$,xCoord$,yCoord$,zCoord$,XaxisLabel$,YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,xStart$,xStop$,yStart$,yStop$)
SUB
DECLARE SUB TwoDplot(PlotFileName$,PlotTitle$,xCoord$,yCoord$,xAxisLabel$,yAxisLabel$,LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$,LineType$,Annotation$)
SUB
DECLARE SUB TwoDplot2Curves(PlotFileName$,PlotFileName2$,PlotTitle$,Annotation$,xCoord$,yCoord$,XaxisLabel$,YaxisLabel$,LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$,LineSize)
SUB
DECLARE SUB TwoDplot3curves(NumCurves%,PlotFileName1$,PlotFileName2$,PlotFileName3$,PlotTitle$,Annotation$,xCoord$,yCoord$,XaxisLabel$,YaxisLabel$,LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$)
SUB
DECLARE SUB CreateGNUpotINIfile(PlotwindowULC_X%,PlotwindowULC_Y%,PlotwindowWidth%,PlotwindowHeight%)
SUB
DECLARE SUB Delay(NumSecs)
SUB
DECLARE SUB MathematicalConstants
SUB
DECLARE SUB AlphabetAndDigits
SUB
DECLARE SUB SpecialSymbols
SUB
DECLARE SUB EMconstants
SUB
DECLARE SUB ConversionFactors
SUB
DECLARE SUB ShowConstants

```

```

DECLARE SUB GetNECdata(NECoutputFile$, NumFreqs%, NumRadPattAngles%, Zo, FrequencyMHz(), RadEfficiencyPCT(), MaxGainDBI(), MinGainDBI(), Rinohms(), Xinohms(), VSWR(), ForwardGain
DBI(), Filestatus$, FileIDS$) SUB
DECLARE SUB ComplexMultiply(ReA, ImA, ReB, ImB, ReC, ImC)
DECLARE SUB ComplexDivide(ReA, ImA, ReB, ImB, ReC, ImC)
'----- FUNCTION DECLARATIONS -----
DECLARE FUNCTION DecimalToVanderCorputBaseN(N&&, Nbase%)
DECLARE FUNCTION Probeweight2(Nd%, Np%, R(), p%, j&)
DECLARE FUNCTION Probeweight(Nd%, R(), p%, j&) 'computes a 'weighting factor' based on probe's position (greater weight if closer to decision space boundary)
DECLARE FUNCTION SlopeRatio(M(), Np%, StepNumber&)
DECLARE CALLBACK FUNCTION DlgProc
DECLARE FUNCTION HasFITNESSsaturated$(Nsteps&, j&, Np%, Nd%, M(), R(), DiagLength)
DECLARE FUNCTION HasDAVGsaturated$(Nsteps&, j&, Np%, Nd%, M(), R(), DiagLength)
DECLARE FUNCTION OscillationInDavg$(j&, Np%, Nd%, M(), R(), DiagLength)
DECLARE FUNCTION DavgThisStep(j&, Np%, Nd%, M(), R(), DiagLength)
DECLARE FUNCTION NoSpaces$(X, Numbigits%)
DECLARE FUNCTION FormatFP$(X, Ndigits%)
DECLARE FUNCTION FormatInteger$(M%)
DECLARE FUNCTION TerminateNowForSaturation$(j&, Nd%, Np%, Nt&, G, DeltaT, Alpha, Beta, R(), A(), M())
DECLARE FUNCTION MagVector(V(), N%)
DECLARE FUNCTION UniformDeviate(u&&)
DECLARE FUNCTION RandomNum(a, b)
DECLARE FUNCTION GaussianDeviate(Mu, Sigma)
DECLARE FUNCTION UnitStep(X)
DECLARE FUNCTION Fibonacci&(N%)
DECLARE FUNCTION ObjectiveFunction(R(), Nd%, p%, j&, FunctionName$)
DECLARE FUNCTION UnitStep(X)
DECLARE FUNCTION FP2String2$(X!)
DECLARE FUNCTION FP2String$(X)
DECLARE FUNCTION Int2String$(X)
DECLARE FUNCTION StandingwaveRatio(Zo, ReZ, ImZ)
'=====
'---- MAIN PROGRAM -----
FUNCTION PBMAIN() AS LONG
' ----- CFO Parameters -----
LOCAL Nd%, Np%, Nt&
LOCAL G, DeltaT, Alpha, Beta, Freq AS EXT
LOCAL PlaceInitialProbes$, InitialAcceleration$, RepositionFactor$
LOCAL R(), A(), M(), Rbest(), Mbest() AS EXT 'position, acceleration & fitness matrices
LOCAL FunctionName$ 'name of objective function
' ----- Miscellaneous Setup Parameters -----
LOCAL N%, P%, i%, YN&, Neval&&, NevalTotal&&, BestNpNd%, NumTrajectories%, Max1DprobesPlotted%, LastStepBestRun&, Pass%
LOCAL A$, RunCFO$, CFOversion$, NECfileError$, RunStart$, RunStop$
LOCAL BestGamma, BestFitnessThisRun, BestFitnessOverall, StartTime, StopTime, OptimumFitness AS EXT
LOCAL BestProbeNum%, BestTimeStep&, BestProbeNumberOverall%, BestTimeStepOverall&, StatusWindowHandle???
' ----- Global Constants -----
REDIM Aij(1 TO 2, 1 TO 25) '(GLOBAL array for Shekel's Foxholes function)
CALL FillArrayAij
CALL MathematicalConstants 'NOTE: Calling order is important!!
CALL AlphabetAndDigits 'NOTE: GLOBAL VARIABLE RunID$ IS SET HERE
CALL SpecialSymbols
CALL EMconstants
CALL ConversionFactors ': CALL ShowConstants 'to verify constants have been set
BOWTIsecsPerRun = 3#
' ----- General Setup -----
CFOversion$ = "CFO Ver. 06-25-2011"
RANDOMIZE TIMER 'seed random number generator with program start time
DESKTOP GET SIZE TO Screenwidth&, Screenheight& 'get screen size (global variables)
IF DIR$( "wgnuplot.exe" ) = "" THEN
    MSGBOX("WARNING! 'wgnuplot.exe' not found. Run terminated.") : EXIT FUNCTION
END IF
IF DIR$( "Fitness" ) > "" THEN KILL "Fitness"
IF DIR$( "Davg" ) > "" THEN KILL "Davg"
IF DIR$( "Best Probe" ) > "" THEN KILL "Best Probe"
' ----- CFO RUN PARAMETERS -----
-----'
CALL GetTestFunctionNumber(FunctionName$)' : exit function 'DEBUG

```

```

CALL
GetFunctionRunParameters(FunctionName$,Nd%,Np%,Nt&,G,DeltaT,Alpha,Beta,Frep,R(),A(),M(),DiagLength,PlaceInitialProbes$,InitialAcceleration$,RepositionFacto
r$) 'NOTE: Parameters returned but not used in this version!!
REDIM R(1 TO Np%, 1 TO Nd%, 0 TO Nt&), A(1 TO Np%, 1 TO Nd%, 0 TO Nt&), M(1 TO Np%, 0 TO Nt&) 'position, acceleration & fitness matrices
REDIM Rbest(1 TO Np%, 1 TO Nd%, 0 TO Nt&), Mbest(1 TO Np%, 0 TO Nt&) 'overall best position & fitness matrices
' ----- PLOT 1d and 2d FUNCTIONS ON-SCREEN FOR VISUALIZATION -----
IF Nd% = 2 AND INSTR(FunctionName$,"PBM_") > 0 THEN
    CALL CheckNECfiles(NECfileError$)
    IF NECfileError$ = "YES" THEN
        EXIT FUNCTION
    ELSE
        MSGBOX("Begin computing plot of function "+FunctionName$+"? May take a while - be patient...")
    END IF
END IF

SELECT CASE Nd%
CASE 1 : CALL Plot1Dfunction(FunctionName$,R())
CASE 2 : CALL Plot2Dfunction(FunctionName$,R())
END SELECT

' ----- RUN CFO -----
YN= MSGBOX("RUN CFO ON FUNCTION "+ FunctionName$ + "?" +CHR$(13)+CHR$(13)+"Get some coffee & sit back...",%MB_YESNO,"CONFIRM RUN") : IF YN= %IDYES
THEN RunCFO$ = "YES"

IF RunCFO$ = "YES" THEN
    StartTime = TIMER : RunStart$ = "Started at "+TIME$+, "+DATE$

' ----- BOWTIE -----
IF FunctionName$ = "BOWTIE" THEN
    N% = FREEFILE : OPEN "Runtime_BOWTIE.DAT" FOR OUTPUT AS #N% : PRINT #N%, RunStart$ : CLOSE #N%
    IF DIR$("BOWTIE_CFO.CFG") = "" THEN
        N% = FREEFILE
        OPEN "BOWTIE_CFO.CFG" FOR OUTPUT AS #N%
        PRINT #N%, "150" : PRINT #N%, "11" : PRINT #N%, "4" 'CFO parameters Nt&, NumGammas%, MaxProbesPerDimension%, respectively
        CLOSE #N%
    END IF
    END IF

' ----- YAGI -----
IF FunctionName$ = "YAGI" THEN
    N% = FREEFILE : OPEN "Runtime_YAGI.DAT" FOR OUTPUT AS #N% : PRINT #N%, RunStart$ : CLOSE #N%
    IF DIR$("YAGI_CFO.CFG") = "" THEN
        N% = FREEFILE
        OPEN "YAGI_CFO.CFG" FOR OUTPUT AS #N%
        PRINT #N%, "150" : PRINT #N%, "11" : PRINT #N%, "4" 'CFO parameters Nt&, NumGammas%, MaxProbesPerDimension%, respectively
        CLOSE #N%
    END IF
    END IF

CALL
CFO(FunctionName$,Nd%,Nt&,R(),A(),M(),DiagLength,BestFitnessOverall,BestNpNd%,BestGamma,Neval&,Rbest(),Mbest(),BestProbeNumberOverall%,BestTimeStepOverall
&,LastStepBestRun&,Alpha,Beta)

StopTime = TIMER : RunStop$ = "Ended at "+TIME$+, "+DATE$

N% = BestNpNd%*Nd%
' ----- Add Best Run Results to CFO Setup Parameter File -----
N% = FREEFILE
OPEN "CFO-"+RunID$+".PAR" FOR APPEND AS #N%
PRINT #N%, "Best Run Data:"
PRINT #N%, "-----"
PRINT #N%, "Fitness" = "+STR$(ROUND(BestFitnessOverall,8))
PRINT #N%, "Np/Nd" = "+STR$(BestNpNd%)"
PRINT #N%, "Nd" = "+STR$(Nd%)"
PRINT #N%, "Np" = "+STR$(Np%)"
PRINT #N%, "Gamma" = "+STR$(BestGamma)"
PRINT #N%, "Probe #" = "+STR$(BestProbeNumberOverall%)"
PRINT #N%, "#Time Step" = "+STR$(BestTimeStepOverall%)"
PRINT #N%, "#Last Step" = "+STR$(LastStepBestRun)"
CLOSE #N%

CALL
PlotResults(FunctionName$,Nd%,Np%,BestFitnessOverall,BestNpNd%,BestGamma,Neval&,Rbest(),Mbest(),BestProbeNumberOverall%,BestTimeStepOverall&,LastStepBestR
un&,Alpha,Beta)

' ----- BOWTIE -----
IF FunctionName$ = "BOWTIE" THEN
    N% = FREEFILE
    OPEN "Runtime_BOWTIE.DAT" FOR APPEND AS #N%
    PRINT #N%, RunStop$
    PRINT #N%, "Runtime = "+STR$(ROUND((StopTime-StartTime)/3600##,2))+" hrs"
    PRINT #N%, "Note: runtime will be incorrect if start/stop times transition midnight..."
    PRINT #N%, FunctionName$+" Total Function Evaluations = "+STR$(Neval&)
    PRINT #N%, "Avg Time/Run = "+STR$(ROUND((StopTime-StartTime)/Neval&,6))
    CLOSE #N%
    IF DIR$("BestBOWTIE.NEC") <> "" THEN KILL "BestBOWTIE.NEC"
    IF DIR$("BestBOWTIE.OUT") <> "" THEN KILL "BestBOWTIE.OUT"
    OptimumFitness = Rbest().Nd%,BestProbeNumberOverall%,BestTimeStepOverall%
    CALL ReplaceCommentCard("BOWTIE.NEC")
    NAME "BOWTIE.NEC" AS "BestBOWTIE.NEC"
    CALL ReplaceCommentCard("BOWTIE.OUT")
    NAME "BOWTIE.OUT" AS "BestBOWTIE.OUT"

    O% = FREEFILE
    OPEN "BestBOWTIE.NEC" FOR APPEND AS #O%
    PRINT #O%, "RLC-LOADED BOWTIE"
    PRINT #O%, "" : PRINT #O%, "OPTIMUM FITNESS = "+STR$(ROUND(OptimumFitness,3))+" @ Fo = 299.8 MHz, "+DATE$+, "+TIME$%
    PRINT #O%, "" : PRINT #O%, USING("Best Gamma: ##.##", BestNpNd: ##.##, Neval: #####) LastStep: #####
    PRINT #O%, "", BestGamma, BestNpNd, Nt&, Neval&, LastStepBestRun&
    PRINT #O%, RunStart$
    PRINT #O%, RunStop$
    CLOSE #O%

    P% = FREEFILE
    OPEN "BestBOWTIE.OUT" FOR APPEND AS #P%
    PRINT #P%, "RLC-LOADED BOWTIE"
    PRINT #P%, "" : PRINT #P%, "OPTIMUM FITNESS = "+STR$(ROUND(OptimumFitness,3))+" @ Fo = 299.8 MHz, "+DATE$+, "+TIME$%

```

```

        PRINT #P%, "" : PRINT #P%, USING$("Best Gamma: ##.##")
        BestNp/Nd: ###          NT: #####      Neval: #####      LastStep:
#####", BestGamma, BestNpNd, Nt&, Neval&&, LastStepBestRun&
        PRINT #P%, ""
        PRINT #P%, RunStart$      PRINT #P%, RunStop$
        CLOSE #P%
        SHELL "Read_NECK_Output_File_BOWTIE.exe"
END IF 'FunctionName$ = "BOWTIE"

----- YAGI ARRAY -----
IF FunctionName$ = "YAGI" THEN
    N% = FREEFILE
    OPEN "Runtime_YAGI.DAT" FOR APPEND AS #N%
    PRINT #N%, RunStop$      PRINT #N%, RunStart$      PRINT #N%, Runtime = "+STR$(ROUND((StopTime-StartTime)/3600##, 2))+" hrs"
    PRINT #N%, Note: runtime will be incorrect if start/stop times transition midnight...
    PRINT #N%, FunctionName$+", Total Function Evaluations = "+STR$(Neval&&)
    PRINT #N%, Avg Time/Run = "+STR$(ROUND((StopTime-StartTime)/Neval&&, 6))
    CLOSE #N%
    IF DIR$("BestYAGI.NEC") <> "" THEN KILL "BestYAGI.NEC"
    IF DIR$("BestYAGI.OUT") <> "" THEN KILL "BestYAGI.OUT"
    OptimumFitness = YAGI_ARRAY(Rbest(), Nd%, BestProbeNumberOverall%, BestTimestepOverall%)
    CALL ReplaceCommentCard("YAGI.NEC")
    NAME "YAGI.NEC" AS "BestYAGI.NEC"
    CALL ReplaceCommentCard("YAGI.OUT")
    NAME "YAGI.OUT" AS "BestYAGI.OUT"

    N% = FREEFILE
    OPEN "BestYAGI.NEC" FOR APPEND AS #N%
    PRINT #N%, YAGI ARRAY
    PRINT #N%, "# : PRINT #0%, "OPTIMUM FITNESS = "+STR$(ROUND(OptimumFitness,3))+" @ Fo = 299.8 MHz, "+DATE$+, "+TIME$"
    PRINT #N%, "# : PRINT #0%, USING$("Best Gamma: ##.##" BestNp/Nd: ###          NT: #####      Neval: #####      LastStep:
#####", BestGamma, BestNpNd, Nt&, Neval&&, LastStepBestRun&
    PRINT #N%, ""
    PRINT #N%, RunStart$      PRINT #N%, RunStop$
    CLOSE #N%
    P% = FREEFILE
    OPEN "BestYAGI.OUT" FOR APPEND AS #P%
    PRINT #P%, "YAGI ARRAY"
    PRINT #P%, "# : PRINT #P%, "OPTIMUM FITNESS = "+STR$(ROUND(OptimumFitness,3))+" @ Fo = 299.8 MHz, "+DATE$+, "+TIME$"
    PRINT #P%, "# : PRINT #P%, USING$("Best Gamma: ##.##" BestNp/Nd: ###          NT: #####      Neval: #####      LastStep:
#####", BestGamma, BestNpNd, Nt&, Neval&&, LastStepBestRun&
    PRINT #P%, ""
    PRINT #P%, RunStart$      PRINT #P%, RunStop$
    CLOSE #P%
    SHELL "Read_NECK_Output_File_YAGI_ARRAY.exe"
END IF 'FunctionName$ = "YAGI"

MSGBOX(FunctionName$+CHR$(13)+"Total Function Evaluations = "+STR$(Neval&&)+CHR$(13)+"Runtime = "+STR$(ROUND((StopTime-StartTime)/3600##, 2))+_
" hrs, Avg Time/Run = "+STR$(ROUND((StopTime-StartTime)/Neval&&, 6)))
NAME "Fitness" AS "Fitness"+RunID$+".DAT" : NAME "Davg" AS "Davg"+RunID$+".DAT" : NAME "Best Probe" AS "BestProbe"+RunID$+".DAT" 'append Run ID and
'DAT' to data file names to identify file type
----- Cleanup Temp Files -----
IF DIR$("cmd2d(gp") <> "" THEN KILL "cmd2d(gp"
IF DIR$("cmd3d(gp") <> "" THEN KILL "cmd3d(gp"
IF DIR$("NECtemp") <> "" THEN KILL "NECtemp"

END IF 'RunCFO$ = "YES"

ExitPMAIN:
END FUNCTION 'PMAIN()
=====
SUB CFO(PropertyName$, Nd%, Nt&, R(), A(), M(), DiagLength, BestFitnessOverall, BestNpNd%, BestGamma, Neval&&, Rbest(), Mbest(), BestProbeNumberOverall%, BestTimestepOverall%,
&, LastStepBestRun&, Alpha, Beta)
LOCAL p%, i%, j& 'Standard Indices: Probe #, Coordinate #, Time Step #
LOCAL Np% 'Number of Probes
LOCAL MaxProbesPerDimension% 'Maximum # probes per dimension (depends on Nd%)
LOCAL K%, L% 'Dummy summation indices
LOCAL M% 'file number
LOCAL NumProbesPerDimension%, GammaNumber%, NumGammas% 'Probes/dimension on each probe line; gamm point #; # gamma points
LOCAL SumSQ, Denom, Numerator, Gamma, Freq, DeltaFreq, FreqInit, MinFreq AS EXT
LOCAL BestProbeNumber%, BestTimestep%, LastStep%, BestProbeNumberThisRun%, BestTimestepThisRun%
LOCAL BestFitness, BestFitnessThisRun, eta AS EXT
LOCAL FitnessSaturation%
'<<<<<<<< NOTE: THIS IS A 'PARAMETER FREE' CFO IMPLEMENTATION. SEE THE ICIC2010 REFERENCE ABOVE FOR DETAILS. >>>>>>>>>>
----- Initial Parameter Values -----
NumGammas% = 3'11 'default value for functions other than BOWTIE
Alpha = 1## : Beta = 1## 'CFO EXPONENTS Alpha & Beta
Nt& = 1000 'set to a large value expecting early termination
IF FunctionName$ = "F" THEN Nt& = 100 'to reduce runtime because this function contains random noise
Neval&& = 0
FreqInit = 0.5##
DeltaFreq = 0.1##
MinFreq = 0.05##
SELECT CASE Nd% 'set Np%/Nd% based on Nd% to avoid excessive runtimes
CASE 1 TO 6 : MaxProbesPerDimension% = 14
CASE 7 TO 10 : MaxProbesPerDimension% = 12
CASE 11 TO 15 : MaxProbesPerDimension% = 10
CASE 16 TO 20 : MaxProbesPerDimension% = 8
CASE 21 TO 30 : MaxProbesPerDimension% = 6
CASE ELSE : MaxProbesPerDimension% = 4

```

```

END SELECT

'----- BOWTIE -----
IF FunctionName$ = "BOWTIE" THEN
  M% = FREEFILE
  OPEN "BOWTIE_CFO.CFG" FOR INPUT AS #M%
    INPUT #M%, Nt& : INPUT #M%, NumGammas% : INPUT #M%, MaxProbesPerDimension%
  CLOSE #M%
  IF Nt& < 5 OR Nt& > 500 THEN Nt& = 150
  IF NumGammas% < 2 OR NumGammas% > 31 THEN NumGammas% = 11
  IF MaxProbesPerDimension% < 2 OR MaxProbesPerDimension% > 10 THEN MaxProbesPerDimension% = 6
END IF

'----- YAGI ARRAY -----
IF FunctionName$ = "YAGI" THEN
  M% = FREEFILE
  OPEN "YAGI_CFO.CFG" FOR INPUT AS #M%
    INPUT #M%, Nt& : INPUT #M%, NumGammas% : INPUT #M%, MaxProbesPerDimension%
  CLOSE #M%
  IF Nt& < 5 OR Nt& > 500 THEN Nt& = 150
  IF NumGammas% < 2 OR NumGammas% > 31 THEN NumGammas% = 11
  IF MaxProbesPerDimension% < 2 OR MaxProbesPerDimension% > 10 THEN MaxProbesPerDimension% = 6
END IF

'-----
LastStep& = Nt&

'IF FunctionName$ = "BOWTIE" THEN
'  MaxProbesperDimension% = 6 'to reduce runtime for LOADED BOWTIE
'  MSGBOX("Approximate runtime: "+STR$(ROUND(BOWTIEsecsPerRun*NumGammas*Nd%*MaxProbesPerDimension%*Nt&/40#,1))+" minutes")
'END IF

' ----- Save Setup Parameters for This Run -----
M% = FREEFILE
OPEN "CFO."+RunID$+".PAR" FOR OUTPUT AS #M%
PRINT #M%, "CFO RUN PARAMETERS, Run ID: "+RunID$+STRING$(LEN(RunID$),"-")
PRINT #M%, "Alpha = "+STR$(Alpha)
PRINT #M%, "Beta = "+STR$(Beta)
PRINT #M%, "Nt = "+STR$(Nt&)
PRINT #M%, "Initial Frep = "+STR$(FrepInit)
PRINT #M%, "Delta Frep = "+STR$(DeltaFrep)
PRINT #M%, "Min Frep = "+STR$(MinFrep)
PRINT #M%, "# Gammas = "+STR$(NumGammas%)
PRINT #M%, "Nt = "+STR$(Nt&)
PRINT #M%, "Max Probes/Dim = "+STR$(MaxProbesPerDimension%)
CLOSE #M%

' ----- Np/Nd LOOP -----
BestFitnessOverall = -1E4200 'very large negative number...
FOR NumProbesPerDimension% = 2 TO MaxProbesPerDimension% STEP 2
'FOR NumProbesPerDimension% = 4 TO MaxProbesPerDimension% STEP 2 'original code
Np% = NumProbesPerDimension%*Nd%
' -----
GAMMA LOOP -----
FOR GammaNumber% = 1 TO NumGammas%
  Gamma = (GammaNumber%-1)/(NumGammas%-1)
  REDIM R(1 TO Np%, 1 TO Nd%, 0 TO Nt&), A(1 TO Np%, 1 TO Nd%, 0 TO Nt&), M(1 TO Np%, 0 TO Nt&) 're-initializes Position Vector/Acceleration/Fitness matrices to zero
'STEP (A1) ----- Compute Initial Probe Distribution (Step 0)-----
  CALL IPD(Np%,Nd%,Nt&,R(),Gamma) 'Probe Line IPD intersecting on diagonal at a point determined by Gamma
'STEP (A2) ----- Compute Initial Fitness Matrix (Step 0) -----
  FOR p% = 1 TO Np% : M(p%,0) = ObjectiveFunction(R(),Nd%,p%,0,FunctionName$) : INCR Neval&& : NEXT p%
'STEP (A3) ----- Set Initial Probe Accelerations to ZERO (Step 0)-----
  FOR p% = 1 TO Np% : FOR i% = 1 TO Nd% : A(p%,i%,0) = 0## : NEXT i% : NEXT p%
'STEP (A4) ----- Initialize Frep -----
  Frep = FrepInit '0.5#
' ====== LOOP ON TIME STEPS STARTING AT STEP #1 ======
BestFitnessThisRun = M(1,0)
FOR j& = 1 TO Nt&
'STEP (B) ----- Compute Probe Position Vectors for this Time Step -----
  FOR p% = 1 TO Np% : FOR i% = 1 TO Nd% : R(p%,i%,j&) = R(p%,i%,j&-1) + A(p%,i%,j&-1) : NEXT i% : NEXT p% 'note: factor of 1/2 combined with G=2 to produce unity coefficient
'STEP (C) ----- Retrieve Errant Probes -----
  CALL RetrieveErrantProbes(Np%,Nd%,j&,R(),Frep)
'  CALL RetrieveErrantprobes2(Np%,Nd%,j&,R(),A(),Frep) 'added 04-01-10
'STEP (D) ----- Compute Fitness Matrix for Current Probe Distribution -----
  FOR p% = 1 TO Np% : M(p%,j&) = ObjectiveFunction(R(),Nd%,p%,j&,FunctionName$) : INCR Neval&& : NEXT p%
'STEP (E) ----- Compute Accelerations Based on Current Probe Distribution & Fitnesses -----
  FOR p% = 1 TO Np%
    FOR i% = 1 TO Nd%
      A(p%,i%,j&) = 0
      FOR k% = 1 TO Np%
        IF k% <> p% THEN
          SumsQ = 0## : FOR L% = 1 TO Nd% : SumsQ = SumsQ + (R(k%,L%,j&)-R(p%,L%,j&))^2 : NEXT L% 'dummy index
          IF SumsQ <> 0## THEN 'to avoid zero denominator (added 03-20-10) [NOTE THAT POWER BASIC DOES NOT FAULT ON DIVIDE-BY-ZERO...]
            Denom = SQR(SumsQ) : Numerator = UnitStep((M(k%,j&)-M(p%,j&))*(M(k%,j&)-M(p%,j&))
            A(p%,i%,j&) = A(p%,i%,j&) + (R(k%,i%,j&)-R(p%,i%,j&))*Numerator^Alpha/Denom^Beta 'ORIGINAL VERSION WITH VARIABLE Alpha & Beta
          END IF 'added 03-20-10
        END IF
      END IF
    END IF
  END IF
END IF

```

```

        END IF
        NEXT k% 'dummy index
        NEXT i% 'coord (dimension) #
        NEXT p% 'probe #
' ----- Get Best Fitness & Corresponding Probe # and Time Step -----
        CALL GetBestFitness(M(),Np%,j&,BestFitness,BestProbeNumber%,BestTimestep&)

        IF BestFitness >= BestFitnessThisRun THEN
            BestFitnessThisRun = BestFitness : BestProbeNumberThisRun% = BestProbeNumber% : BestTimeStepThisRun& = BestTimeStep&
        END IF
        ----- Increment Frep -----
        Frep = Frep + DeltaFrep
        IF Frep > 1## THEN Frep = MinFrep 'keep Frep in range [0.05,1]
' ----- Starting at Step #20 Shrink Decision Space Around Best Probe Every 20th Step -----
        IF j& MOD 10 = 0 AND j& >= 20 THEN
            IF j& MOD 20 = 0 AND j& >= 20 THEN
                FOR i% = 1 TO Nd% : XiMin(i%) = XiMin(i%)+(R(BestProbeNumber%,i%,BestTimeStep&)-XiMin(i%))/2## : XiMax(i%) = XiMax(i%)-(XiMax(i%)-R(BestProbeNumber%,i%,BestTimeStep&))/2## : NEXT i% 'shrink DS by 0.5
                CALL RetrieveErrantProbes(Np%,Nd%,j&,R(),Frep) 'TO RETRIEVE PROBES LYING OUTSIDE SHRUNKEN DS 'ADDED 02-07-2010
                CALL RetrieveErrantprobes2(Np%,Nd%,j&,R(),A(),Frep) 'added 04-01-10
            END IF
        END IF
'STEP (F) ----- Check for Early Run Termination -----
        IF HasFITNESSsaturated$(25,j&,Np%,Nd%,M(),R(),DiagLength) = "YES" THEN
            LastStep& = j&
            EXIT FOR
        END IF
        NEXT j& 'END TIME STEP LOOP
'----- Best Overall Fitness & Corresponding Parameters -----
        IF BestFitnessThisRun >= BestFitnessOverall THEN
            BestFitnessOverall = BestFitnessThisRun : BestProbeNumberOverall% = BestProbeNumberThisRun% : BestTimeStepOverall& = BestTimeStepThisRun&
            BestNpNd% = NumProbesPerDimension% : BestGamma = Gamma : LastStepBestRun& = LastStep&
            CALL CopyBestMatrices(Np%,Nd%,Nt&,R(),M(),Rbest(),Mbest())
        END IF
'STEP (G) ---- Reset Decision Space Boundaries to Initial values -----
        CALL ResetDecisionSpaceBoundaries(Nd%)
        NEXT GammaNumber% 'END GAMMA LOOP
        NEXT NumProbesPerDimension% 'END Np/Nd LOOP
        END SUB 'CFO()
'=====
SUB IPD_Halton(Np%,Nd%,Nt&,R(),Gamma) 'added 06-29-2011
LOCAL Deltaxi, Delx1, Delx2, Di AS EXT
LOCAL NumProbesPerDimension%, p%, i%, k%, NumX1points%, NumX2points%, x1pointNum%, x2pointNum%
IF Nd% > 1 THEN
    NumProbesPerDimension% = Np%\Nd% 'even #
ELSE
    NumProbesPerDimension% = Np%
END IF
FOR i% = 1 TO Nd%
    FOR p% = 1 TO Np%
        R(p%,i%,0) = XiMin(i%) + Gamma*(XiMax(i%)-XiMin(i%))
    NEXT Np%
NEXT i%
FOR i% = 1 TO Nd% 'place probes probe line-by-probe line (i% is dimension number)
    Deltaxi = (XiMax(i%)-XiMin(i%))/(NumProbesPerDimension%-1)
    FOR k% = 1 TO NumProbesPerDimension%
        p% = k% + NumProbesPerDimension%*(i%-1) 'probe #
        R(p%,i%,0) = XiMin(i%) + (k%-1)*Deltaxi
    NEXT k%
NEXT i%
END SUB 'IPD_Halton()
'-----
FUNCTION DecimalToVanDerCorputBaseN(N&&,Nbase%)
'Returns the decimal value of the VDC base Nbase% 'radical inverse function' to create a Low Discrepancy sequence of decimal values.
'Maps integer argument into a quasirandom real number on the interval [0,1].
'Refs: (1) "Improved Particle Swarm Optimization with Low-Discrepancy Sequences," Pant, Thangaraj, Grosan & Abraham, 2008 IEEE Congress on Evolutionary Computation (CEC2008), p. 3011.
' (2) "Quasirandom Ramblings," Computing Science column in American Scientist Magazine, July-August 2011, p. 282.

```

```

' (www.american scientist.org)

'CHECK VALUES FOR BASE 2
Integer(N&&) Base 2 Representation Digits Reversed VDC Decimal Value
-----
0 0 0 0.0
2 10 01 0.25
3 11 11 0.75
4 100 001 0.125
6 110 011 0.375
7 111 111 0.875
15 1111 1111 0.9375
120 111000 0001111 0.1171875
121 111001 1001111 0.6171875
532 1000010100 0010100001 0.1572265625

'CHECK VALUES FOR BASE 3
Integer(N&&) Base 3 Representation Digits Reversed VDC Decimal Value
-----
0 0 0 0.0
2 2 2 0.666...
3 10 01 0.111...
7 21 12 0.555...
120 11110 01111 0.164609053497942
532 201201 102102 0.422496570544719

'CHECK VALUES FOR BASE 5
Integer(N&&) Base 5 Representation Digits Reversed VDC Decimal Value
-----
0 0 0 0.0
1 1 1 0.2
2 2 2 0.4
3 3 3 0.6
4 4 4 0.8
5 10 01 0.44
7 12 21 0.44
17 32 23 0.52
121 441 144 0.392
532 4112 2114 0.4544

LOCAL S AS EXT, R AS EXT, I&&, D&&
S = 0##
IF N&& > 2^63-2 THEN
  MSGBOX("WARNING! VDC arg > 2^63-2. zero returned.") : GOTO ExitVDC
END IF

I&& = N&& : R = 1#/Nbase%
DO WHILE I&& <> 0 : D&& = I&& MOD Nbase% : S = S + D&&#R : I&& = (I&&-D&&)/Nbase% : R = R/Nbase% : LOOP

ExitVDC:
DecimalToVanDerCorputBaseN = S
END FUNCTION
'-----
SUB SieveOfEratosthenes(N&&,Primes&&(),NumPrimes&&)
'Returns primes between 2 and N&& and their number.
'NOTE: There are 303 primes between 2 and 2000. Accuracy of this routine has been checked against table of the first 1000 primes (# primes up to N&&=7919).
'Ref: Caldwell, C., "The Prime Pages," Univ. Tennessee at Martin, http://primes.utm.edu
LOCAL i&&, iStart&&, p&&, j&&, TempArray&&()
REDIM TempArray&&(1 TO N&&)
TempArray&&(1) = 0 : FOR i&& = 2 TO N&& : TempArray&&(i&&) = 1 : NEXT i&&
p&& = 2 : WHILE p&&#2 <= N&& : j&& = p&&#2 : WHILE j&& <= N&& : TempArray&&(j&&) = 0 : j&& = j&& + p&& : WEND : p&& = p&& + 1 : WEND 'inserts 0 or 1
depending on whether or not # is a prime
NumPrimes&& = 0
FOR i&& = 1 TO N&& 'converts the 1's into their corresponding prime numbers & retrieves # primes between 2 and N&&
  IF TempArray&&(i&&) = 1 THEN INCR NumPrimes&&
    TempArray&&(i&&) = i&&#TempArray&&(i&&)
  NEXT i&&
REDIM Primes&&(1 TO NumPrimes&&)
iStart&& = 1
FOR j&& = 1 TO NumPrimes&&
  FOR i&& = iStart&& TO N&&
    IF TempArray&&(i&&) <> 0 THEN
      Primes&&(j&&) = TempArray&&(i&&) : iStart&& = i&&+1 : EXIT FOR
    END IF
  NEXT i&&
NEXT j&&
END SUB 'SieveofEratosthenes()
'-----
SUB IPD(Np%,Nd%,Nt&,R(),Gamma)
LOCAL DeltaXi, DelX1, DelX2, Di AS EXT
LOCAL NumProbesPerDimension%, p%, i%, k%, NumX1points%, NumX2points%, x1pointNum%, x2pointNum%
IF Nd% > 1 THEN
  NumProbesPerDimension% = Np%\\Nd% 'even #
ELSE
  NumProbesPerDimension% = Np%
END IF
FOR i% = 1 TO Nd%
  FOR p% = 1 TO Np%
    R(p%,i%,0) = XiMin(i%) + Gamma*(XiMax(i%)-XiMin(i%))
  NEXT Np%
NEXT i%
FOR i% = 1 TO Nd% 'place probes probe line-by-probe line (i% is dimension number)

```

```

DeltaXi = (XiMax(i%)-XiMin(i%))/(NumProbesPerDimension%-1)
FOR k% = 1 TO NumProbesPerDimension%
    p% = k% + NumProbesPerDimension%*(i%-1) 'probe #
    R(p%,i%,0) = XiMin(i%) + (k%-1)*DeltaXi
NEXT k%
NEXT i%
END SUB 'IPD()
'-----
FUNCTION HasFITNESSsaturated$(Nsteps&,j&,Np%,Nd%,M(),RC(),DiagLength)
LOCAL A$, B$
LOCAL k&, p%
LOCAL BestFitness, SumOfBestFitnesses, BestFitnessStepJ, FitnessSatTOL AS EXT
A$ = "NO" : B$ = "j=" + STR$(j&)+CHR$(13)
FitnessSatTOL = 0.000001# 'tolerance for FITNESS saturation
IF j& < Nsteps& + 10 THEN GOTO ExitHasFITNESSsaturated 'execute at least 10 steps after averaging interval before performing this check
SumOfBestFitnesses = 0#
FOR k& = j&-Nsteps&+1 TO j& 'GET BEST FITNESSES STEP-BY-STEP FOR Nsteps& INCLUDING THIS STEP j& AND COMPUTE AVERAGE VALUE.
    BestFitness = M(k&,1) 'ORIG CODE 03-23-2010: THIS IS A MISTAKE!
    BestFitness = -1E4200 'THIS LINE CORRECTED 03-23-2010 PER DISCUSSION WITH ROB GREEN.
    'INITIALIZE BEST FITNESS AT k&-th TIME STEP TO AN EXTREMELY LARGE NEGATIVE NUMBER.
    FOR p% = 1 TO Np% 'PROBE-BY-PROBE GET MAXIMUM FITNESS
        IF M(p%,k&) >= BestFitness THEN BestFitness = M(p%,k&)
    NEXT p%
    IF k& = j& THEN BestFitnessStepJ = BestFitness 'IF AT THE END OF AVERAGING INTERVAL, SAVE BEST FITNESS FOR CURRENT TIME STEP j&
    SumOfBestFitnesses = SumOfBestFitnesses + BestFitness
    B$ = B$ + "k=" + STR$(k&)+" BestFit=" + STR$(BestFitness)+" SumFit=" + STR$(SumOfBestFitnesses)+CHR$(13)
NEXT k&
IF ABS(SumOfBestFitnesses/Nsteps&-BestFitnessStepJ) <= FitnessSatTOL THEN A$ = "YES" 'saturation if (avg value - last value) are within TOL
ExitHasFITNESSsaturated:
    HasFITNESSsaturated$ = A$
END FUNCTION 'HasFITNESSsaturated$()

'-----
SUB RetrieveErrantprobes2(Np%,Nd%,j&,R(),A(),Frep) 'added 04-01-10
LOCAL ErrantProbe$
LOCAL p%, i%, k%
LOCAL Xik, dMax, Eta(), EtaStar, SumSQ, MagAj1 AS EXT
REDIM Eta(1 TO Nd%, 1 TO 2) 'Eta(i%,k%)
FOR p% = 1 TO Np%
    ErrantProbe$ = "NO" 'presume each probe is inside DS
    FOR i% = 1 TO Nd% 'check to see if probe p lies outside DS (any coordinate exceeding a boundary)
        IF R(p%,i%,j&) > XiMax(i%) OR R(p%,i%,j&) < XiMin(i%) AND A(p%,i%,j&-1) <> 0## THEN 'probe lies outside DS
            ErrantProbe$ = "YES" : EXIT FOR
    END IF
NEXT i%
IF ErrantProbe$ = "YES" THEN 'reposition probe p inside DS with acceleration direction preserved
    FOR i% = 1 TO Nd% 'compute array of Eta values
        FOR k% = 1 TO 2
            SELECT CASE k%
                CASE 1 : Xik = XiMin(i%)
                CASE 2 : Xik = XiMax(i%)
            END SELECT
            Eta(i%,k%) = (Xik-R(p%,i%,j&-1))/A(p%,i%,j&-1)
        NEXT k%
    NEXT i%
    EtaStar = 1E4200 'very large positive number
    FOR i% = 1 TO Nd% 'get min Eta value > 0
        FOR k% = 1 TO 2
            IF Eta(i%,k%) < EtaStar AND Eta(i%,k%) >= 0## THEN EtaStar = Eta(i%,k%)
        NEXT k%
    NEXT i%
    SumSQ = 0## : FOR i% = 1 TO Nd% : SumSQ = SumSQ + A(p%,i%,j&-1)^2 : NEXT i% : MagAj1 = SQR(SumSQ) 'magnitude of acceleration vector A(probe #p)
at step j&-1 dMax = EtaStar*MagAj1 'distance to nearest boundary plane from position of probe p% at step j&-1
FOR i% = 1 TO Nd% 'change probe p's i-th coordinate in proportion to the ratio of position vector lengths at steps j& and j&-1
    R(p%,i%,j&) = R(p%,i%,j&-1) + Frep*dMax*A(p%,i%,j&-1)/MagAj1 'preserves acceleration directional information by scaling dMax by Frep, which
is arbitrary but precisely known
NEXT i%

```

```

        END IF 'ErrantProbe$ = "YES"
NEXT p%
END SUB 'Retrieveerrantprobes2()
'-----
SUB RetrieveErrantProbes(Np%,Nd%,j&,R(),Frep)
LOCAL p%, i%
FOR p% = 1 TO Np%
    FOR i% = 1 TO Nd%
        IF R(p%,i%,j&) < XiMin(i%) THEN R(p%,i%,j&) = MAX(XiMin(i%) + Frep*(R(p%,i%,j&-1)-XiMin(i%)),XiMin(i%)) 'CHANGED 02-07-10
        IF R(p%,i%,j&) > XiMax(i%) THEN R(p%,i%,j&) = MIN(XiMax(i%) - Frep*(XiMax(i%)-R(p%,i%,j&-1)),XiMax(i%))
    NEXT i%
NEXT p%
END SUB 'RetrieveErrantProbes()
'-----
SUB ResetDecisionSpaceBoundaries(Nd%)
LOCAL i%
FOR i% = 1 TO Nd% : XiMin(i%) = StartingXiMin(i%) : XiMax(i%) = StartingXiMax(i%) : NEXT i%
END SUB
'-----
SUB CopyBestMatrices(Np%,Nd%,Nt&,R(),M(),Rbest(),Mbest())
LOCAL p%, i%, j&
REDIM Rbest(1 TO Np%, 1 TO Nd%, 0 TO Nt&), Mbest(1 TO Np%, 0 TO Nd%, 0 TO Nt&) 're-initializes Best Position Vector/Fitness matrices to zero
FOR p% = 1 TO Np%
    FOR i% = 1 TO Nd%
        FOR j& = 0 TO Nt&
            Rbest(p%,i%,j&) = R(p%,i%,j&) : Mbest(p%,i%,j&) = M(p%,i%,j&)
        NEXT j&
    NEXT i%
NEXT p%
END SUB
'-----
'FORGET THIS IDEA !!!!
FUNCTION Probeweight(Nd%,R(),p%,j&) 'computes a 'weighting factor' based on probe's position (greater weight if closer to decision space boundary)
LOCAL MinDistCoordinate%, i% 'dimension number. Remember, XiMin(), XiMax()& DiagLength are GLOBAL.
LOCAL MinDistance, dstar, Maxweight AS EXT
MinDistance = DiagLength 'largest dimension of decision space
FOR i% = 1 TO Nd% 'compute distance to closest boundary
    IF ABS(R(p%,i%,j&)-XiMin(i%)) <= MinDistance THEN
        MinDistance = ABS(R(p%,i%,j&)-XiMin(i%)) : MinDistCoordinate% = i%
    END IF
    IF ABS(XiMax(i%)-R(p%,i%,j&)) <= MinDistance THEN
        MinDistance = ABS(XiMax(i%)-R(p%,i%,j&)) : MinDistCoordinate% = i%
    END IF
NEXT i%
dstar = MinDistance/(XiMax(MinDistCoordinate%)-XiMin(MinDistCoordinate%)) 'normalized minimum distance, [0-1]
MaxWeight = 2##
Probeweight = 1## + 2##*Maxweight*abs(dStar-0.5##)
Probeweight = 1## + 4##*Maxweight*(dStar-0.5##)^2
END FUNCTION 'Probeweight
'-----
'FORGET THIS IDEA !!!!
FUNCTION Probeweight2(Nd%,Np%,R(),M(),p%,j&) 'computes a 'weighting factor' based on probe's position (greater weight if closer to decision space boundary)
LOCAL MinDistCoordinate%, ProbeNum%, BestProbeThisStep%, i% 'dimension number. Remember, XiMin(), XiMax()& DiagLength are GLOBAL.
LOCAL Distance, SumSQ, dstar, Maxweight, BestFitnessThisStep AS EXT
BestFitnessThisStep = M(1,j&)
FOR ProbeNum% = 1 TO Np% 'get number of best probe this step
    IF M(ProbeNum%,j&) >= BestFitnessThisStep THEN
        BestFitnessThisStep = M(ProbeNum%,j&) : BestProbeThisStep% = ProbeNum%
    END IF
NEXT ProbeNum%
SumSQ = 0##
FOR i% = 1 TO Nd% 'compute distance from probe #p% to the best probe this step
    SumSQ = (R(p%,i%,j&) - R(BestProbeThisStep%,i%,j&))^2
NEXT i%
Distance = SQR(SumSQ)

```

```

dstar = Distance/DiagLength 'range [0-1]
' ----- Compute weight Factor -----
MaxWeight = 0#
Probeweight2 = 1## + 2##*Maxweight*abs(dstar-0.5##)
Probeweight2 = 1## + 4##*Maxweight*(dstar-0.5##)^2
END FUNCTION 'Probeweight2
'-----

FUNCTION SlopeRatio(M(),Np%,StepNumber&)
LOCAL p% 'probe #
LOCAL NumSteps%
LOCAL BestFitnessAtStepNumber, BestFitnessAtStepNumberMinus1, BestFitnessAtStepNumberMinus2, Z AS EXT
Z = 1## 'assumes no slope change
IF StepNumber& < 10 THEN GOTO ExitSlopeRatio 'need at least 10 steps for this test
NumSteps% = 2
BestFitnessAtStepNumber = M(1,StepNumber&) : FOR p% = 1 TO Np% : IF M(p%,StepNumber&) >= BestFitnessAtStepNumber
THEN BestFitnessAtStepNumber = M(p%,StepNumber&) : NEXT p%
BestFitnessAtStepNumberMinus1 = M(1,StepNumber&-NumSteps%) : FOR p% = 1 TO Np% : IF M(p%,StepNumber&-NumSteps%) >= BestFitnessAtStepNumberMinus1
THEN BestFitnessAtStepNumberMinus1 = M(p%,StepNumber&-NumSteps%) : NEXT p%
BestFitnessAtStepNumberMinus2 = M(1,StepNumber&-2*NumSteps%) : FOR p% = 1 TO Np% : IF M(p%,StepNumber&-2*NumSteps%) >= BestFitnessAtStepNumberMinus2
THEN BestFitnessAtStepNumberMinus2 = M(p%,StepNumber&-2*NumSteps%) : NEXT p%
Z = (BestFitnessAtStepNumber-BestFitnessAtStepNumberMinus1)/(BestFitnessAtStepNumberMinus1-BestFitnessAtStepNumberMinus2)
ExitSlopeRatio:
SlopeRatio = Z
END FUNCTION
'-----

SUB PlotResults(FunctionName$,Nd%,Np%,BestFitnessOverall,BestNpNd%,BestGamma,Neval&,Rbest(),Mbest(),BestProbeNumberOverall%,BestTimeStepOverall%,LastStepBestRun%,Alpha,Beta)
LOCAL LastStep&, BestFitnessProbeNumber%, BestFitnessTimeStep&, NumTrajectories%, Max1DprobesPlotted%, i%
LOCAL RepositionFactor$, PlaceInitialProbes$, InitialAcceleration$, A$, B$
LOCAL G, DeltaT, Freq AS EXT
' G = 2## : DeltaT = 1## : Freq = 0.5## : RepositionFactor$ = "VARIABLE" : PlaceInitialProbes$ = "UNIFORM ON-AXIS" : InitialAcceleration$ = "FIXED"
'THese ARE NOW HARDWIRED IN THE CFO EQUATIONS 'ORIG CODE 05/14/2011
' G = 2## : DeltaT = 1## : Freq = 0.5## : RepositionFactor$ = "VARIABLE" : PlaceInitialProbes$ = "PROBE LINES" : InitialAcceleration$ = "ZERO" 'MOD
05/14/2011
B$ = "" : IF Nd% > 1 THEN B$ = "s"
A$ = FunctionName$ + CHR$(13) +
"Best Fitness = " + REMOVE$(STR$(BestFitnessOverall),ANY" ") + " returned by " + CHR$(13) +
"Probe # " + REMOVE$(STR$(BestProbeNumberOverall%),ANY" ") + CHR$(13) + CHR$(13) + "P" + REMOVE$(STR$(BestProbeNumberOverall%),ANY" ") + "coordinate" + B$ + ":" + CHR$(13)
FOR i% = 1 TO Nd% : A$ = A$ + STR$(i%)+" "+REMOVE$(STR$(ROUND(Rbest(BestProbeNumberOverall%,i%,BestTimeStepOverall%),8)),ANY" ") + CHR$(13) : NEXT i%
MSGBOX(A$)
' ----- PLOT EVOLUTION OF BEST FITNESS, AVG DISTANCE & BEST PROBE #
-----
CALL
PlotBestFitnessEvolution(Nd%,Np%,LastStepBestRun&,G,DeltaT,Alpha,Beta,Freq,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,BestGamma)
' MSGBOX("Enter for next plot...")
CALL
PlotAverageDistance(Nd%,Np%,LastStepBestRun&,G,DeltaT,Alpha,Beta,Freq,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Rbest(),DiagLength,BestGamma)
' MSGBOX("Enter for next plot...")
CALL
PlotBestProbeVsTimeStep(Nd%,Np%,LastStepBestRun&,G,DeltaT,Alpha,Beta,Freq,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,BestGamma)
' ----- PLOT TRAJECTORIES OF BEST PROBES FOR 2/3-D FUNCTIONS -----
IF Nd% = 2 THEN
    NumTrajectories% = 10 : CALL Plot2DbestProbeTrajectories(NumTrajectories%,Mbest(),Rbest(),Np%,Nd%,LastStepBestRun&,FunctionName$)
    NumTrajectories% = 16 : CALL Plot2DindividualProbeTrajectories(NumTrajectories%,Mbest(),Rbest(),Np%,Nd%,LastStepBestRun&,FunctionName$)
END IF
IF Nd% = 3 THEN
    NumTrajectories% = 4 : CALL Plot3DbestProbeTrajectories(NumTrajectories%,Mbest(),Rbest(),Np%,Nd%,LastStepBestRun&,FunctionName$)
END IF
' ----- For 1-D Objective Functions, Tabulate Probe Coordinates & if Np% <= Max1DprobesPlotted% Plot Evolution of Probe Positions -----
IF Nd% = 1 THEN
    Max1DprobesPlotted% = 15
    CALL
Tabulate1DprobeCoordinates(Max1DprobesPlotted%,Nd%,Np%,LastStepBestRun&,G,DeltaT,Alpha,Beta,Freq,Rbest(),Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,BestGamma)
    IF Np% <= Max1DprobesPlotted% THEN -
        CALL
Plot1DprobePositions(Max1DprobesPlotted%,Nd%,Np%,LastStepBestRun&,G,DeltaT,Alpha,Beta,Freq,Rbest(),Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,BestGamma)
        CALL CLEANUP 'delete probe coordinate plot files, if any
    END IF

```

```

END SUB 'PlotResults()

'=====
SUB CheckNECfiles(NECfileError$)
LOCAL N%
NECfileError$ = "NO"
' ----- NEC Files Required for PBM Antenna Benchmarks -----
IF DIR$("n41_2k1.exe") = "" THEN
    MSGBOX("WARNING! 'n41_2k1.exe' not found. Run terminated.") : NECfileError$ = "YES" : EXIT SUB
END IF
' ----- These Files are Required for NEC-4.1, Some for NEC-2 -----
N% = FREEFILE : OPEN "ENDERR.DAT" FOR OUTPUT AS #N% : PRINT #N%, "NO" : CLOSE #N%
N% = FREEFILE : OPEN "FILE_MSG.DAT" FOR OUTPUT AS #N% : PRINT #N%, "NO" : CLOSE #N%
N% = FREEFILE : OPEN "NHSCALE.DAT" FOR OUTPUT AS #N% : PRINT #N%, "0.00001" : CLOSE #N%
END SUB
'-----
SUB GetBestFitness(M(),Np%,StepNumber&,BestFitness,BestProbeNumber%,BestTimeStep&)
LOCAL p%, i&, A$
BestFitness = M(1,0)
FOR i& = 0 TO StepNumber&
    FOR p% = 1 TO Np%
        IF M(p%,i&) >= BestFitness THEN
            BestFitness = M(p%,i&) : BestProbeNumber% = p% : BestTimeStep& = i&
        END IF
    NEXT p%
NEXT i&
END SUB
'===== FUNCTION DEFINITIONS =====
FUNCTION ObjectiveFunction(R(),Nd%,p%,j&,FunctionName$) 'Objective function to be MAXIMIZED is defined here
SELECT CASE FunctionName$
CASE "ParrottF4" : ObjectiveFunction = ParrottF4(R(),Nd%,p%,j&) 'Parrott F4 (1-D)
CASE "SGO" : ObjectiveFunction = SGO(R(),Nd%,p%,j&) 'SGO Function (2-D)
CASE "GP" : ObjectiveFunction = GoldsteinPrice(R(),Nd%,p%,j&) 'Goldstein-Price Function (2-D)
CASE "STEP" : ObjectiveFunction = StepFunction(R(),Nd%,p%,j&) 'Step Function (n-D)
CASE "SCHWEFEL_226" : ObjectiveFunction = Schwefel1226(R(),Nd%,p%,j&) 'Schwefel Prob. 2.26 (n-D)
CASE "COLVILLE" : ObjectiveFunction = Colville(R(),Nd%,p%,j&) 'Colville Function (4-D)
CASE "GRIEWANK" : ObjectiveFunction = Griewank(R(),Nd%,p%,j&) 'Griewank Function (n-D)
CASE "HIMMELBLAU" : ObjectiveFunction = Himmelblau(R(),Nd%,p%,j&) 'Himmelblau Function (2-D)
CASE "ROSEN BROCK" : ObjectiveFunction = Rosenbrock(R(),Nd%,p%,j&) 'Rosenbrock Function (n-D)
CASE "SPHERE" : ObjectiveFunction = Sphere(R(),Nd%,p%,j&) 'Sphere Function (n-D)
CASE "HIMMELBLAUNL0" : ObjectiveFunction = HIMMELBLAUNL0(R(),Nd%,p%,j&) 'Himmelblau NLO (5-D)
CASE "TRIPOD" : ObjectiveFunction = Tripod(R(),Nd%,p%,j&) 'Tripod (2-D)
CASE "ROSEN BROCK F6" : ObjectiveFunction = RosenbrockF6(R(),Nd%,p%,j&) 'RosenbrockF6 (10-D)
CASE "COMPRESSIONSPRING" : ObjectiveFunction = CompressionSpring(R(),Nd%,p%,j&) 'Compression Spring (3-D)
CASE "GEARTRAIN" : ObjectiveFunction = GearTrain(R(),Nd%,p%,j&) 'Gear Train (4-D)
----- GSO Paper Benchmark Functions -----
CASE "F1" : ObjectiveFunction = F1(R(),Nd%,p%,j&) 'F1 (n-D)
CASE "F2" : ObjectiveFunction = F2(R(),Nd%,p%,j&) 'F2 (n-D)
CASE "F3" : ObjectiveFunction = F3(R(),Nd%,p%,j&) 'F3 (n-D)
CASE "F4" : ObjectiveFunction = F4(R(),Nd%,p%,j&) 'F4 (n-D)
CASE "F5" : ObjectiveFunction = F5(R(),Nd%,p%,j&) 'F5 (n-D)
CASE "F6" : ObjectiveFunction = F6(R(),Nd%,p%,j&) 'F6 (n-D)
CASE "F7" : ObjectiveFunction = F7(R(),Nd%,p%,j&) 'F7 (n-D)
CASE "F8" : ObjectiveFunction = F8(R(),Nd%,p%,j&) 'F8 (n-D)
CASE "F9" : ObjectiveFunction = F9(R(),Nd%,p%,j&) 'F9 (n-D)
CASE "F10" : ObjectiveFunction = F10(R(),Nd%,p%,j&) 'F10 (n-D)
CASE "F11" : ObjectiveFunction = F11(R(),Nd%,p%,j&) 'F11 (n-D)
CASE "F12" : ObjectiveFunction = F12(R(),Nd%,p%,j&) 'F12 (n-D)
CASE "F13" : ObjectiveFunction = F13(R(),Nd%,p%,j&) 'F13 (n-D)
CASE "F14" : ObjectiveFunction = F14(R(),Nd%,p%,j&) 'F14 (2-D)
CASE "F15" : ObjectiveFunction = F15(R(),Nd%,p%,j&) 'F15 (4-D)
CASE "F16" : ObjectiveFunction = F16(R(),Nd%,p%,j&) 'F16 (2-D)
CASE "F17" : ObjectiveFunction = F17(R(),Nd%,p%,j&) 'F17 (2-D)
CASE "F18" : ObjectiveFunction = F18(R(),Nd%,p%,j&) 'F18 (2-D)
CASE "F19" : ObjectiveFunction = F19(R(),Nd%,p%,j&) 'F19 (3-D)
CASE "F20" : ObjectiveFunction = F20(R(),Nd%,p%,j&) 'F20 (6-D)
CASE "F21" : ObjectiveFunction = F21(R(),Nd%,p%,j&) 'F21 (4-D)
CASE "F22" : ObjectiveFunction = F22(R(),Nd%,p%,j&) 'F22 (4-D)
CASE "F23" : ObjectiveFunction = F23(R(),Nd%,p%,j&) 'F23 (4-D)
----- PBM Antenna Benchmarks -----
CASE "PBM_1" : ObjectiveFunction = PBM_1(R(),Nd%,p%,j&) 'PBM_1 (2-D)
CASE "PBM_2" : ObjectiveFunction = PBM_2(R(),Nd%,p%,j&) 'PBM_2 (2-D)
CASE "PBM_3" : ObjectiveFunction = PBM_3(R(),Nd%,p%,j&) 'PBM_3 (2-D)
CASE "PBM_4" : ObjectiveFunction = PBM_4(R(),Nd%,p%,j&) 'PBM_4 (2-D)
CASE "PBM_5" : ObjectiveFunction = PBM_5(R(),Nd%,p%,j&) 'PBM_5 (2-D)
----- LOADED BOWTIE IN FREE SPACE -----
CASE "BOWTIE" : ObjectiveFunction = BOWTIE(R(),Nd%,p%,j&) 'FREE SPACE LOADED BOWTIE
----- YAGI ARRAY IN FREE SPACE -----
CASE "YAGI" : ObjectiveFunction = YAGI_ARRAY(R(),Nd%,p%,j&) 'FREE SPACE YAGI ARRAY

```

```

END SELECT
END FUNCTION 'ObjectiveFunction()
'-----
SUB GetFunctionRunParameters(FunctionName$, Nd%, Np%, Nt&, G, DeltaT, Alpha, Beta, Freq, R(), A(), M(),-
DiagLength, PlaceInitialProbes$, InitialAcceleration$, RepositionFactor$)
LOCAL i%, NumProbesPerDimension%, NN%, NumCollinearElements%
LOCAL AS

SELECT CASE FunctionName$
CASE "ParrottF4"
Nd% = 1 : Np% = 3
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : XiMin(1) = 0## : XiMax(1) = 1##
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "SGO"
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -50## : XiMax(i%) = 50## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "GP"
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "STEP"
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : XiMin(1) = 72## : XiMax(1) = 78## : XiMin(2) = 27## : XiMax(2) = 33## 'use this to plot STEP detail
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "SCHWEFEL_226"
Nd% = 30 : Np% = 120
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -500## : XiMax(i%) = 500## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "COLVILLE"
Nd% = 4 : Np% = 16
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -10## : XiMax(i%) = 10## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "GRIEWANK"
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -600## : XiMax(i%) = 600## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "HIMMELBLAU"
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -6## : XiMax(i%) = 6## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "ROSEN BROCK" '(n-D)
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -2## : XiMax(i%) = 2## : NEXT i% : XiMin(i%) = -6## : XiMax(i%) = 6##
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "SPHERE" '(n-D)
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "HIMMELBLAUNLO" '(5-D)
Nd% = 5 : Np% = 20
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)
XiMin(1) = 78## : XiMax(1) = 102##
XiMin(2) = 33## : XiMax(2) = 45##
XiMin(3) = 27## : XiMax(3) = 45##
XiMin(4) = 27## : XiMax(4) = 45##
XiMin(5) = 27## : XiMax(5) = 45##
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "TRIPOD" '(2-D)
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%

```

```

NEXT i%      REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
CASE "ROSENBROCKF6" '(10-D)
Nd% = 10
Np% = 40
REDIM xioffset(1 TO Nd%)
xioffset(1) = 81.0232#
xioffset(2) = -48.3950#
xioffset(3) = 19.2316#
xioffset(4) = -2.5231#
xioffset(5) = 70.4338#
xioffset(6) = 47.1774#
xioffset(7) = -7.8358#
xioffset(8) = -86.6693#
xioffset(9) = 57.8532#
xioffset(10) = 0#
xioffset(1) = 80#
xioffset(2) = -50#
xioffset(3) = 20#
xioffset(4) = -3#
xioffset(5) = 70#
xioffset(6) = 47#
xioffset(7) = -8#
xioffset(8) = -87#
xioffset(9) = 58#
xioffset(10) = 0#
xioffset(1) = 5#
xioffset(2) = -25#
xioffset(3) = 5#
xioffset(4) = -15#
xioffset(5) = 5#
xioffset(6) = -2#
xioffset(7) = 25#
xioffset(8) = -5#
xioffset(9) = 5#
xioffset(10) = -15#
xioffset(1) = 0#
xioffset(2) = 81.0232#
xioffset(3) = -48.3950#
xioffset(4) = 19.2316#
xioffset(5) = -2.5231#
xioffset(6) = 70.4338#
xioffset(7) = 47.1774#
xioffset(8) = -7.8358#
xioffset(9) = -86.6693#
xioffset(10) = 57.8532#
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "COMPRESSIONSPRING" '(3-D)
Nd% = 3 : Np% = 12
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)
XiMin(1) = 1## : XiMax(1) = 70## 'integer values only!
XiMin(2) = 0.6## : XiMax(2) = 3##
XiMin(3) = 0.207## : XiMax(3) = 0.5##
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "GEARTRAIN" '(4-D)
Nd% = 4 : Np% = 16
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 12# : XiMax(i%) = 60## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "F1" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "F2" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -10## : XiMax(i%) = 10## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "F3" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "F4" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "F5" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -30## : XiMax(i%) = 30## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%      CASE "F6" '(n-D) STEP
Nd% = 30 : Np% = 60

```

```

REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -100## : XiMax(i%) = 100## : NEXT i%
NEXT i%
CASE "F7" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -1.28## : XiMax(i%) = 1.28## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F8" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -500## : XiMax(i%) = 500## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F9" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -5.12## : XiMax(i%) = 5.12## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F10" '(n-D) Ackley's Function
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -32## : XiMax(i%) = 32## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F11" '(n-D)
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -600## : XiMax(i%) = 600## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F12" '(n-D) Penalized #
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -50## : XiMax(i%) = 50## : NEXT i%
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -5## : XiMax(i%) = 5## : NEXT i% 'use this interval for second run to
improve performance
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F13" '(n-D) Penalized #
Nd% = 30 : Np% = 60
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -50## : XiMax(i%) = 50## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F14" '(2-D) Shekel's Foxholes
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -65.536## : XiMax(i%) = 65.536## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F15" '(4-D) Kowaliik's Function
Nd% = 4
Np% = 16
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -5## : XiMax(i%) = 5## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F16" '(2-D) Camel Back
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = -5## : XiMax(i%) = 5## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F17" '(2-D) Branin
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : XiMin(1) = -5## : XiMax(1) = 10## : XiMin(2) = 0## : XiMax(2) = 15##
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F18" '(2-D) Goldstein-Price
Nd% = 2 : Np% = 8
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : XiMin(1) = -2## : XiMax(1) = 2## : XiMin(2) = -2## : XiMax(2) = 2##
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F19" '(3-D) Hartman's Family #1
Nd% = 3 : Np% = 12
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 0## : XiMax(i%) = 1## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%
CASE "F20" '(6-D) Hartman's Family #

```

```

Nd% = 6 : Np% = 24
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 0## : XiMax(i%) = 1## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
CASE "F21" '(4-D) Shekel's Family m=5
Nd% = 4 : Np% = 16
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 0## : XiMax(i%) = 10## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
CASE "F22" '(4-D) Shekel's Family m=7
Nd% = 4 : Np% = 16
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 0## : XiMax(i%) = 10## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
CASE "F23" '(4-D) Shekel's Family m=10
Nd% = 4 : Np% = 16
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 0## : XiMax(i%) = 10## : NEXT i%
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
CASE "PBM_1" '2-D
Nd% = 2
NumProbesPerDimension% = 2 '4 '20
Np% = NumProbesPerDimension%*Nd%
Nt& = 100
G = 2##
Alpha = 2##
Beta = 2##
DeltaT = 1##
Freq = 0.5##
PlaceInitialProbes$ = "UNIFORM ON-AXIS"
InitialAcceleration$ = "ZERO"
RepositionFactor$ = "VARIABLE" "'FIXED"
Np% = NumProbesPerDimension%*Nd%
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)
XiMin(1) = 0.5## : XiMax(1) = 3## 'dipole length, L, in Wavelengths
XiMin(2) = 0## : XiMax(2) = Pi2 'polar angle, Theta, in Radians
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS #NN% : PRINT #NN%,"PBM1.NEC" : PRINT #NN%,"PBM1.OUT" : CLOSE #NN% 'NEC Input/Output Files
CASE "PBM_2" '2-D
AddNoiseToPBM2$ = "NO" "'YES" "'NO" "'YES"
Nd% = 2
NumProbesPerDimension% = 4 '20
Np% = NumProbesPerDimension%*Nd%
Nt& = 100
G = 2##
Alpha = 2##
Beta = 2##
DeltaT = 1##
Freq = 0.5##
PlaceInitialProbes$ = "UNIFORM ON-AXIS"
InitialAcceleration$ = "ZERO"
RepositionFactor$ = "VARIABLE" "'FIXED"
Np% = NumProbesPerDimension%*Nd%
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)
XiMin(1) = 5## : XiMax(1) = 15## 'dipole separation, D, in Wavelengths
XiMin(2) = 0## : XiMax(2) = Pi 'polar angle, Theta, in Radians
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS #NN% : PRINT #NN%,"PBM2.NEC" : PRINT #NN%,"PBM2.OUT" : CLOSE #NN%
CASE "PBM_3" '2-D
Nd% = 2
NumProbesPerDimension% = 4 '20
Np% = NumProbesPerDimension%*Nd%
Nt& = 100
G = 2##
Alpha = 2##
Beta = 2##
DeltaT = 1##
Freq = 0.5##
PlaceInitialProbes$ = "UNIFORM ON-AXIS"
InitialAcceleration$ = "ZERO"
RepositionFactor$ = "VARIABLE" "'FIXED"
Np% = NumProbesPerDimension%*Nd%
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)
XiMin(1) = 0## : XiMax(1) = 4## 'phase parameter, Beta (0-4)
XiMin(2) = 0## : XiMax(2) = Pi 'polar angle, Theta, in Radians
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) :
NEXT i%
NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS #NN% : PRINT #NN%,"PBM3.NEC" : PRINT #NN%,"PBM3.OUT" : CLOSE #NN%
CASE "PBM_4" '2-D
Nd% = 2
NumProbesPerDimension% = 4 '6 '2 '4 '20
Np% = NumProbesPerDimension%*Nd%

```

```

Nt&      = 100
G        = 2##
Alpha    = 2##
Beta     = 2##
DeltaT   = 1##
Freq     = 0.5##

PlaceInitialProbes$ = "UNIFORM ON-AXIS"
InitialAcceleration$ = "ZERO"
RepositionFactor$   = "VARIABLE" "'FIXED"

Np% = NumProbesPerDimension%Nd%
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)

XiMin(1) = 0.5## : XiMax(1) = 1.5## 'ARM LENGTH (NOT Total Length), wavelengths (0.5-1.5)
XiMin(2) = Pi/18## : XiMax(2) = Pi/2## 'Inner angle, Alpha, in Radians (Pi/18-Pi/2)

REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%

NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS #NN% : PRINT #NN%,"PBM4.NEC" : PRINT #NN%,"PBM4.OUT" : CLOSE #NN%
CASE "PBM_5"
  NumCollinearElements% = 6 '30 'EVEN OR ODD: 6,7,10,13,16,24 used by PBM
  Nd% = NumCollinearElements% - 1
  NumProbesPerDimension% = 4 '20
  Np% = NumProbesPerDimension%Nd%
  Nt&      = 100
  G        = 2##
  Alpha    = 2##
  Beta     = 2##
  DeltaT   = 1##
  Freq     = 0.5##

  PlaceInitialProbes$ = "UNIFORM ON-AXIS"
  InitialAcceleration$ = "ZERO"
  RepositionFactor$   = "VARIABLE" "'FIXED"

  Nd% = NumCollinearElements% - 1
  Np% = NumProbesPerDimension%Nd%
  REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : XiMin(i%) = 0.5## : XiMax(i%) = 1.5## : NEXT i%
  REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
NEXT i%

NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS #NN% : PRINT #NN%,"PBM5.NEC" : PRINT #NN%,"PBM5.OUT" : CLOSE #NN%
=====
CASE "BOWTIE" 'FREE SPACE LOADED BOWTIE
  ----- Check for NEC Executable -----
  IF DIR$("NEC41D_4K_053011.EXE") = "" THEN
    MSGBOX("WARNING! NEC4.1D executable NEC41D_4K_053011.EXE not found!" +CHR$(13)+CHR$(13)+_
           "RUN TERMINATED.")+CHR$(13)+CHR$(13)
    EXIT SUB
  END IF

  ----- Get Segmentation -----
  IF DIR$("BowtieSeg.TXT") = "" THEN 'create BowtieSeg.TXT if it doesn't exist
    NN% = FREEFILE : OPEN "BowtieSeg.TXT" FOR OUTPUT AS NN% : PRINT #NN%,"Variable" : PRINT #NN%,"0.05" : CLOSE #NN%
  END IF
  NN% = FREEFILE : OPEN "BowtieSeg.TXT" FOR INPUT AS NN% : INPUT #NN%,BowtieSegmentLength$ : INPUT #NN%,BowtieSegmentLengthwvln : CLOSE #NN%
  IF INSTR(UCASE$(BowtieSegmentLength$),"V") > 0 THEN BowtieSegmentLength$ = "VARIABLE"
  IF INSTR(UCASE$(BowtieSegmentLength$),"F") > 0 THEN BowtieSegmentLength$ = "FIXED"
  IF INSTR(UCASE$(BowtieSegmentLength$),"E") = 0 AND INSTR(UCASE$(BowtieSegmentLength$),"F") = 0 THEN BowtieSegmentLength$ = "VARIABLE"
  IF BowtieSegmentLengthwvln < 0.02## OR BowtieSegmentLengthwvln > 0.2## THEN BowtieSegmentLengthwvln = 0.05## 'range 0.02-0.2 wavelengths

  ----- Get Bowtie Fitness Function Coefficients ----- NOTE: OPTIONALLY USED IN FITNESS FUNCTION (SEE BOWTIE FUNCTION FOR ACTUAL CALCULATION)
  REDIM BowtieFitnessCoefficients(1 TO 3)
  IF DIR$("BowtieCoef.txt") = "" THEN 'create BowtieCoef.TXT if it doesn't exist
    NN% = FREEFILE : OPEN "BowtieCoef.TXT" FOR OUTPUT AS NN% : PRINT #NN%,"40" : PRINT #NN%,"2" : PRINT #NN%,"3" : CLOSE #NN%
  END IF
  NN% = FREEFILE
  OPEN "BowtieCoef.TXT" FOR INPUT AS NN%
  INPUT #NN%,BowtieFitnessCoefficients(1) : INPUT #NN%,BowtieFitnessCoefficients(2) : INPUT #NN%,BowtieFitnessCoefficients(3)
  CLOSE #NN%
  BowtieCoefficients$ = "A=" + REMOVE$(STR$(BowtieFitnessCoefficients(1)),ANY"") +_
    ", B=" + REMOVE$(STR$(BowtieFitnessCoefficients(2)),ANY"") +_
    ", C=" + REMOVE$(STR$(BowtieFitnessCoefficients(3)),ANY" ")

'BOWTIE DECISION SPACE BOUNDARY ARRAY:
  Array Element #      Design Variable
  ----- -----
  1                   Bowtie arm length (wavelengths)
  2                   Bowtie HALF angle (degrees)
  3                   Loading segment number #1
  4                   Loading resistance #1 (ohms)
  5                   Zo

Nd% = 5 'FIXED DIMENSIONALITY BASED ON ABOVE DESIGN PARAMETERS
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%)

XiMin(1) = 0.01## : XiMax(1) = 0.08# 'min/max arm length (METERS) (>~1/4-wave at 1 GHz)
XiMin(2) = 10## : XiMax(2) = 80## 'min/max HALF angle (degrees)
XiMin(3) = 1 : XiMax(3) = 9 'min/max loading segment number #1 (NOTE FIXED SEGMENTATION AT 9 SEGS !!!)
XiMin(4) = 1## : XiMax(4) = 100## 'min/max loading resistance, R1 (ohms)
XiMin(5) = 50## : XiMax(5) = 100## 'Zo, ohms

REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%) : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%)
FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) : NEXT i%
NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS #NN% : PRINT #NN%,"BOWTIE.NEC" : PRINT #NN%,"BOWTIE.OUT" : CLOSE #NN%
=====
CASE "YAGI" 'FREE SPACE YAGI ARRAY
  ----- Check for NEC Executable -----
  IF DIR$("NEC41D_4K_053011.EXE") = "" THEN
    MSGBOX("WARNING! NEC4.1D executable NEC41D_4K_053011.EXE not found!" +CHR$(13)+CHR$(13)+_
           "RUN TERMINATED.")+CHR$(13)+CHR$(13)
    EXIT SUB
  END IF

  ----- Get Segmentation -----
  IF DIR$("YagiSeg.TXT") = "" THEN 'create YagiSeg.TXT if it doesn't exist
    NN% = FREEFILE : OPEN "YagiSeg.TXT" FOR OUTPUT AS NN% : PRINT #NN%,"Variable" : PRINT #NN%,"0.05" : CLOSE #NN%

```

```

END IF
NN% = FREEFILE : OPEN "YagiSeg.TXT" FOR INPUT AS NN% : INPUT #NN%,YagiSegmentLength$ : INPUT #NN%,YagiSegmentLengthw\ln : CLOSE #NN%
IF INSTR(UCASE$(YagiSegmentLength$),"V") > 0 THEN YagiSegmentLength$ = "VARIABLE"
IF INSTR(UCASE$(YagiSegmentLength$),"E") > 0 THEN YagiSegmentLength$ = "FIXED"
IF INSTR(UCASE$(YagiSegmentLength$),"F") = 0 AND INSTR(UCASE$(YagiSegmentLength$),"F") = 0 THEN YagiSegmentLength$ = "VARIABLE"
IF YagiSegmentLengthw\ln < 0.02## OR YagiSegmentLengthw\ln > 0.2## THEN YagiSegmentLengthw\ln = 0.05## 'range 0.02-0.2 wavelengths

' ----- Get Yagi Fitness Function Coefficients -----
REDIM YagiFitnessCoefficients(1 TO 4)
IF DIR$("YagiCoeff.TXT") = "" THEN 'create YagiCoeff.TXT if it doesn't exist
'A=20, B=2, C=3, D=4.
    NN% = FREEFILE : OPEN "YagiCoeff.TXT" FOR OUTPUT AS NN% : PRINT #NN%,"20" : PRINT #NN%,"2" : PRINT #NN%,"3" : PRINT #NN%,"4" : CLOSE
#NN%
    END IF
    NN% = FREEFILE
    OPEN "YagiCoeff.TXT" FOR INPUT AS NN%
        INPUT #NN%,YagiFitnessCoefficients(1) : INPUT #NN%,YagiFitnessCoefficients(2) : INPUT #NN%,YagiFitnessCoefficients(3) : INPUT
#NN%,YagiFitnessCoefficients(4)
        CLOSE #NN%
    YagiCoefficients$ = "A=" + REMOVE$(STR$(YagiFitnessCoefficients(1)),ANY" ") +
    ", B=" + REMOVE$(STR$(YagiFitnessCoefficients(2)),ANY" ") +
    ", C=" + REMOVE$(STR$(YagiFitnessCoefficients(3)),ANY" ") +
    ", D=" + REMOVE$(STR$(YagiFitnessCoefficients(4)),ANY" ")

' ----- # Array Elements -----
A$ = INPUTBOX$("Array Elements","YAGI ELEMENTS","5")
NumYagiElements% = VAL(A$)

Nd% = 2*NumYagiElements% 'spacing and length are the two optimization parameters defining each element
Nd% = Nd%+1 'INCREASE DECISION SPACE DIMENSION TO ADD Zo AS A DESIGN <<>>.
'=====

'YAGI DECISION SPACE BOUNDARY ARRAY:
' Array Element #           Design Variable
'----- -----
1          TO      Yagi element spacing along boom from previous element, wavelengths
NumYagiElements
NumYagiElements+1          TO      Yagi element length, wavelengths
2*NumYagiElements (Nd-1)

Nd          <<< Zo >>>
REDIM XiMin(1 TO Nd%), XiMax(1 TO Nd%) '<<<<< FOLLOWING BOUNDS ARE FOR ZEPP ELEMENTS !!! >>>>>>>>>
XiMin(1) = 0## : XiMax(1) = 0## : FOR i% = 2 TO NumYagiElements% : XiMin(i%) = 0.1## : XiMax(i%) = 0.5## : NEXT i% 'min/max SPACING, w\ln
'[NOTE: XiMin/max(1)=0 ALWAYS BECAUSE FIRST ELEMENT, REFLECTOR, IS AT X=0 (no spacing)]
XiMin(NumYagiElements%+1) = 0.2## : XiMax(NumYagiElements%+1) = 0.6## 'min/max RREFLECTOR length, waves
XiMin(NumYagiElements%+2) = 0.2## : XiMax(NumYagiElements%+2) = 0.6## 'min/max DRIVEN ELEMENT length, waves
FOR i% = NumYagiElements%+3 TO Nd%-1
    XiMin(i%) = 0.2## : XiMax(i%) = 0.6## 'min/max DIRECTOR lengths, waves
NEXT i%
XiMin(Nd%) = 5## : XiMax(j%) = 600## 'min/max values of zo (OHMS)
REDIM StartingXiMin(1 TO Nd%), StartingXiMax(1 TO Nd%)
FOR i% = 1 TO Nd% : StartingXiMin(i%) = XiMin(i%) : StartingXiMax(i%) = XiMax(i%) : NEXT i%
NN% = FREEFILE : OPEN "INFILE.DAT" FOR OUTPUT AS NN% : PRINT #NN%,"YAGI.NEC" : PRINT #NN%,"YAGI.OUT" : CLOSE #NN%
'===== END YAGI =====

' NOTE - DON'T FORGET TO ADD NEW TEST FUNCTIONS TO FUNCTION ObjectiveFunction() ABOVE !!
'=====

END SELECT
IF Nd% > 100 THEN Nt& = MIN(Nt&,200) 'to avoid array dimensioning problems
DiagLength = 0## : FOR i% = 1 TO Nd% : DiagLength = DiagLength + (XiMax(i%) - XiMin(i%))^2 : NEXT i% : DiagLength = SQR(DiagLength) 'compute length of
decision space principal diagonal
END SUB 'GetFunctionRunParameters()

'-----
FUNCTION ParrottF4(R(),Nd%,p%,j&) 'Parrott F4 (1-D)
'MAXIMUM = 1 AT ~0.0796875... WITH ZERO OFFSET (SEEMS TO WORK BEST WITH JUST 3 PROBES, BUT NOT ALLOWED IN THIS VERSION...)
'References:
'Beasley, D., D. R. Bull, and R. R. Martin, "A Sequential Niche Technique for Multimodal
'Function Optimization," Evol. Comp. (MIT Press), vol. 1, no. 2, 1993, pp. 101-125
'(online at http://citeseer.ist.psu.edu/beasley93sequential.html).
'Parrott, D., and X. Li, "Locating and Tracking Multiple Dynamic Optima by a Particle Swarm
'Model Using Speciation," IEEE Trans. Evol. Computation, vol. 10, no. 4, Aug. 2006, pp. 440-458.

LOCAL Z, x, offset AS EXT
offset = 0#
x = R(p%,1,j&)
Z = EXP(-2##*LOG(2##)*((x-0.08##-offset)/0.854##)^2)*(SIN(S##*Pi*((x-offset)^0.75##-0.05##)))^6 'WARNING! This is a NATURAL LOG, NOT Log10!!!
ParrottF4 = Z
END FUNCTION 'ParrottF4()
'-----
FUNCTION SGO(R(),Nd%,p%,j&) 'SGO Function (2-D)
'MAXIMUM = ~130.8323226... @ ~(-2.8362075...,-2.8362075...) WITH ZERO OFFSET.
'Reference:
'Hsiang, Y., Chuang, C., Jiang, J., and Chien, C., "A Novel Optimization Algorithm: Space
'Gravitational Optimization," Proc. of 2005 IEEE International Conference on Systems, Man,
'and Cybernetics, 3, 2323-2328. (2005)
LOCAL x1, x2, z, t1, t2, SGOx1offset, SGOx2offset AS EXT
SGOx1offset = 0## : SGOx2offset = 0##
SGOx1offset = 40## : SGOx2offset = 10##

```

```

x1 = R(p%,1,j&) - SG0x1offset : x2 = R(p%,2,j&) - SG0x2offset
t1 = x1^4 - 16##*x1^2 + 0.5##*x1 : t2 = x2^4 - 16##*x2^2 + 0.5##*x2
Z = t1 + t2
SG0 = -Z
END FUNCTION 'SG0()

'-----
FUNCTION GoldsteinPrice(R(),Nd%,p%,j&) 'Goldstein-Price Function (2-D)
'MAXIMUM = -3 @ (0,-1) WITH ZERO OFFSET.
'Reference:
'Cui, Z., Zeng, J., and Sun, G. (2006) 'A Fast Particle Swarm Optimization,' Int'l. J. Innovative Computing, Information and Control, vol. 2, no. 6, December, pp. 1365-1380.
LOCAL Z, x1, x2, offset1, offset2, t1, t2 AS EXT
offset1 = 0## : offset2 = 0##
' offset1 = 20## : offset2 = -10##
x1 = R(p%,1,j&)-offset1 : x2 = R(p%,2,j&)-offset2
t1 = 1##*(x1+x2+1##)^2*(19##-14##*x1+3##*x1^2-14##*x2+6##*x1*x2+3##*x2^2)
t2 = 30##*(2##*x1-3##*x2)^2*(18##-32##*x1+12##*x1^2+48##*x2-36##*x1*x2+27##*x2^2)
Z = t1*t2
GoldsteinPrice = -Z
END FUNCTION 'GoldsteinPrice()

'-----
FUNCTION StepFunction(R(),Nd%,p%,j&) 'Step Function (n-D)
'MAXIMUM VALUE = 0 @ [Offset]^n.
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster," IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

LOCAL Offset, Z AS EXT
LOCAL i%
Z = 0## : Offset = 0## '75.123## '0##
FOR i% = 1 TO Nd%
  IF Nd% = 2 AND i% = 1 THEN Offset = 75 '75##
  IF Nd% = 2 AND i% = 2 THEN Offset = 35 '30 '35##
  Z = Z + INT((R(p%,i%,j&)-Offset) + 0.5##)^2
NEXT i%
StepFunction = -Z
END FUNCTION 'StepFunction()

'-----
FUNCTION Schwefel226(R(),Nd%,p%,j&) 'Schwefel Problem 2.26 (n-D)
'MAXIMUM = 12,569.5 @ [420.8687]^30 (30-D CASE).
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster," IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

LOCAL Z, xi AS EXT
LOCAL i%
Z = 0##
FOR i% = 1 TO Nd%
  xi = R(p%,i%,j&)
  Z = Z + xi*SIN(SQR(ABS(xi)))
NEXT i%
Schwefel226 = Z
END FUNCTION 'SCHWEFEL226()

'-----
FUNCTION Colville(R(),Nd%,p%,j&) 'Colville Function (4-D)
'MAXIMUM = 0 @ (1,1,1,1) WITH ZERO OFFSET.
'Reference:
'Doo-Hyun, and Se-Young, O., "A New Mutation Rule for Evolutionary Programming Motivated from Backpropagation Learning," IEEE Trans. Evolutionary Computation, vol. 4, No. 2, pp. 188-190, July 2000.

LOCAL Z, x1, x2, x3, x4, offset AS EXT
offset = 0## '7.123##
x1 = R(p%,1,j&)-offset : x2 = R(p%,2,j&)-offset : x3 = R(p%,3,j&)-offset : x4 = R(p%,4,j&)-offset
Z = 100##*(x2-x1)^2 + (1##*-x1)^2 + -
  90##*(x4-x3)^2 + (1##*-x3)^2 + -
  10.1#*((x2-1##)^2 + (x4-1##)^2) + -
  19.8##*(x2-1##)*(x4-1##)
Colville = -Z
END FUNCTION 'Colville()

```

```

FUNCTION Griewank(R(),Nd%,p%,j&) 'Griewank (n-D)
'Max of zero at (0,...,0)
'Reference: Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"
'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

    LOCAL Offset, Sum, Prod, Z, Xi AS EXT
    LOCAL i%
    Sum = 0## : Prod = 1##
    offset = 75.123##
    FOR i% = 1 TO Nd%
        Xi = R(p%,i%,j&) - offset
        Sum = Sum + Xi^2
        Prod = Prod*COS(Xi/SQR(i%))
    NEXT i%
    Z = Sum/4000## - Prod + 1##
    Griewank = -Z
END FUNCTION 'Griewank()

'-----
FUNCTION Himmelblau(R(),Nd%,p%,j&) 'Himmelblau (2-D)
    LOCAL Z, x1, x2, offset AS EXT
    offset = 0##
    x1 = R(p%,1,j&)-offset : x2 = R(p%,2,j&)-offset
    Z = 200## - (x1^2 + x2 -11##)^2 - (x1+x2^2-7##)^2
    Himmelblau = Z
END FUNCTION 'Himmelblau()

'-----
FUNCTION Rosenbrock(R(),Nd%,p%,j&) 'Rosenbrock (n-D)
'MAXIMUM = 0 @ [1,...,1]^n (n-D CASE).
'Reference: Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"
'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

    LOCAL Z, Xi, xi1 AS EXT
    LOCAL i%
    Z = 0##
    FOR i% = 1 TO Nd%-1
        xi = R(p%,i%,j&) : xi1 = R(p%,i%+1,j&)
        Z = Z + 100##*(xi1-Xi^2)^2 + (Xi-1##)^2
    NEXT i%
    Rosenbrock = -Z
END FUNCTION 'ROSENBROCK()

'-----
FUNCTION Sphere(R(),Nd%,p%,j&) 'Sphere (n-D)
'MAXIMUM = 0 @ [0,...,0]^n (n-D CASE).
'Reference: Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"
'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

    LOCAL Z, Xi, xi1 AS EXT
    LOCAL i%
    Z = 0##
    FOR i% = 1 TO Nd%
        xi = R(p%,i%,j&)
        Z = Z + Xi^2
    NEXT i%
    Sphere = -Z
END FUNCTION 'SPHERE()

'-----
FUNCTION HimmelblauNLO(R(),Nd%,p%,j&) 'Himmelblau non-linear optimization (5-D)
'MAXIMUM ~ 31025.5562644972 @ (78.0,33.0,27.0709971052,45.0,44.9692425501)
'Reference: "Constrained Optimization using CODEQ," Mahamed G.H. Omran & Ayed Salman,
'Chaos, Solitons and Fractals, 42(2009), 662-668

    LOCAL Z, x1, x2, x3, x4, x5, g1, g2, g3 AS EXT
    Z = 1E4200
    x1 = R(p%,1,j&) : x2 = R(p%,2,j&) : x3 = R(p%,3,j&) : x4 = R(p%,4,j&) : x5 = R(p%,5,j&)
    g1 = 85.334407## + 0.0056858##*x2*x5 + 0.00026##*x1*x4 - 0.0022053##*x3*x5
    g2 = 80.51249## + 0.0071317##*x2*x5 + 0.0029955##*x1*x2 + 0.0021813##*x3*x4
    g3 = 9.300961## + 0.0047026##*x3*x5 + 0.0012547##*x1*x3 + 0.0019085##*x3*x4
    IF g1## < 0 OR g1 > 92## OR g2 < 90## OR g2 > 110## OR g3 < 20## OR g3 > 25## THEN GOTO ExitHimmelblauNLO
    Z = 5.3578547##*x3*x3 + 0.8356891##*x1*x5 + 37.29329##*x1 - 40792.141#

```

```

ExitHimmelblauNLO:
    HimmelblauNLO = -Z
END FUNCTION 'HimmelblauNLO()
'-----
FUNCTION Tripod(R(),Nd%,p%,j&) 'Tripod (2-D)
'MAXIMUM = 0 at (0,-50)
'Reference: "Appendix: A mini-benchmark," Maurice Clerc
    LOCAL Z, x1, x2, s1, s2, t1, t2, t3 AS EXT
    x1 = R(p%,1,j&) : x2 = R(p%,2,j&)
    s1 = Sign(x1) : s2 = Sign(x2)
    t1 = (1##-s2)*(ABS(x1)+ABS(x2+50##))
    t2 = 0.5##*(1##+s2)*(1##-s1)*(1##+ABS(x1+50##)+ABS(x2-50##))
    t3 = (1##+s1)*(2##+ABS(x1-50##)+ABS(x2-50##))
    Z = 0.5##*(t1 + t2 + t3)
    Tripod = -Z
END FUNCTION 'Tripod()
'-----
FUNCTION Sign(X)
LOCAL Z AS EXT
    Z = 1## : IF X <= 0## THEN Z = -1##
    Sign = Z
END FUNCTION
'-----
FUNCTION RosenbrockF6(R(),Nd%,p%,j&) 'Rosenbrock F6 (10-D)
'WARNING !! 03-19-10 THIS FUNCTION CONTAINS ERRORS. SEE CLERC'S EMAIL!
'MAXIMUM = 394 at (0,-50)
'Reference: "Appendix: A mini-benchmark," Maurice Clerc (NOTE: Uses his notation...)
    LOCAL Z, xi, xi1, zi, zi1, Sum AS EXT
    LOCAL i%
    Sum = 0##
    FOR i% = 2 TO Nd%
        xi = R(p%,i%,j&) : xi1 = R(p%,i%-1,j&)
        zi = xi - xi offset(i%) + 1## : zi1 = xi1 - xi offset(i%-1) + 1##
        Sum = Sum + 100##*(zi1^2-zi)^2 + (zi1-1##)^2
    NEXT i%
    Z = 390## + Sum
    RosenbrockF6 = -Z
END FUNCTION 'RosenbrockF6()
'-----
FUNCTION CompressionSpring(R(),Nd%,p%,j&) 'compression Spring (3-D)
'MAXIMUM = 394 at (0,-50)
'Reference: "Appendix: A mini-benchmark," Maurice Clerc (NOTE: Uses his notation...)
    LOCAL Z, x1, x2, x3, g1, g2, g3, g4, g5, Cf, Fmax, S, Lf, Lmax, SigP, SigPM, Fp, K, SigW AS EXT
    Z = 1E4200
    x1 = ROUND(R(p%,1,j&),0) : x2 = R(p%,2,j&) : x3 = ROUND(R(p%,3,j&),3)
    Cf = 1## + 0.75##*x3/(x2-x3)+0.615##*x3/x2
    Fmax = 1000## : S = 189000## : Lmax = 14## : SigPM = 6## : Fp = 300## : SigW = 1.25##
    K = 11.5##*1E6*x3^4/(8##*x1*x2*x3)
    Lf = Fmax/K + 1.05##*(x1+2##)*x3
    SigP = Fp/K
    g1 = 8##*Cf*Fmax*x2/(Pi*x3^3) - S
    g2 = Lf - Lmax
    g3 = SigP - SigPM
    g4 = SigP - Fp/K 'WARNING! 03-19-10. THIS IS SATISFIED EXACTLY (SEE CLERC'S EMAIL - TYPO IN HIS BENCHMARKS)
    g5 = SigW - (Fmax-Fp)/K
    IF g1 > 0## OR g2 > 0## OR g3 > 0## OR g4 > 0## OR g5 > 0## THEN GOTO ExitCompressionSpring
    Z = Pi^2*x2*x3^2*(x1+1##)/4##
ExitCompressionSpring:
    CompressionSpring = -Z
END FUNCTION 'CompressionSpring()
'-----
FUNCTION GearTrain(R(),Nd%,p%,j&) 'GearTrain (4-D)
'MAXIMUM = 394 at (0,-50)
'Reference: "Appendix: A mini-benchmark," Maurice Clerc (NOTE: Uses his notation...)
    LOCAL Z, x1, x2, x3, x4 AS EXT

```

```

x1 = ROUND(R(p%,1,j&),0) : x2 = ROUND(R(p%,2,j&),0)
x3 = ROUND(R(p%,3,j&),0) : x4 = ROUND(R(p%,4,j&),0)
Z = (1#/6.931##-x1*x2/(x3*x4))^2
GearTrain = -Z
END FUNCTION 'GearTrain
'-----
FUNCTION F1(R(),Nd%,p%,j&) 'F1 (n-D)
'MAXIMUM = ZERO (n-D CASE).
'Reference:
LOCAL Z, Xi AS EXT
LOCAL i%
Z = 0##
FOR i% = 1 TO Nd%
Xi = R(p%,i%,j&)
Z = Z + Xi^2
NEXT i%
F1 = -Z
END FUNCTION 'F1
'-----
FUNCTION F2(R(),Nd%,p%,j&) 'F2 (n-D)
'MAXIMUM = ZERO (n-D CASE).
'Reference:
LOCAL Sum, prod, z, xi AS EXT
LOCAL i%
Z = 0## : Sum = 0## : Prod = 1##
FOR i% = 1 TO Nd%
Xi = R(p%,i%,j&)
Sum = Sum+ ABS(Xi)
Prod = Prod^ABS(Xi)
NEXT i%
Z = Sum + Prod
F2 = -Z
END FUNCTION 'F2
'-----
FUNCTION F3(R(),Nd%,p%,j&) 'F3 (n-D)
'MAXIMUM = ZERO (n-D CASE).
'Reference:
LOCAL Z, Xk, Sum AS EXT
LOCAL i%, k%
Z = 0##
FOR i% = 1 TO Nd%
Sum = 0##
FOR k% = 1 TO i%
Xk = R(p%,k%,j&)
Sum = Sum + Xk
NEXT k%
Z = Z + Sum^2
NEXT i%
F3 = -Z
END FUNCTION 'F3
'-----
FUNCTION F4(R(),Nd%,p%,j&) 'F4 (n-D)
'MAXIMUM = ZERO (n-D CASE).
'Reference:
LOCAL Z, Xi, MaxXi AS EXT
LOCAL i%
MaxXi = -1E4200
FOR i% = 1 TO Nd%
Xi = R(p%,i%,j&)
IF ABS(Xi) >= MaxXi THEN MaxXi = ABS(Xi)
NEXT i%
F4 = -MaxXi
END FUNCTION 'F4
'-----

```

```

FUNCTION F5(R(),Nd%,p%,j&) 'F5 (n-D)
'MAXIMUM = ZERO (n-D CASE).
'Reference:
    LOCAL Z, Xi, XiPlus1 AS EXT
    LOCAL i%
    Z = 0##
    FOR i% = 1 TO Nd%-1
        Xi      = R(p%,i%,j&)
        XiPlus1 = R(p%,i%+1,j&)
        Z = Z + (100##*(XiPlus1-Xi^2)^2+(Xi-1##))^2
    NEXT i%
    F5 = -Z
END FUNCTION 'F5
'-----
FUNCTION F6(R(),Nd%,p%,j&) 'F6 (n-D STEP)
'MAXIMUM VALUE = 0 @ [Offset]^n.
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"  

'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.
    LOCAL Z AS EXT
    LOCAL i%
    Z = 0##
    FOR i% = 1 TO Nd%
        Z = Z + INT(R(p%,i%,j&) + 0.5##)^2
    NEXT i%
    F6 = -Z
END FUNCTION 'F6
'-----
FUNCTION F7(R(),Nd%,p%,j&) 'F7
'MAXIMUM VALUE = 0 @ [offset]^n.
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"  

'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.
    LOCAL Z, Xi AS EXT
    LOCAL i%
    Z = 0##
    FOR i% = 1 TO Nd%
        Xi = R(p%,i%,j&)
        Z = Z + i%*Xi^4
    NEXT i%
    F7 = -Z - RandomNum(0##,1##)
END FUNCTION 'F7
'-----
FUNCTION F8(R(),Nd%,p%,j&) '(n-D) F8 [Schwefel Problem 2.26]
'MAXIMUM = 12,569.5 @ [420.8687]^30 (30-D CASE).
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"  

'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.
    LOCAL Z, Xi AS EXT
    LOCAL i%
    Z = 0##
    FOR i% = 1 TO Nd%
        Xi = R(p%,i%,j&)
        Z = Z - Xi*SIN(SQR(ABS(Xi)))
    NEXT i%
    F8 = -Z
END FUNCTION 'F8
'-----
FUNCTION F9(R(),Nd%,p%,j&) '(n-D) F9 [Rastrigin]
'MAXIMUM = ZERO (n-D CASE).
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster,"  

'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.
    LOCAL Z, Xi AS EXT
    LOCAL i%
    Z = 0##

```

```

FOR i% = 1 TO Nd%
  xi = R(p%,i%,j&)
  Z = Z + (xi^2 - 10##*COS(TwoPi*xi) + 10##)^2
NEXT i%
F9 = -Z
END FUNCTION 'F9

'-----
FUNCTION F10(R(),Nd%,p%,j&) '(n-D) F10 [Ackley's Function]
'MAXIMUM = ZERO (n-D CASE).
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster."
'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

  LOCAL Z, Xi, Sum1, Sum2 AS EXT
  LOCAL i%
  Z = 0## : Sum1 = 0## : Sum2 = 0##
  FOR i% = 1 TO Nd%
    xi = R(p%,i%,j&)
    Sum1 = Sum1 + Xi^2
    Sum2 = Sum2 + COS(TwoPi*xi)
  NEXT i%
  Z = -20##*EXP(-0.2##*SQR(Sum1/Nd%)) - EXP(Sum2/Nd%) + 20## + e
  F10 = -Z
END FUNCTION 'F10

'-----
FUNCTION F11(R(),Nd%,p%,j&) '(n-D) F11
'MAXIMUM = ZERO (n-D CASE).
'Reference:
'Yao, X., Liu, Y., and Lin, G., "Evolutionary Programming Made Faster."
'IEEE Trans. Evolutionary Computation, Vol. 3, No. 2, 82-102, Jul. 1999.

  LOCAL Z, Xi, Sum, Prod AS EXT
  LOCAL i%
  Z = 0## : Sum = 0## : Prod = 1##
  FOR i% = 1 TO Nd%
    xi = R(p%,i%,j&)
    Sum = Sum + (Xi-100##)^2
    Prod = Prod*COS((xi-100##)/SQR(i%))
  NEXT i%
  Z = Sum/4000## - Prod + 1##
  F11 = -Z
END FUNCTION 'F11

'-----
FUNCTION u(xi,a,k,m)
LOCAL Z AS EXT
Z = 0##
SELECT CASE xi
CASE > a : Z = k^(xi-a)^m
CASE < -a : Z = k^(-xi-a)^m
END SELECT
u = Z
END FUNCTION

'-----
FUNCTION F12(R(),Nd%,p%,j&) '(n-D) F12, Penalized #1
'Ref: Yao(1999). Max=0 @ (-1,-1,...,-1), -50=<xi=<50.

  LOCAL Offset, Sum1, Sum2, Z, X1, Y1, Xn, Yn, Xi, Yi, XiPlus1, YiPlus1 AS EXT
  LOCAL i%, m%, A#
  X1 = R(p%,1,j&) : Y1 = 1## + (X1+1##)/4##
  Xn = R(p%,Nd%,j&) : Yn = 1## + (Xn+1##)/4##
  Sum1 = 0##
  FOR i% = 1 TO Nd%-1
    xi = R(p%,i%,j&) : yi = 1## + (Xi+1##)/4##
    xiplus1 = R(p%,i%+1,j&): yiplus1 = 1## + (XiPlus1+1##)/4##
    Sum1 = Sum1 + (yi-1##)^2*(1##+1##*(SIN(Pi*yiPlus1))^2)
  NEXT i%
  Sum1 = Sum1 + 10##*(SIN(Pi*Y1))^2 + (Yn-1##)^2
  Sum1 = Pi*Sum1/Nd%

```

```

Sum2 = 0##
FOR i% = 1 TO Nd%
  Xi = R(p%,i%,j&)
  Sum2 = Sum2 + u(Xi,10##,100##,4##)
NEXT i%
Z = Sum1 + Sum2
F12 = -Z
END FUNCTION 'F12()

'-----
FUNCTION F13(R(),Nd%,p%,j&) '(n-D) F13, Penalized #
'Ref: Yao(1999). Max=0 @ (1,1,...,1), -50=<Xi=<50.
  LOCAL Offset, Sum1, Sum2, Z, Xi, Xn, XiPlus1, X1 AS EXT
  LOCAL i%, m%, A$
  X1 = R(p%,1,j&) : Xn = R(p%,Nd%,j&)
  Sum1 = 0##
  FOR i% = 1 TO Nd%-1
    Xi = R(p%,i%,j&) : XiPlus1 = R(p%,i%+1,j&)
    Sum1 = Sum1 + (Xi-1##)^2*(1##+(SIN(3##*Pi*Xiplus1))^2)
  NEXT i%
  Sum1 = Sum1 + (SIN(Pi*3##*X1))^2 +(Xn-1##)^2*(1##+(SIN(TwoPi*Xn))^2)
  Sum2 = 0##
  FOR i% = 1 TO Nd%
    Xi = R(p%,i%,j&)
    Sum2 = Sum2 + u(Xi,5##,100##,4##)
  NEXT i%
  Z = Sum1/10## + Sum2
  F13 = -Z
END FUNCTION 'F13()

'-----
SUB FillArrayAij 'needed for function F14, Shekel's Foxholes
  Aij(1,1)=-16## : Aij(1,2)=-16## : Aij(1,3)=0## : Aij(1,4)=16## : Aij(1,5)=32##
  Aij(1,6)=-32## : Aij(1,7)=-16## : Aij(1,8)=0## : Aij(1,9)=16## : Aij(1,10)=32##
  Aij(1,11)=-32## : Aij(1,12)=-16## : Aij(1,13)=0## : Aij(1,14)=16## : Aij(1,15)=32##
  Aij(1,16)=-32## : Aij(1,17)=-16## : Aij(1,18)=0## : Aij(1,19)=16## : Aij(1,20)=32##
  Aij(1,21)=-32## : Aij(1,22)=-16## : Aij(1,23)=0## : Aij(1,24)=16## : Aij(1,25)=32##
  Aij(2,1)=-32## : Aij(2,2)=-32## : Aij(2,3)=-32## : Aij(2,4)=-32## : Aij(2,5)=-32##
  Aij(2,6)=-16## : Aij(2,7)=-16## : Aij(2,8)=-16## : Aij(2,9)=-16## : Aij(2,10)=-16##
  Aij(2,11)=0## : Aij(2,12)=0## : Aij(2,13)=0## : Aij(2,14)=0## : Aij(2,15)=0##
  Aij(2,16)=16## : Aij(2,17)=16## : Aij(2,18)=16## : Aij(2,19)=16## : Aij(2,20)=16##
  Aij(2,21)=32## : Aij(2,22)=32## : Aij(2,23)=32## : Aij(2,24)=32## : Aij(2,25)=32#
END SUB
'-----

FUNCTION F14(R(),Nd%,p%,j&) 'F14 (2-D) Shekel's Foxholes (INVERTED...)
  LOCAL Sum1, Sum2, Z, Xi AS EXT
  LOCAL i%, jj%
  Sum1 = 0##
  FOR jj% = 1 TO 25
    Sum2 = 0##
    FOR i% = 1 TO 2
      Xi = R(p%,i%,j&)
      Sum2 = Sum2 + (Xi-Aij(i%,jj%))^6
    NEXT i%
    Sum1 = Sum1 + 1##/(jj%+Sum2)
  NEXT jj%
  Z = 1##/(0.002##+Sum1)
  F14 = -Z
END FUNCTION 'F14

'-----
FUNCTION F16(R(),Nd%,p%,j&) 'F16 (2-D) 6-Hump Camel-Back
  LOCAL x1, x2, Z AS EXT
  X1 = R(p%,1,j&) : X2 = R(p%,2,j&)
  Z = 4##*X1^2 - 2.1##*X1^4 + X1^6/3## + X1*X2 - 4*X2^2 + 4*X2^4
  F16 = -Z
END FUNCTION 'F16

'-----
FUNCTION F15(R(),Nd%,p%,j&) 'F15 (4-D) Kowaliak's Function
'Global maximum = -0.0003075 @ (0.1928,0.1908,0.1231,0.1358)
  LOCAL x1, x2, x3, x4, Num, Denom, Z, Aj(), Bj() AS EXT
  LOCAL jj%

```

```

REDIM Aj(1 TO 11), Bj(1 TO 11)
Aj(1) = 0.1957## : Bj(1) = 1##/0.25##
Aj(2) = 0.1947## : Bj(2) = 1##/0.50##
Aj(3) = 0.1735## : Bj(3) = 1##/1.00##
Aj(4) = 0.1600## : Bj(4) = 1##/4.00##
Aj(5) = 0.0844## : Bj(5) = 1##/4.00##
Aj(6) = 0.0627## : Bj(6) = 1##/6.00##
Aj(7) = 0.0456## : Bj(7) = 1##/8.00##
Aj(8) = 0.0342## : Bj(8) = 1##/10.00##
Aj(9) = 0.0323## : Bj(9) = 1##/12.00##
Aj(10) = 0.0235## : Bj(10) = 1##/14.00##
Aj(11) = 0.0246## : Bj(11) = 1##/16.00##

Z = 0##
x1 = R(p%,1,j&) : x2 = R(p%,2,j&) : x3 = R(p%,3,j&) : x4 = R(p%,4,j&)
FOR jj% = 1 TO 11
    Num = x1*(Bj(jj%)^2+Bj(jj%)*x2)
    Denom = Bj(jj%)^2+Bj(jj%)*x3+x4
    Z = Z + (Aj(jj%)-Num/Denom)^2
NEXT jj%
F15 = -Z
END FUNCTION 'F15
'-----
FUNCTION F17(R(),Nd%,p%,j&) 'F17, (2-D) Branin
'Global maximum = -0.398 @ (-3.142,12.275), (3.142,2.275), (9.425,2.425)
    LOCAL x1, x2, z AS EXT
    x1 = R(p%,1,j&) : x2 = R(p%,2,j&)
    Z = (x2-5.1##*x1^2/(4##*Pi^2)+5##*x1/Pi-6##)^2 + 10##*(1##-1##/(8##*Pi))*COS(x1) + 10##
    F17 = -Z
END FUNCTION 'F17
'-----
FUNCTION F18(R(),Nd%,p%,j&) 'Goldstein-Price 2-D Test Function
'Global maximum = -3 @ (0,-1)
    LOCAL z, x1, x2, t1, t2 AS EXT
    x1 = R(p%,1,j&) : x2 = R(p%,2,j&)
    t1 = 1##*(x1+x2+1##)^2*(19##-14##*x1+3##*x1^2-14##*x2+6##*x1*x2+3##*x2^2)
    t2 = 30##*(2##*x1-3##*x2)^2*(18##-32##*x1+12##*x1^2+48##*x2-36##*x1*x2+27##*x2^2)
    Z = t1*t2
    F18 = -Z
END FUNCTION 'F18()
'-----
FUNCTION F19(R(),Nd%,p%,j&) 'F19 (3-D) Hartman's Family #1
'Global maximum = 3.86 @ (0.114,0.556,0.852)
    LOCAL xi, z, sum, Aj(), Cj(), Pj() AS EXT
    LOCAL i%, jj%, m%
    REDIM Aj(1 TO 4, 1 TO 3), Cj(1 TO 4), Pj(1 TO 4, 1 TO 3)
    Aj(1,1) = 3.0## : Aj(1,2) = 10## : Aj(1,3) = 30## : Cj(1) = 1.0##
    Aj(2,1) = 0.1## : Aj(2,2) = 10## : Aj(2,3) = 35## : Cj(2) = 1.2##
    Aj(3,1) = 3.0## : Aj(3,2) = 10## : Aj(3,3) = 30## : Cj(3) = 3.0##
    Aj(4,1) = 0.1## : Aj(4,2) = 10## : Aj(4,3) = 35## : Cj(4) = 3.2##
    Pj(1,1) = 0.36890## : Pj(1,2) = 0.1170## : Pj(1,3) = 0.2673##
    Pj(2,1) = 0.46990## : Pj(2,2) = 0.4387## : Pj(2,3) = 0.7470##
    Pj(3,1) = 0.10910## : Pj(3,2) = 0.8732## : Pj(3,3) = 0.5547##
    Pj(4,1) = 0.03815## : Pj(4,2) = 0.5743## : Pj(4,3) = 0.8828##
    Z = 0##
    FOR jj% = 1 TO 4
        Sum = 0##
        FOR i% = 1 TO 3
            xi = R(p%,i%,j&)
            Sum = Sum + Aj(jj%,i%)*(xi-Pj(jj%,i%))^2
        NEXT i%
        Z = Z + Cj(jj%)*EXP(-Sum)
    NEXT jj%
    F19 = Z
END FUNCTION 'F19
'-----
FUNCTION F20(R(),Nd%,p%,j&) 'F20 (6-D) Hartman's Family #2
'Global maximum = 3.32 @ (0.201,0.150,0.477,0.275,0.311,0.657)
    LOCAL xi, z, sum, Aj(), Cj(), Pj() AS EXT
    LOCAL i%, jj%, m%
    REDIM Aj(1 TO 4, 1 TO 6), Cj(1 TO 4, 1 TO 6)
    Aj(1,1) = 10.0## : Aj(1,2) = 3.0## : Aj(1,3) = 17.0## : Cj(1) = 1.0##
    Aj(2,1) = 0.05## : Aj(2,2) = 10.0## : Aj(2,3) = 17.0## : Cj(2) = 1.2##
    Aj(3,1) = 3.0## : Aj(3,2) = 3.50## : Aj(3,3) = 1.70## : Cj(3) = 3.0##
    Aj(4,1) = 17.0## : Aj(4,2) = 8.0## : Aj(4,3) = 0.05## : Cj(4) = 3.2##

```

```

Aji(1,4) = 3.5## : Aji(1,5) = 1.7## : Aji(1,6) = 8##
Aji(2,4) = 0.1## : Aji(2,5) = 8## : Aji(2,6) = 14##
Aji(3,4) = 10## : Aji(3,5) = 17## : Aji(3,6) = 8##
Aji(4,4) = 10## : Aji(4,5) = 0.1## : Aji(4,6) = 14##

Pji(1,1) = 0.133120## : Pji(1,2) = 0.1696## : Pji(1,3) = 0.5569##
Pji(2,1) = 0.23290## : Pji(2,2) = 0.4135## : Pji(2,3) = 0.8307##
Pji(3,1) = 0.23480## : Pji(3,2) = 0.1415## : Pji(3,3) = 0.3522##
Pji(4,1) = 0.40470## : Pji(4,2) = 0.8828## : Pji(4,3) = 0.8732##

Pji(1,4) = 0.01240## : Pji(1,5) = 0.8283## : Pji(1,6) = 0.5886##
Pji(2,4) = 0.37360## : Pji(2,5) = 0.1004## : Pji(2,6) = 0.9991##
Pji(3,4) = 0.28830## : Pji(3,5) = 0.3047## : Pji(3,6) = 0.6650##
Pji(4,4) = 0.57430## : Pji(4,5) = 0.1091## : Pji(4,6) = 0.0381##

Z = 0##
FOR jj% = 1 TO 4
  Sum = 0##
  FOR i% = 1 TO 6
    xi = R(p%,i%,j&)
    Sum = Sum + Aji(jj%,i%)*(xi-Pji(jj%,i%))^-2
  NEXT i%
  Z = Z + Cj(jj%)*EXP(-Sum)
NEXT jj%
F20 = Z
END FUNCTION 'F20
'-----
FUNCTION F21(R(),Nd%,p%,j&) 'F21 (4-D) Shekel's Family m=5
'Global maximum = 10
  LOCAL xi, z, sum, Aji(), Cj() AS EXT
  LOCAL i%, jj%, m%
  m% = 5 : REDIM Aji(1 TO m%, 1 TO 4), Cj(1 TO m%)
  Aji(1,1) = 4## : Aji(1,2) = 4## : Aji(1,3) = 4## : Aji(1,4) = 4## : Cj(1) = 0.1##
  Aji(2,1) = 1## : Aji(2,2) = 1## : Aji(2,3) = 1## : Aji(2,4) = 1## : Cj(2) = 0.2##
  Aji(3,1) = 8## : Aji(3,2) = 8## : Aji(3,3) = 8## : Aji(3,4) = 8## : Cj(3) = 0.2##
  Aji(4,1) = 6## : Aji(4,2) = 6## : Aji(4,3) = 6## : Aji(4,4) = 6## : Cj(4) = 0.4##
  Aji(5,1) = 3## : Aji(5,2) = 7## : Aji(5,3) = 3## : Aji(5,4) = 7## : Cj(5) = 0.4##
  Z = 0##
  FOR jj% = 1 TO m% 'NOTE: Index jj% is used to avoid same variable name as j&
    Sum = 0##
    FOR i% = 1 TO 4 'Shekel's family is 4-D only
      xi = R(p%,i%,j&)
      Sum = Sum + (xi-Aji(jj%,i%))^-2
    NEXT i%
    Z = Z + 1#/ (Sum + Cj(jj%))
  NEXT jj%
  F21 = Z
END FUNCTION 'F21
'-----
FUNCTION F22(R(),Nd%,p%,j&) 'F22 (4-D) Shekel's Family m=7
'Global maximum = 10
  LOCAL xi, z, sum, Aji(), Cj() AS EXT
  LOCAL i%, jj%, m%
  m% = 7 : REDIM Aji(1 TO m%, 1 TO 4), Cj(1 TO m%)
  Aji(1,1) = 4## : Aji(1,2) = 4## : Aji(1,3) = 4## : Aji(1,4) = 4## : Cj(1) = 0.1##
  Aji(2,1) = 1## : Aji(2,2) = 1## : Aji(2,3) = 1## : Aji(2,4) = 1## : Cj(2) = 0.2##
  Aji(3,1) = 8## : Aji(3,2) = 8## : Aji(3,3) = 8## : Aji(3,4) = 8## : Cj(3) = 0.2##
  Aji(4,1) = 6## : Aji(4,2) = 6## : Aji(4,3) = 6## : Aji(4,4) = 6## : Cj(4) = 0.4##
  Aji(5,1) = 2## : Aji(5,2) = 7## : Aji(5,3) = 3## : Aji(5,4) = 7## : Cj(5) = 0.4##
  Aji(6,1) = 2## : Aji(6,2) = 9## : Aji(6,3) = 2## : Aji(6,4) = 9## : Cj(6) = 0.6##
  Aji(7,1) = 5## : Aji(7,2) = 5## : Aji(7,3) = 3## : Aji(7,4) = 3## : Cj(7) = 0.3##
  Z = 0##
  FOR jj% = 1 TO m% 'NOTE: Index jj% is used to avoid same variable name as j&
    Sum = 0##
    FOR i% = 1 TO 4 'Shekel's family is 4-D only
      xi = R(p%,i%,j&)
      Sum = Sum + (xi-Aji(jj%,i%))^-2
    NEXT i%
    Z = Z + 1#/ (Sum + Cj(jj%))
  NEXT jj%
  F22 = Z
END FUNCTION 'F22
'-----
FUNCTION F23(R(),Nd%,p%,j&) 'F23 (4-D) Shekel's Family m=10
'Global maximum = 10
  LOCAL xi, z, sum, Aji(), Cj() AS EXT
  LOCAL i%, jj%, m%

```

```

m% = 10 : REDIM Aj(1 TO m%, 1 TO 4), Cj(1 TO m%)

Aj(1,1) = 4## : Aj(1,2) = 4## : Aj(1,3) = 4## : Aj(1,4) = 4## : Cj(1) = 0.1##
Aj(2,1) = 1## : Aj(2,2) = 1## : Aj(2,3) = 1## : Aj(2,4) = 1## : Cj(2) = 0.2##
Aj(3,1) = 8## : Aj(3,2) = 8## : Aj(3,3) = 8## : Aj(3,4) = 8## : Cj(3) = 0.2##
Aj(4,1) = 6## : Aj(4,2) = 6## : Aj(4,3) = 6## : Aj(4,4) = 6## : Cj(4) = 0.4##
Aj(5,1) = 3## : Aj(5,2) = 7## : Aj(5,3) = 3## : Aj(5,4) = 7## : Cj(5) = 0.4##
Aj(6,1) = 2## : Aj(6,2) = 9## : Aj(6,3) = 2## : Aj(6,4) = 9## : Cj(6) = 0.6##
Aj(7,1) = 5## : Aj(7,2) = 5## : Aj(7,3) = 3## : Aj(7,4) = 3## : Cj(7) = 0.3##
Aj(8,1) = 8## : Aj(8,2) = 1## : Aj(8,3) = 8## : Aj(8,4) = 1## : Cj(8) = 0.7##
Aj(9,1) = 6## : Aj(9,2) = 2## : Aj(9,3) = 6## : Aj(9,4) = 2## : Cj(9) = 0.5##
Aj(10,1) = 7## : Aj(10,2) = 3.6## : Aj(10,3) = 7## : Aj(10,4) = 3.6## : Cj(10) = 0.5##

Z = 0##

FOR jj% = 1 TO m% 'NOTE: Index jj% is used to avoid same variable name as j&
    Sum = 0##
    FOR i% = 1 TO 4 'Shekel's family is 4-D only
        Xi = R(p%,i%,j&)
        Sum = Sum + (Xi-Aj(jj%,i%))2
    NEXT i%
    Z = Z + 1##/(Sum + Cj(jj%))
NEXT jj%
F23 = Z

END FUNCTION 'F23

'===== END FUNCTION DEFINITIONS =====

SUB Plot2DbestProbeTrajectories(NumTrajectories%,M(),RC(),Np%,Nd%,LastStep&,FunctionName$)
LOCAL TrajectoryNumber%, ProbeNumber%, StepNumber&, N%, M%, ProcID???
LOCAL MaximumFitness, MinimumFitness AS EXT
LOCAL BestProbeThisStep%()
LOCAL BestFitnessThisStep(), TempFitness() AS EXT
LOCAL Annotation$, xCoord$, yCoord$, GnuPlotEXE$, PlotwithLines$

Annotation$ = ""
PlotwithLines$ = "YES" "'NO"
NumTrajectories% = MIN(Np%,NumTrajectories%)
GnuPlotEXE$ = "wgnuplot.exe"

----- Get Min/Max Fitnesses -----
MaximumFitness = M(1,0) : MinimumFitness = M(1,0) 'Note: M(p%,j&)

FOR StepNumber& = 0 TO LastStep&
    FOR ProbeNumber% = 1 TO Np%
        IF M(ProbeNumber%,StepNumber&) >= MaximumFitness THEN MaximumFitness = M(ProbeNumber%,StepNumber&)
        IF M(ProbeNumber%,StepNumber&) <= MinimumFitness THEN MinimumFitness = M(ProbeNumber%,StepNumber&)
    NEXT ProbeNumber%
NEXT StepNumber%

----- Copy Fitness Array M() into TempFitness to Preserve M() -----
REDIM TempFitness(1 TO Np%, 0 TO LastStep&)
FOR StepNumber& = 0 TO LastStep&
    FOR ProbeNumber% = 1 TO Np%
        TempFitness(ProbeNumber%,StepNumber&) = M(ProbeNumber%,StepNumber&)
    NEXT ProbeNumber%
NEXT StepNumber%

----- LOOP ON TRAJECTORIES -----
FOR TrajectoryNumber% = 1 TO NumTrajectories%
    ----- Get Trajectory Coordinate Data -----
    REDIM BestFitnessThisStep(0 TO LastStep&), BestProbeThisStep%(0 TO LastStep&)
    FOR StepNumber& = 0 TO LastStep&
        BestFitnessThisStep(StepNumber&) = TempFitness(1,StepNumber&)
        FOR ProbeNumber% = 1 TO Np%
            IF TempFitness(ProbeNumber%,StepNumber&) >= BestFitnessThisStep(StepNumber&) THEN
                BestFitnessThisStep(StepNumber&) = TempFitness(ProbeNumber%,StepNumber&)
                BestProbeThisStep%(StepNumber&) = ProbeNumber%
            END IF
        NEXT ProbeNumber%
    NEXT StepNumber&
    ----- Create Plot Data File -----
    N% = FREEFILE
    SELECT CASE TrajectoryNumber%
        CASE 1 : OPEN "t1" FOR OUTPUT AS #N%
        CASE 2 : OPEN "t2" FOR OUTPUT AS #N%
        CASE 3 : OPEN "t3" FOR OUTPUT AS #N%
        CASE 4 : OPEN "t4" FOR OUTPUT AS #N%
        CASE 5 : OPEN "t5" FOR OUTPUT AS #N%
        CASE 6 : OPEN "t6" FOR OUTPUT AS #N%
        CASE 7 : OPEN "t7" FOR OUTPUT AS #N%
        CASE 8 : OPEN "t8" FOR OUTPUT AS #N%
        CASE 9 : OPEN "t9" FOR OUTPUT AS #N%
    END SELECT

```

```

CASE 10 : OPEN "t10" FOR OUTPUT AS #N%
END SELECT

----- Write Plot File Data -----
FOR StepNumber& = 0 TO LastStep&
  PRINT #####.#####,#N%,#N%,#N%,
  USING$("#####.#####")
  TempFitness(BestProbeThisStep%(StepNumber&),1,StepNumber&),R(BestProbeThisStep%(StepNumber&),2,StepNumber&)
  TempFitness(BestProbeThisStep%(StepNumber&),StepNumber&) = MinimumFitness 'so that same max will not be found for next trajectory
NEXT StepNumber%
CLOSE #N%
NEXT TrajectoryNumber%

----- Plot Trajectories -----
CALL CreateGNUPlotINIfile(0.13##*ScreenWidth&,0.18##*ScreenHeight&,0.7##*ScreenHeight&,0.7##*ScreenHeight&)
Annotation$ = ""
N% = FREEFILE
OPEN "cmd2d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set xrange [+"+REMOVE$(STR$(XiMin(1)),ANY"" )+":+"+REMOVE$(STR$(XiMax(1)),ANY" ")+"]
PRINT #N%, "set yrang [+"+REMOVE$(STR$(XiMin(2)),ANY"" )+":+"+REMOVE$(STR$(XiMax(2)),ANY" ")+"]
'PRINT #N%, "set label " + Quote$ + Annotation$ + Quote$ + " at graph " + xCoord$ + ", " + yCoord$
PRINT #N%, "set grid xtics " + "10"
PRINT #N%, "set grid ytics " + "10"
PRINT #N%, "set grid mxtics"
PRINT #N%, "set grid mytics"
PRINT #N%, "show grid"
PRINT #N%, "set title " + Quote$ + "2D " + FunctionName$+" TRAJECTORIES OF PROBES WITH BEST\nFITNESSES (ORDERED BY FITNESS)" + "\n" + RunID$ +
Quote$ PRINT #N%, "set xlabel " + Quote$ + "x1\n" + "n" + "n" + Quote$ + "x2" + Quote$ + "y2"
IF PlotwithLines$ = "YES" THEN
  SELECT CASE NumTrajectories%
    CASE 1 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3"
    CASE 2 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 "
    CASE 3 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 4 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 5 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 6 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 7 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 8 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 9 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
    CASE 10 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" w 1 lw 3,"+Quote$+"t2"+Quote$+" w 1 ,"+Quote$+"t3"+Quote$+" w 1 "
  END SELECT
ELSE
  SELECT CASE NumTrajectories%
    CASE 1 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2"
    CASE 2 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+
    CASE 3 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+
    CASE 4 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 5 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 6 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 7 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 8 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 9 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 10 : PRINT #N%, "plot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
  END SELECT
END IF
CLOSE #N%
ProcID??? = SHELL(GnuPlotEXE$+" cmd2d.gp -") : CALL Delay(1#)

END SUB 'Plot2dbestProbeTrajectories()

-----
SUB Plot2bindividualProbeTrajectories(NumTrajectories%,M(),R(),Np%,Nd%,LastStep&,FunctionName$)
LOCAL ProbeNumber%, StepNumber&, N%, ProcID???
LOCAL Annotation$, xCoord$, yCoord$, GnuPlotEXE$, PlotwithLines$
NumTrajectories% = MIN(Np%,NumTrajectories%)
Annotation$ = ""
PlotwithLines$ = "YES" "'NO"
GnuPlotEXE$ = "wgnuplot.exe"
----- LOOP ON PROBES -----
FOR ProbeNumber% = 1 TO MIN(NumTrajectories%,Np%)
  ----- Create Plot Data File -----
  N% = FREEFILE

```

```

SELECT CASE ProbeNumber%
CASE 1 : OPEN "p1" FOR OUTPUT AS #N%
CASE 2 : OPEN "p2" FOR OUTPUT AS #N%
CASE 3 : OPEN "p3" FOR OUTPUT AS #N%
CASE 4 : OPEN "p4" FOR OUTPUT AS #N%
CASE 5 : OPEN "p5" FOR OUTPUT AS #N%
CASE 6 : OPEN "p6" FOR OUTPUT AS #N%
CASE 7 : OPEN "p7" FOR OUTPUT AS #N%
CASE 8 : OPEN "p8" FOR OUTPUT AS #N%
CASE 9 : OPEN "p9" FOR OUTPUT AS #N%
CASE 10 : OPEN "p10" FOR OUTPUT AS #N%
CASE 11 : OPEN "p11" FOR OUTPUT AS #N%
CASE 12 : OPEN "p12" FOR OUTPUT AS #N%
CASE 13 : OPEN "p13" FOR OUTPUT AS #N%
CASE 14 : OPEN "p14" FOR OUTPUT AS #N%
CASE 15 : OPEN "p15" FOR OUTPUT AS #N%
CASE 16 : OPEN "p16" FOR OUTPUT AS #N%
END SELECT

----- Write Plot File Data -----
FOR StepNumber& = 0 TO LastStep&
    PRINT #N%, USING$("#####.#####.#####.#####",R(ProbeNumber%,1,StepNumber&),R(ProbeNumber%,2,StepNumber&))
NEXT StepNumber%
CLOSE #N%
NEXT ProbeNumber%

----- Plot Trajectories -----
'usage: CALL CreateGNuplotINIfile(PlotwindowULC_X%,PlotwindowULC_Y%,PlotwindowWidth%,PlotwindowHeight%)
CALL CreateGNuplotINIfile(0.17##*ScreenWidth&,0.22##*ScreenHeight&,0.7##*ScreenHeight&,0.7##*ScreenHeight&)

Annotation$ = ""
N% = FREEFILE
OPEN "cmd2d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set xrange [":+REMOVE$(STR$(xiMin(1)),ANY"")+":":+REMOVE$(STR$(xiMax(1)),ANY" "+"]"
PRINT #N%, "set yrang [":+REMOVE$(STR$(xiMin(2)),ANY"")+":":+REMOVE$(STR$(xiMax(2)),ANY" "+"]"

PRINT #N%, "set grid xtics " + "10"
PRINT #N%, "set grid ytics " + "10"
PRINT #N%, "set grid mxtics"
PRINT #N%, "set grid mytics"
PRINT #N%, "show grid"
PRINT #N%, "set title " + Quote$ + "2D " + FunctionName$" INDIVIDUAL PROBE TRAJECTORIES\n(ORDERED BY PROBE #)" + "\n" + RunID$ + Quote$ + "p4"+Quote$ + "w 1," + Quote$ + "p3"+Quote$ + "w 1," + Quote$ + "p2"+Quote$ + "w 1," + Quote$ + "p1"+Quote$ + "w 1," + Quote$ + "p6"+Quote$ + "w 1," + Quote$ + "p5"+Quote$ + "w 1," + Quote$ + "p7"+Quote$ + "w 1," + Quote$ + "p8"+Quote$ + "w 1," + Quote$ + "p9"+Quote$ + "w 1," + Quote$ + "p10"+Quote$ + "w 1," + Quote$ + "p11"+Quote$ + "w 1," + Quote$ + "p12"+Quote$ + "w 1," + Quote$ + "p13"+Quote$ + "w 1," + Quote$ + "p14"+Quote$ + "w 1," + Quote$ + "p15"+Quote$ + "w 1," + Quote$ + "p16"+Quote$ + "w 1,"

IF PlotwithLines$ = "YES" THEN
    SELECT CASE NumTrajectories%
        CASE 1 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1"
        CASE 2 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1"
        CASE 3 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1"
        CASE 4 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1"
        CASE 5 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1"
        CASE 6 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1"
        CASE 7 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1"
        CASE 8 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1"
        CASE 9 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1"
        CASE 10 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1"
        CASE 11 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1," +Quote$+"p11"+Quote$+" w 1"
        CASE 12 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1," +Quote$+"p11"+Quote$+" w 1," +Quote$+"p12"+Quote$+" w 1"
        CASE 13 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1," +Quote$+"p11"+Quote$+" w 1," +Quote$+"p12"+Quote$+" w 1," +Quote$+"p13"+Quote$+" w 1," +Quote$+"p14"+Quote$+" w 1," +Quote$+"p15"+Quote$+" w 1," +Quote$+"p16"+Quote$+" w 1"
        CASE 14 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1," +Quote$+"p11"+Quote$+" w 1," +Quote$+"p12"+Quote$+" w 1," +Quote$+"p13"+Quote$+" w 1," +Quote$+"p14"+Quote$+" w 1," +Quote$+"p15"+Quote$+" w 1," +Quote$+"p16"+Quote$+" w 1"
        CASE 15 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1," +Quote$+"p11"+Quote$+" w 1," +Quote$+"p12"+Quote$+" w 1," +Quote$+"p13"+Quote$+" w 1," +Quote$+"p14"+Quote$+" w 1," +Quote$+"p15"+Quote$+" w 1," +Quote$+"p16"+Quote$+" w 1"
        CASE 16 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" w 1 lw 1," +Quote$+"p2"+Quote$+" w 1," +Quote$+"p3"+Quote$+" w 1," +Quote$+"p4"+Quote$+" w 1," +Quote$+"p5"+Quote$+" w 1," +Quote$+"p6"+Quote$+" w 1," +Quote$+"p7"+Quote$+" w 1," +Quote$+"p8"+Quote$+" w 1," +Quote$+"p9"+Quote$+" w 1," +Quote$+"p10"+Quote$+" w 1," +Quote$+"p11"+Quote$+" w 1," +Quote$+"p12"+Quote$+" w 1," +Quote$+"p13"+Quote$+" w 1," +Quote$+"p14"+Quote$+" w 1," +Quote$+"p15"+Quote$+" w 1," +Quote$+"p16"+Quote$+" w 1"
    END SELECT

    ELSE
        SELECT CASE NumTrajectories%
            CASE 1 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" w 1"
            CASE 2 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" w 1," +Quote$+"p2"+Quote$+
            CASE 3 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" w 1," +Quote$+"p2"+Quote$+" , "+Quote$+"p3"+Quote$+
            CASE 4 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" w 1," +Quote$+"p2"+Quote$+" , "+Quote$+"p3"+Quote$+" , "+Quote$+"p4"+Quote$+
        END SELECT
    END IF

```

```

        CASE 5 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2"+Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4"+Quote$+
        ,"+Quote$+"p5"+Quote$+
        CASE 6 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2"+Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4"+Quote$+
        ,"+Quote$+"p5"+Quote$+" ,"+Quote$+"p6"+Quote$+
        CASE 7 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2"+Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4"+Quote$+
        ,"+Quote$+"p5"+Quote$+" ,"+Quote$+"p6"+Quote$+
        Quotes$+"p7"+Quote$+
        CASE 8 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2"+Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4"+Quote$+
        ,"+Quote$+"p5"+Quote$+" ,"+Quote$+"p6"+Quote$+
        CASE 9 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2"+Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4"+Quote$+
        ,"+Quote$+"p5"+Quote$+" ,"+Quote$+"p6"+Quote$+
        Quotes$+"p7"+Quote$+
        CASE 10 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5"+Quote$+" ,"+Quote$+"p6"+Quote$+
        CASE 11 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5" +Quote$+" ,"+Quote$+"p6"+Quotes$+" ,"+Quotes$+"p7"+Quote$+
        CASE 12 : PRINT #N%, "plot "+Quote$+"p1"+Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5" +Quote$+" ,"+Quote$+"p6"+Quotes$+" ,"+Quotes$+"p7"+Quote$+
        CASE 13 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5" +Quote$+" ,"+Quote$+"p6"+Quotes$+" ,"+Quotes$+"p7"+Quote$+
        CASE 14 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3"+Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5" +Quote$+" ,"+Quote$+"p6"+Quotes$+" ,"+Quotes$+"p7"+Quote$+
        CASE 15 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3" +Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5" +Quote$+" ,"+Quote$+"p6"+Quotes$+" ,"+Quotes$+"p7"+Quote$+
        CASE 16 : PRINT #N%, "plot "+Quote$+"p1" +Quote$+" 1w 1,"+Quote$+"p2" +Quote$+" ,"+Quote$+"p3" +Quote$+" ,"+Quote$+"p4" +Quote$+
        ,"+Quote$+"p5" +Quote$+" ,"+Quote$+"p6"+Quotes$+" ,"+Quotes$+"p7"+Quote$+
        END SELECT
    END IF
    CLOSE #N%
    ProcID??? = SHELL(GnuPlotEXE$+" cmd2d.gp -") : CALL Delay(1#)
END SUB 'Plot2dindividualProbeTrajectories()
'-----
SUB Plot3dbestProbeTrajectories(NumTrajectories%,M(),R(),Np%,Nd%,LastStep&,FunctionName$) 'XYZZY
LOCAL TrajectoryNumber%, ProbeNumber%, StepNumber&, N%, M%, ProcID???
LOCAL MaximumFitness, MinimumFitness AS EXT
LOCAL BestProbeThisStep()
LOCAL BestFitnessThisStep(), Tempfitness() AS EXT
LOCAL Annotation$, xCoord$, yCoord$, zCoord$, GnuPlotEXE$, PlotWithLines$
    Annotation$ = ""
    PlotWithLines$ = "NO" "YES" "NO"
    NumTrajectories% = MIN(Np%, NumTrajectories%)
    GnuPlotEXE$ = "wgnuplot.exe"
' ----- Get Min/Max Fitnesses -----
MaximumFitness = M(1,0) : MinimumFitness = M(1,0) 'Note: M(p%,j&)
FOR StepNumber& = 0 TO LastStep&
    FOR ProbeNumber% = 1 TO Np%
        IF M(ProbeNumber%,StepNumber&) >= MaximumFitness THEN MaximumFitness = M(ProbeNumber%,StepNumber&)
        IF M(ProbeNumber%,StepNumber&) <= MinimumFitness THEN MinimumFitness = M(ProbeNumber%,StepNumber&)
    NEXT ProbeNumber%
NEXT StepNumber%
' ----- Copy Fitness Array M() into TempFitness to Preserve M()
REDIM TempFitness(1 TO Np%, 0 TO LastStep&)
FOR StepNumber& = 0 TO LastStep&
    FOR ProbeNumber% = 1 TO Np%
        TempFitness(ProbeNumber%,StepNumber&) = M(ProbeNumber%,StepNumber&)
    NEXT ProbeNumber%
NEXT StepNumber%
' ----- LOOP ON TRAJECTORIES -----
FOR TrajectoryNumber% = 1 TO NumTrajectories%
    ' ----- Get Trajectory Coordinate Data -----
    REDIM BestFitnessThisStep(0 TO LastStep&), BestProbeThisStep(0 TO LastStep&)
    FOR StepNumber& = 0 TO LastStep&
        BestFitnessThisStep(StepNumber&) = TempFitness(1,StepNumber&)
    FOR ProbeNumber% = 1 TO Np%
        IF TempFitness(ProbeNumber%,StepNumber&) >= BestFitnessThisStep(StepNumber&) THEN

```

```

        BestFitnessThisStep(StepNumber&) = TempFitness(ProbeNumber%,StepNumber&)
        BestProbeThisStep%(StepNumber&) = ProbeNumber%
    END IF
NEXT ProbeNumber%
NEXT StepNumber&
----- Create Plot Data File -----
N% = FREEFILE
SELECT CASE TrajectoryNumber%
CASE 1 : OPEN "t1" FOR OUTPUT AS #N%
CASE 2 : OPEN "t2" FOR OUTPUT AS #N%
CASE 3 : OPEN "t3" FOR OUTPUT AS #N%
CASE 4 : OPEN "t4" FOR OUTPUT AS #N%
CASE 5 : OPEN "t5" FOR OUTPUT AS #N%
CASE 6 : OPEN "t6" FOR OUTPUT AS #N%
CASE 7 : OPEN "t7" FOR OUTPUT AS #N%
CASE 8 : OPEN "t8" FOR OUTPUT AS #N%
CASE 9 : OPEN "t9" FOR OUTPUT AS #N%
CASE 10 : OPEN "t10" FOR OUTPUT AS #N%
END SELECT
----- Write Plot File Data -----
FOR StepNumber& = 0 TO LastStep&
    PRINT #N%, USING$("#####.#####",R(BestProbeThisStep%(StepNumber&),1,StepNumber&),R(BestProbeThisStep%(StepNumber&),2,StepNumber&),R(BestProbeThisStep%(StepNumber&),3,StepNumber&))+CHR$(13))
    TempFitness(BestProbeThisStep%(StepNumber&),StepNumber&) = MinimumFitness 'so that same max will not be found for next trajectory
NEXT StepNumber%
CLOSE #N%
NEXT TrajectoryNumber%
----- Plot Trajectories -----
'CALL CreateGNuplotINIfile(0.1##ScreenWidth&,0.25##*ScreenHeight&,0.6##*ScreenHeight&,0.6##*ScreenHeight&)
Annotation$ = ""
N% = FREEFILE
OPEN "cmd3d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set pm3d"
PRINT #N%, "show pm3d"
PRINT #N%, "set hidden3d"
PRINT #N%, "set view 45, 45, 1, 1"
PRINT #N%, "unset colorbox"
PRINT #N%, "set xrange [ " + REMOVE$(STR$(Ximin(1)),ANY"") + ":" + REMOVE$(STR$(Ximax(1)),ANY"") + "]"
PRINT #N%, "set yrange [ " + REMOVE$(STR$(Ximin(2)),ANY"") + ":" + REMOVE$(STR$(Ximax(2)),ANY"") + "]"
PRINT #N%, "set zrange [ " + REMOVE$(STR$(Ximin(3)),ANY"") + ":" + REMOVE$(STR$(Ximax(3)),ANY"") + "]"
PRINT #N%, "set grid xtics ytics ztics"
PRINT #N%, "show grid"
PRINT #N%, "set title " + Quote$ + "3D " + FunctionName$ + " PROBE TRAJECTORIES" + "\n" + RunID$ + Quote$
PRINT #N%, "set xlabel " + Quote$ + "x1" + Quote$ + "x2" + Quote$ + "x3"
PRINT #N%, "set ylabel " + Quote$ + "x1" + Quote$ + "x2" + Quote$ + "x3"
PRINT #N%, "set zlabel " + Quote$ + "x1" + Quote$ + "x2" + Quote$ + "x3"
IF PlotWithLines$ = "YES" THEN
    SELECT CASE NumTrajectories%
    CASE 1 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3"
    CASE 2 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] "
    CASE 3 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] "
    CASE 4 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] "
    CASE 5 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] ,"+Quote$+"t5"+Quote$+" w ] "
    CASE 6 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] ,"+Quote$+"t5"+Quote$+" w ] ,"+Quote$+"t6"+Quote$+" w ] "
    CASE 7 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] ,"+Quote$+"t5"+Quote$+" w ] ,"+Quote$+"t6"+Quote$+" w ] ,"+Quote$+"t7"+Quote$+" w ] "
    CASE 8 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] ,"+Quote$+"t5"+Quote$+" w ] ,"+Quote$+"t6"+Quote$+" w ] ,"+Quote$+"t7"+Quote$+" w ] ,"+Quote$+"t8"+Quote$+" w ] "
    CASE 9 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] ,"+Quote$+"t5"+Quote$+" w ] ,"+Quote$+"t6"+Quote$+" w ] ,"+Quote$+"t7"+Quote$+" w ] ,"+Quote$+"t8"+Quote$+" w ] ,"+Quote$+"t9"+Quote$+" w ] "
    CASE 10 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" w ] lw 3,"+Quote$+"t2"+Quote$+" w ] ,"+Quote$+"t3"+Quote$+" w ] ,"+Quote$+"t4"+Quote$+" w ] ,"+Quote$+"t5"+Quote$+" w ] ,"+Quote$+"t6"+Quote$+" w ] ,"+Quote$+"t7"+Quote$+" w ] ,"+Quote$+"t8"+Quote$+" w ] ,"+Quote$+"t9"+Quote$+" w ] ,"+Quote$+"t10"+Quote$+" w ] "
    END SELECT
ELSE
    SELECT CASE NumTrajectories%
    CASE 1 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2"
    CASE 2 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+
    CASE 3 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+
    CASE 4 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+
    CASE 5 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+", "+Quote$+"t5"+Quote$+
    CASE 6 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+", "+Quote$+"t5"+Quote$+", "+Quote$+"t6"+Quote$+
    CASE 7 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+", "+Quote$+"t5"+Quote$+", "+Quote$+"t6"+Quote$+", "+Quote$+"t7"+Quote$+
    CASE 8 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+", "+Quote$+"t5"+Quote$+", "+Quote$+"t6"+Quote$+", "+Quote$+"t7"+Quote$+", "+Quote$+"t8"+Quote$+
    CASE 9 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+", "+Quote$+"t5"+Quote$+", "+Quote$+"t6"+Quote$+", "+Quote$+"t7"+Quote$+", "+Quote$+"t8"+Quote$+", "+Quote$+"t9"+Quote$+
    CASE 10 : PRINT #N%, "splot "+Quote$+"t1"+Quote$+" lw 2,"+Quote$+"t2"+Quote$+", "+Quote$+"t3"+Quote$+", "+Quote$+"t4"+Quote$+", "+Quote$+"t5"+Quote$+", "+Quote$+"t6"+Quote$+", "+Quote$+"t7"+Quote$+", "+Quote$+"t8"+Quote$+", "+Quote$+"t9"+Quote$+", "+Quote$+"t10"+Quote$+
    END SELECT
END IF
CLOSE #N%

```

```

ProcID??? = SHELL(GnuPlotEXE$+" cmd3d.gp -") : CALL Delay(1#)
END SUB 'Plot3DbestProbeTrajectories()
'-----
FUNCTION HasDAVGsaturated$(Nsteps&, j&, Np%, Nd%, M(), R(), DiagLength)
LOCAL A$
LOCAL k&
LOCAL SumOfDavg, DavgStepJ AS EXT
LOCAL DavgSatTOL AS EXT
A$ = "NO"
DavgSatTOL = 0.0005## 'tolerance for DAVG saturation
IF j& < Nsteps& + 10 THEN GOTO ExitHasDAVGsaturated 'execute at least 10 steps after averaging interval before performing this check
DavgStepJ = DavgThisStep(j&, Np%, Nd%, M(), R(), DiagLength)
SumOfDavg = 0##
FOR k& = j&-Nsteps&+1 TO j& 'check this step and previous (Nsteps&-1) steps
    SumOfDavg = SumOfDavg + DavgThisStep(k&, Np%, Nd%, M(), R(), DiagLength)
NEXT k&
IF ABS(SumOfDavg/Nsteps&-DavgStepJ) =< DavgSatTOL THEN A$ = "YES" 'saturation if (avg value - last value) are within TOL
ExitHasDAVGsaturated:
    HasDAVGsaturated$ = A$
END FUNCTION 'HasDAVGsaturated()

'-----
FUNCTION OscillationInDavg$(j&, Np%, Nd%, M(), R(), DiagLength)
LOCAL A$
LOCAL k&, NumSlopeChanges%
A$ = "NO"
NumSlopeChanges% = 0
IF j& < 15 THEN GOTO ExitDavgOscillation 'wait at least 15 steps
FOR k& = j&-10 TO j&-1 'check previous ten steps
    IF (DavgThisStep(k&, Np%, Nd%, M(), R(), DiagLength)-DavgThisStep(k&-1, Np%, Nd%, M(), R(), DiagLength)) * (DavgThisStep(k&+1, Np%, Nd%, M(), R(), DiagLength)-DavgThisStep(k&, Np%, Nd%, M(), R(), DiagLength)) < 0## THEN INCR NumSlopeChanges%
NEXT j&
IF NumSlopeChanges% >= 3 THEN A$ = "YES"
ExitDavgOscillation:
    OscillationInDavg$ = A$
END FUNCTION 'OscillationInDavg()

'-----
FUNCTION DavgThisStep(j&, Np%, Nd%, M(), R(), DiagLength)
LOCAL BestFitness, TotalDistanceAllProbes, SumSQ AS EXT
LOCAL p%, k&, N%, i%, BestProbeNumber%, BestTimeStep%
' ----- Best Probe #, etc.
FOR k& = 0 TO j&
    BestFitness = M(1, k&)
    FOR p% = 1 TO Np%
        IF M(p%, k&) >= BestFitness THEN
            BestFitness = M(p%, k&): BestProbeNumber% = p%: BestTimeStep& = k&
        END IF
    NEXT p% 'probe #
    NEXT k& 'time step
' ----- Average Distance to Best Probe -----
TotalDistanceAllProbes = 0##
FOR p% = 1 TO Np%
    SumSQ = 0##
    FOR i% = 1 TO Nd%
        SumSQ = SumSQ + (R(BestProbeNumber%, i%, BestTimeStep&)-R(p%, i%, j&))^2 'do not exclude p%=BestProbeNumber%(j&) from sum because it adds zero
    NEXT i%
    TotalDistanceAllProbes = TotalDistanceAllProbes + SQR(SumSQ)
NEXT p%
DavgThisStep = TotalDistanceAllProbes/(DiagLength*(Np%-1)) 'but exclude best prove from average
END FUNCTION 'DavgThisStep()

'-----
SUB PlotBestFitnessEvolution(Nd%, Np%, LastStep&, G, DeltaT, Alpha, Beta, Freq, Mbest(), PlaceInitialProbes$, InitialAcceleration$, RepositionFactor$, FunctionName$, Gamma)
LOCAL BestFitness(), GlobalBestFitness AS EXT
LOCAL PlotAnnotation$, PlotTitle$
LOCAL p%, j&, N%
REDIM BestFitness(0 TO LastStep&)

```

```

CALL
GetPlotAnnotation(PlotAnnotation$,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,
e$,Gamma)
  GlobalBestFitness = Mbest(1,0)
  FOR j& = 0 TO LastStep&
    BestFitness(j&) = Mbest(1,j&) 'orig code 03-23-2010
    BestFitness(j&) = -1E4200 'added 03-23-2010
    FOR p% = 1 TO Np%
      IF Mbest(p%,j&) >= BestFitness(j&) THEN BestFitness(j&) = Mbest(p%,j&)
      IF Mbest(p%,j&) >= GlobalBestFitness THEN GlobalBestFitness = Mbest(p%,j&)
    NEXT p% 'probe #
  NEXT j& 'time step
  N% = FREEFILE
  OPEN "Fitness" FOR OUTPUT AS #N%
  print #N%,"From Sub PlotBestFitness..."
  FOR j& = 0 TO LastStep&
    PRINT #N%, USING$("##### ##.#####^^^^^",j&,BestFitness(j&))
    PRINT #N%, USING$("##### ######.#####",j&,BestFitness(j&))
  NEXT j&
  CLOSE #N%
  PlotAnnotation$ = PlotAnnotation$ + "Best Fitness = " + REMOVE$(STR$(ROUND(GlobalBestFitness,8)),ANY" ")
  PlotTitle$ = "Best Fitness vs Time Step\n" + "[" + REMOVE$(STR$(Np%),ANY" ") + " probes, " + REMOVE$(STR$(LastStep&),ANY" ")+" time steps]"
  CALL CreateGNUPlotINIfile(0.1##*ScreenWidth&,0.1##*ScreenHeight&,0.6##*ScreenWidth&,0.6##*ScreenHeight&)
  CALL TwoDplot("fitness","Best Fitness","0.7","0.7","Time Step\n",".\n\nBest Fitness(X)",_
  "","","","","","wgnuplot.exe"," with lines linewidth 2",PlotAnnotation$)
END SUB 'PlotBestFitnessEvolution()
'-----
SUB
PlotAverageDistance(Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,R(),DiagLen
gth,Gamma)
  LOCAL Davg(), BestFitness(), TotalDistanceAllProbes, SumSQ AS EXT
  LOCAL PlotAnnotation$, PlotTitle$
  LOCAL p%, j&, N%, i%, BestProbeNumber(), BestTimeStep()
  REDIM Davg(0 TO LastStep&), BestFitness(0 TO LastStep&), BestProbeNumber%(0 TO LastStep&), BestTimeStep(0 TO LastStep&)
  CALL
GetPlotAnnotation(PlotAnnotation$,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,
e$,Gamma)
  ' ----- Best Probe #, etc. -----
  FOR j& = 0 TO LastStep&
    BestFitness(j&) = Mbest(1,j&)
    FOR p% = 1 TO Np%
      IF Mbest(p%,j&) >= BestFitness(j&) THEN
        BestFitness(j&) = Mbest(p%,j&): BestProbeNumber%(j&) = p%: BestTimeStep(j&) = j& 'only probe number is used at this time, but other data
are computed for possible future use.
      END IF
    NEXT p% 'probe #
  NEXT j& 'time step
  N% = FREEFILE
  ' ----- Average Distance to Best Probe -----
  FOR j& = 0 TO LastStep&
    TotalDistanceAllProbes = 0##
    FOR p% = 1 TO Np%
      SumSQ = 0##
      FOR i% = 1 TO Nd%
        SumSQ = SumSQ + (R(BestProbeNumber%(j&),i%,j&)-R(p%,i%,j&))^2 'do not exclude p%=BestProbeNumber%(j&) from sum because it adds zero
      NEXT i%
      TotalDistanceAllProbes = TotalDistanceAllProbes + SQR(SumSQ)
    NEXT p%
    Davg(j&) = TotalDistanceAllProbes/(DiagLength*(Np%-1)) 'but exclude best prove from average
  NEXT j&
  ' ----- Create Plot Data File -----
  OPEN "Davg" FOR OUTPUT AS #N%
  FOR j& = 0 TO LastStep&
    PRINT #N%, USING$("##### ######.#####",j&,Davg(j&))
  NEXT j&
  CLOSE #N%
  PlotTitle$ = "Average Distance of " + REMOVE$(STR$(Np%-1),ANY" ") + " Probes to Best Probe\nNormalized to size of Decision Space\n" + _
  "[" + REMOVE$(STR$(Np%),ANY" ") + " probes, " + REMOVE$(STR$(LastStep&),ANY" ") + " time steps]"
  CALL CreateGNUPlotINIfile(0.2##*ScreenWidth&,0.2##*ScreenHeight&,0.6##*ScreenWidth&,0.6##*ScreenHeight&)

```

```

CALL TwoDplot("davg",PlotTitle$,"0.7","0.9","Time Step\n\n.", ".\n\n<0>/Ldiag",
              "", "", "", "", "", "wgnuplot.exe", " with lines linewidth 2",PlotAnnotation$)
END SUB 'PlotAverageDistance()
'-----
SUB GetPlotAnnotation(PlotAnnotation$,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,
e$,Gamma)
LOCAL A$  

A$ = "" : IF PlaceInitialProbes$ = "UNIFORM ON-AXIS" AND Nd% > 1 THEN A$ = "("+REMOVE$(STR$(Np%/Nd%),ANY" ") + "/axis)"  

PlotAnnotation$ = RunID$ + "\n" + FunctionName$ + " Function" + "("+ FormatInteger$(Nd%) + "-D) \n" +_
FormatInteger$(Np%) + " probes" + A$ + "\n" +_
"G" + FormatFP$(G,2) + "\n" +_
"Alpha = " + FormatFP$(Alpha,1) + "\n" +_
"Beta = " + FormatFP$(Beta,1) + "\n" +_
"Delta = " + FormatFP$(DeltaT,1) + "\n" +_
"Gamma = " + FormatFP$(Gamma,3) + "\n" +_
"Init Probes " + PlaceInitialProbes$ + "\n" +_
"Init Accel " + InitialAcceleration$ + "\n" +_
"Frep " + RepositionFactor$ + "\n"  

END SUB  

'-----  

SUB PlotBestProbeVsTimestep(Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)
LOCAL BestFitness AS EXT
LOCAL PlotAnnotation$, PlotTitle$  

LOCAL p%, j&, N%, BestProbeNumber%()  

REDIM BestProbeNumber%(0 TO LastStep&)  

CALL GetPlotAnnotation(PlotAnnotation$,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Frep,Mbest(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,
e$,Gamma)
FOR j& = 0 TO LastStep&
    BestFitness = Mbest(1,j&)
    FOR p% = 1 TO Np%
        IF Mbest(p%,j&) >= BestFitness THEN
            BestFitness = Mbest(p%,j&) : BestProbeNumber%(j&) = p%
        END IF
    NEXT p% 'probe #
    NEXT j& 'time step
    N% = FREEFILE
    OPEN "Best Probe" FOR OUTPUT AS #N%
    FOR j& = 0 TO LastStep&
        PRINT #N%, USING$("##### #####",j&,BestProbeNumber%(j&))
    NEXT j&
    CLOSE #N%
    PlotTitle$ = "Best Probe Number vs Time Step\n" + "[" + REMOVE$(STR$(Np%),ANY" ") + " probes, " + REMOVE$(STR$(LastStep&),ANY" ") + " time steps]"
    CALL CreateGNUPlotINIfile(0.15##ScreenWidth&,0.15##ScreenHeight&,0.6##ScreenWidth&,0.6##ScreenHeight&)
    'USAGE: TwoDplot("Best Probe",PlotTitle$,xCoord$,yCoord$,xAxisLabel$,yAxisLabel$,LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$,LineType$,Annotation$)          CALL
    TwoDplot("Best Probe",PlotTitle$,"0.7","0.7","Time Step\n\n.", ".\n\nBest Probe #","",","",","",",0",NoSpaces$(Np%+1,0),"","",",wgnuplot.exe", " pt 8
    ps .5 lw 1",PlotAnnotation$) 'pt, pointtype; ps, pointsize; lw, linewidth
END SUB 'PlotBestProbeVsTimestep()
'-----  

FUNCTION FormatInteger$(M%) : FormatInteger$ = REMOVE$(STR$(M%),ANY" ") : END FUNCTION
'-----  

FUNCTION FormatFP$(X,Ndigits%)  

LOCAL A$  

IF X = 0## THEN
    A$ = "0." : GOTO ExitFormatFP
END IF
AS = REMOVE$(STR$(ROUND(ABS(X),Ndigits%)),ANY" ")
IF ABS(X) < 1## THEN
    IF X > 0## THEN
        A$ = "0" + A$
    ELSE
        A$ = "-0" + A$
    END IF
ELSE
    IF X < 0## THEN A$ = "-" + A$
    END IF
ExitFormatFP:
    FormatFP$ = A$  

END FUNCTION

```

```

'-----
SUB InitialProbeDistribution(Np%,Nd%,Nt&,R(),PlaceInitialProbes$,Gamma)
LOCAL Deltaxi, Delx1, Delx2, Di AS EXT
LOCAL NumProbesPerDimension%, p%, i%, k%, NumX1points%, NumX2points%, x1pointNum%, x2pointNum%, A$ 
SELECT CASE PlaceInitialProbes$
CASE "UNIFORM ON-AXIS"
    IF Nd% > 1 THEN
        NumProbesPerDimension% = Np% \ Nd% 'even #
    ELSE
        NumProbesPerDimension% = Np%
    END IF
    FOR i% = 1 TO Nd%
        FOR p% = 1 TO Np%
            R(p%,i%,0) = XiMin(i%) + Gamma*(XiMax(i%)-XiMin(i%))
        NEXT Np%
    NEXT i%
    FOR i% = 1 TO Nd% 'place probes probe line-by-probe line (i% is dimension number)
        DeltaXi = (XiMax(i%)-XiMin(i%))/(NumProbesPerDimension%-1)
        FOR k% = 1 TO NumProbesPerDimension%
            p% = k% + NumProbesPerDimension%*(i%-1) 'probe #
            R(p%,i%,0) = XiMin(i%) + (k%-1)*DeltaXi
        NEXT k%
    NEXT i%
CASE "UNIFORM ON-DIAGONAL"
    FOR p% = 1 TO Np%
        FOR i% = 1 TO Nd%
            DeltaXi = (XiMax(i%)-XiMin(i%))/(Np%-1)
            R(p%,i%,0) = XiMin(i%) + (p%-1)*DeltaXi
        NEXT i%
    NEXT p%
CASE "2D GRID"
    NumProbesPerDimension% = SQR(Np%) : NumX1points% = NumProbesPerDimension% : NumX2points% = NumX1points% 'broken down for possible future use
    Delx1 = (XiMax(1)-XiMin(1))/(NumX1points%-1)
    Delx2 = (XiMax(2)-XiMin(2))/(NumX2points%-1)
    FOR x1pointNum% = 1 TO NumX1points%
        FOR x2pointNum% = 1 TO NumX2points%
            p% = NumX1points%*(x1pointNum%-1)+x2pointNum% 'probe #
            R(p%,1,0) = XiMin(1) + Delx1*(x1pointNum%-1) 'x1 coord
            R(p%,2,0) = XiMin(2) + Delx2*(x2pointNum%-1) 'x2 coord
        NEXT x2pointNum%
    NEXT x1pointNum%
CASE "RANDOM"
    FOR p% = 1 TO Np%
        FOR i% = 1 TO Nd%
            R(p%,i%,0) = XiMin(i%) + RandomNum(0##,1##)*(XiMax(i%)-XiMin(i%))
        NEXT i%
    NEXT p%
END SELECT
END SUB 'InitialProbeDistribution()
'-----

SUB ChangeRunParameters(NumProbesPerDimension%,Np%,Nd%,Nt&,G,Alpha,Beta,DeltaT,Freq,PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$)
'THIS PROCEDURE NOT USED
LOCAL A$, Defaultvalue$ 
A$ = INPUTBOX$("# dimensions?","Change # Dimensions (" + FunctionName$ + ")",NoSpaces$(Nd%+0,0)) : Nd% = VAL(A$) : IF Nd% < 1 OR Nd% > 500 THEN Nd% = 2
IF Nd% > 1 THEN NumProbesPerDimension% = 2*((NumProbesPerDimension%+1)\2) 'require an even # probes on each probe line to avoid overlapping at origin
(in symmetrical spaces at least...)
IF Nd% = 1 THEN NumProbesPerDimension% = MAX(NumProbesPerDimension%,3) 'at least 3 probes on x-axis for 1-D functions
Np% = NumProbesPerDimension%*Nd%
A$ = INPUTBOX$("# time steps?","Change # Steps (" + FunctionName$ + ")",NoSpaces$(Nt&+0,0)) : Nt& = VAL(A$) : IF Nt& < 3 THEN Nt& = 50
A$ = INPUTBOX$("Grav Const G?","Change G (" + FunctionName$ + ")",NoSpaces$(G,2)) : G = VAL(A$) : IF G < -100## OR G > 100## THEN G = 2##
A$ = INPUTBOX$("Alpha?","Change Alpha (" + FunctionName$ + ")",NoSpaces$(Alpha,2)) : Alpha = VAL(A$) : IF Alpha < -50## OR Alpha > 50## THEN Alpha = 2##
A$ = INPUTBOX$("Beta?","Change Beta (" + FunctionName$ + ")",NoSpaces$(Beta,2)) : Beta = VAL(A$) : IF Beta < -50## OR Beta > 50## THEN Beta = 2##
A$ = INPUTBOX$("Delta T?","Change Delta-T (" + FunctionName$ + ")",NoSpaces$(DeltaT,2)) : DeltaT = VAL(A$) : IF DeltaT == 0## THEN DeltaT = 1#

```

```

A$ = INPUTBOX$("Freq [0-1]?", "Change Freq (" + FunctionName$ + ")", NoSpaces$(Freq, 3))      : Freq = VAL(A$) : IF Freq < 0## OR Freq > 1## THEN Freq
= 0.5##

' ----- Initial Probe Distribution -----
SELECT CASE PlaceInitialProbes$
CASE "UNIFORM ON-AXIS" : DefaultValue$ = "1"
CASE "UNIFORM ON-DIAGONAL" : DefaultValue$ = "2"
CASE "2D GRID" : DefaultValue$ = "3"
CASE "RANDOM" : DefaultValue$ = "4"
END SELECT

A$ = INPUTBOX$("Initial Probes?" + CHR$(13) + "1 - UNIFORM ON-AXIS" + CHR$(13) + "2 - UNIFORM ON-DIAGONAL" + CHR$(13) + "3 - 2D GRID" + CHR$(13) + "4 - RANDOM", "Initial Probe Distribution (" + FunctionName$ + ")", DefaultValue$)

IF VAL(A$) < 1 OR VAL(A$) > 4 THEN A$ = "1"

SELECT CASE VAL(A$)
CASE 1 : PlaceInitialProbes$ = "UNIFORM ON-AXIS"
CASE 2 : PlaceInitialProbes$ = "UNIFORM ON-DIAGONAL"
CASE 3 : PlaceInitialProbes$ = "2D GRID"
CASE 4 : PlaceInitialProbes$ = "RANDOM"
END SELECT

IF Nd% = 1 AND PlaceInitialProbes$ = "UNIFORM ON-DIAGONAL" THEN PlaceInitialProbes$ = "UNIFORM ON-AXIS" 'cannot do diagonal in 1-D space
IF Nd% <> 2 AND PlaceInitialProbes$ = "2D GRID" THEN PlaceInitialProbes$ = "UNIFORM ON-AXIS" '2D grid is available only in 2 dimensions!
' ----- Initial Acceleration -----
SELECT CASE InitialAcceleration$
CASE "ZERO" : DefaultValue$ = "1"
CASE "FIXED" : DefaultValue$ = "2"
CASE "RANDOM" : DefaultValue$ = "3"
END SELECT

A$ = INPUTBOX$("Initial Acceleration?" + CHR$(13) + "1 - ZERO" + CHR$(13) + "2 - FIXED" + CHR$(13) + "3 - RANDOM", "Initial Acceleration (" + FunctionName$ + ")", DefaultValue$)

IF VAL(A$) < 1 OR VAL(A$) > 3 THEN A$ = "1"

SELECT CASE VAL(A$)
CASE 1 : InitialAcceleration$ = "ZERO"
CASE 2 : InitialAcceleration$ = "FIXED"
CASE 3 : InitialAcceleration$ = "RANDOM"
END SELECT

' ----- Reposition Factor -----
SELECT CASE RepositionFactor$
CASE "FIXED" : DefaultValue$ = "1"
CASE "VARIABLE" : DefaultValue$ = "2"
CASE "RANDOM" : DefaultValue$ = "3"
END SELECT

A$ = INPUTBOX$("Reposition Factor?" + CHR$(13) + "1 - FIXED" + CHR$(13) + "2 - VARIABLE" + CHR$(13) + "3 - RANDOM", "Retrieve Probes (" + FunctionName$ + ")", DefaultValue$)

IF VAL(A$) < 1 OR VAL(A$) > 3 THEN A$ = "1"

SELECT CASE VAL(A$)
CASE 1 : RepositionFactor$ = "FIXED"
CASE 2 : RepositionFactor$ = "VARIABLE"
CASE 3 : RepositionFactor$ = "RANDOM"
END SELECT

END SUB 'ChangeRunParameters()

'-----
FUNCTION NoSpaces$(X, NumDigits%) : NoSpaces$ = REMOVE$(STR$(X, NumDigits%), ANY" ") : END FUNCTION
'-----

FUNCTION TerminateNowForSaturation$(j&, Nd%, Np%, Nt&, G, DeltaT, Alpha, Beta, R(), A(), M())
LOCAL A$, i&, p%, NumStepsForAveraging&

LOCAL BestFitness, AvgFitness, FitnessTOL AS EXT 'terminate if avg fitness does not change over NumStepsForAveraging& time steps
FitnessTOL = 0.00001## : NumStepsForAveraging& = 10
A$ = "NO"
IF j& >= NumStepsForAveraging+10 THEN 'wait until step 10 to start checking for fitness saturation
    AvgFitness = 0#
    FOR i& = j&-NumStepsForAveraging&+1 TO j& 'avg fitness over current step & previous NumStepsForAveraging&-1 steps
        BestFitness = M(1, i&)
        FOR p% = 1 TO Np%
            IF M(p%, i&) >= BestFitness THEN BestFitness = M(p%, i&)
        NEXT p%
        AvgFitness = AvgFitness + BestFitness
    NEXT i&
    AvgFitness = AvgFitness/NumStepsForAveraging&
    IF ABS(AvgFitness-BestFitness) < FitnessTOL THEN A$ = "YES" 'compare avg fitness to best fitness at this step
END IF
TerminateNowForSaturation$ = A$

END FUNCTION 'TerminateNowForSaturation$()

'-----
FUNCTION MagVector(V(), N%) 'returns magnitude of Nx1 column vector V
LOCAL SumSq AS EXT
LOCAL i%
SumSq = 0## : FOR i% = 1 TO N% : SumSq = SumSq + V(i%)^2 : NEXT i% : MagVector = SQR(SumSq)
END FUNCTION 'MagVector()
'---

FUNCTION UnitStep(X)

```

```

LOCAL Z AS EXT
IF X < 0## THEN
    Z = 0##
ELSE
    Z = 1##
END IF
UnitStep = Z
END FUNCTION 'unitStep()
'---

SUB Plot1Dfunction(FunctionName$,R())
    'plots 1D function on-screen
LOCAL NumPoints%, i%, N%
LOCAL DeltaX, X AS EXT
NumPoints% = 32001
DeltaX = (XiMax(1)-XiMin(1))/(NumPoints%-1)
N% = FREEFILE
SELECT CASE FunctionName$
CASE "ParrottF4" 'PARROTT F4 FUNCTION
    OPEN "ParrottF4" FOR OUTPUT AS #N%
    FOR i% = 1 TO NumPoints%
        R(1,1,0) = XiMin(1) + (i%-1)*DeltaX
        PRINT #N%, USING$("#.##### #.##### #####.##### #######^##",R(1,1,0),ParrottF4(R(),1,1,0))
    NEXT i%
    CLOSE #N%
    CALL CreateGNuplotINIfile(0.2##*ScreenWidth&,0.2##*ScreenHeight&,0.6##*ScreenWidth&,0.6##*ScreenHeight&)
    CALL TwoDplot("ParrottF4","Parrott F4 Function","0.7","0.7","X\nn.", ".\n\nParrott F4(X)", "", "", "0", "1", "0", "1", "", "", "wgnuplot.exe", " with
lines linewidth 2","")
    END SELECT
END SUB
'-----
SUB CLEANUP 'probe coordinate plot files
IF DIR$( "P1") <> "" THEN KILL "P1"
IF DIR$( "P2") <> "" THEN KILL "P2"
IF DIR$( "P3") <> "" THEN KILL "P3"
IF DIR$( "P4") <> "" THEN KILL "P4"
IF DIR$( "P5") <> "" THEN KILL "P5"
IF DIR$( "P6") <> "" THEN KILL "P6"
IF DIR$( "P7") <> "" THEN KILL "P7"
IF DIR$( "P8") <> "" THEN KILL "P8"
IF DIR$( "P9") <> "" THEN KILL "P9"
IF DIR$( "P10") <> "" THEN KILL "P10"
IF DIR$( "P11") <> "" THEN KILL "P11"
IF DIR$( "P12") <> "" THEN KILL "P12"
IF DIR$( "P13") <> "" THEN KILL "P13"
IF DIR$( "P14") <> "" THEN KILL "P14"
IF DIR$( "P15") <> "" THEN KILL "P15"
END SUB
'-----
SUB Plot2Dfunction(FunctionName$,R())
LOCAL A$
LOCAL NumPoints%, i%, k%, N%
LOCAL Delx1, Delx2, Z AS EXT
SELECT CASE FunctionName$
CASE "BOWTIE" : Numpoints% = 5
CASE "YAGI" : Numpoints% = 5
CASE "PBM_1","PBM_2","PBM_3","PBM_4","PBM_5" : NumPoints% = 25
CASE ELSE : NumPoints% = 100
END SELECT
N% = FREEFILE : OPEN "TwoDplot.DAT" FOR OUTPUT AS #N%
Delx1 = (XiMax(1)-XiMin(1))/(NumPoints%-1) : Delx2 = (XiMax(2)-XiMin(2))/(NumPoints%-1)
FOR i% = 1 TO NumPoints%
    R(1,1,0) = XiMin(1) + (i%-1)*Delx1 'x1 value
    FOR k% = 1 TO NumPoints%
        R(1,2,0) = XiMin(2) + (k%-1)*Delx2 'x2 value
        Z = ObjectiveFunction(R(),2,1,0,FunctionName$)
        PRINT #N%, USING$("#.#####.##### #####.##### #####.##### #######^##",R(1,1,0),R(1,2,0),Z)
    NEXT k%
    PRINT #N%, ""
NEXT i%
CLOSE #N%
CALL CreateGNuplotINIfile(0.1##*ScreenWidth&,0.1##*ScreenHeight&,0.6##*ScreenWidth&,0.6##*ScreenHeight&)
A$ = "" : IF INSTR(FunctionName$,"PBM_") > 0 THEN A$ = "Coarse"
CALL ThreeDplot("TwoDplot.DAT",A$+"Plot of "+FunctionName$+" Function", "", "0.6", "0.6", "1.2", _ "x1", "x2", "z=F(x1,x2)", "", "", "wgnuplot.exe", "", "", "", "")

```

```

END SUB
'-----
SUB TwoDplot3curves(NumCurves%,PlotFileName1$,PlotFileName2$,PlotFileName3$,PlotTitle$,Annotation$,xCoord$,yCoord$,xaxisLabel$,yaxisLabel$, _
LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$)
LOCAL N%
LOCAL LineSize$
LineSize$ = "2"
N% = FREEFILE
OPEN "cmd2d.gp" FOR OUTPUT AS #N%
IF LogXaxis$ = "YES" AND LogYaxis$ = "NO" THEN PRINT #N%, "set logscale x"
IF LogXaxis$ = "NO" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale y"
IF LogXaxis$ = "YES" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale xy"
IF xMin$ < "" AND xMax$ < "" THEN PRINT #N%, "set xrange [+" + xMin$ + ":" + xMax$ + "]"
IF yMin$ < "" AND yMax$ < "" THEN PRINT #N%, "set yrange [+" + yMin$ + ":" + yMax$ + "]"
PRINT #N%, "set label "+Quote$+Annotation$+Quote$+" at graph "+xCoord$+", "+yCoord$
PRINT #N%, "set grid xtics"
PRINT #N%, "set grid ytics"
PRINT #N%, "set xtics "+xTics$
PRINT #N%, "set ytics "+yTics$
PRINT #N%, "set grid mxtics"
PRINT #N%, "set grid mytics"
PRINT #N%, "set title "+Quote$+PlotTitle$+Quote$+
PRINT #N%, "set xlabel "+Quote$+xaxisLabel$+Quote$+
PRINT #N%, "set ylabel "+Quote$+yaxisLabel$+Quote$+
SELECT CASE NumCurves%
CASE 1
PRINT #N%, "plot " + Quote$ + PlotFileName1$ + Quote$ + " with lines linewidth " + LineSize$
CASE 2
PRINT #N%, "plot " + Quote$ + PlotFileName1$ + Quote$ + " with lines linewidth " + LineSize$+",
" + -" + Quote$ + PlotFileName2$ + Quote$ + " with lines linewidth " + LineSize$+
CASE 3
PRINT #N%, "plot " + Quote$ + PlotFileName1$ + Quote$ + " with lines linewidth " + LineSize$+",
" + -" + Quote$ + PlotFileName2$ + Quote$ + " with lines linewidth " + LineSize$+",
" + -" + Quote$ + PlotFileName3$ + Quote$ + " with lines linewidth " + LineSize$+
END SELECT
CLOSE #N%
SHELL(GnuPlotEXE$+" cmd2d.gp -")
CALL Delay(1##)
END SUB 'TwoDplot3Curves()
'---

FUNCTION Fibonacci&&(N%) 'RETURNS Nth FIBONACCI NUMBER
LOCAL i%, Fn&&, Fn1&&, Fn2&&
LOCAL A$%
IF N% > 91 OR N% < 0 THEN
MSGBOX("ERROR! Fibonacci argument"+STR$(N%)+" > 91. out of range or < 0...") : EXIT FUNCTION
END IF
SELECT CASE N%
CASE 0: Fn&& = 1
CASE ELSE
Fn&& = 0 : Fn2&& = 1 : i% = 0
FOR i% = 1 TO N%
Fn&& = Fn1&& + Fn2&&
Fn1&& = Fn2&&
Fn2&& = Fn&&
NEXT i% 'LOOP
END SELECT
Fibonacci&& = Fn&&
END FUNCTION 'Fibonacci&&()
'-----

FUNCTION RandomNum(a,b) 'Returns random number X, a=< X < b.
RandomNum = a + (b-a)*RND
END FUNCTION 'RandomNum()
'-----

FUNCTION GaussianDeviate(Mu,Sigma) 'returns NORMAL (Gaussian) random deviate with mean Mu and standard deviation Sigma (variance = Sigma^2)
'Refs: (1) Press, W.H., Flannery, B.P., Teukolsky, S.A., and Vetterling, W.T., "Numerical Recipes: The Art of Scientific Computing," §7.2, Cambridge University Press, Cambridge, UK, 1986.
' (2) Shinzato, T., "Box Muller Method," 2007, http://www.sp.dis.titech.ac.jp/~shinzato/boxmuller.pdf
LOCAL s, t, Z AS EXT
s = RND : t = RND
Z = Mu + Sigma*SQR(-2##*LOG(s))*COS(TwoPi*t)
GaussianDeviate = Z
END FUNCTION 'GaussianDeviate()
'-----
SUB ContourPlot(PlotFileName$,PlotTitle$,Annotation$,xCoord$,yCoord$,zCoord$,
xaxisLabel$,yaxisLabel$,zaxisLabel$,zMin$,zMax$,GnuPlotEXE$,A$)
LOCAL N%

```

```

N% = FREEFILE
OPEN "cmd3d.gp" FOR OUTPUT AS #N%
PRINT #N%, "show surface"
PRINT #N%, "set hidden3d"
IF zMin$ < "" AND zMax$ > "" THEN PRINT #N%, "set xrange [+"zMin$+":+"zMax$+"]"
PRINT #N%, "set label "+Quote$+Annotation$+Quote$" at graph "+xCoord$+", "+yCoord$+", "+zCoord$
PRINT #N%, "show label"
PRINT #N%, "set grid xtics ytics ztics"
PRINT #N%, "set title "+Quote$+PlotTitle$+Quote$+
PRINT #N%, "set xlabel "+Quote$+xAxisLabel$+Quote$+
PRINT #N%, "set ylabel "+Quote$+yAxisLabel$+Quote$+
PRINT #N%, "set zlabel "+Quote$+zAxisLabel$+Quote$+
PRINT #N%, "splot "+Quote$+PlotFileName$+Quote$+A$" " notitle with linespoints" 'A$'" notitle with lines"
CLOSE #N%
SHELL(GnuPlotEXE$+" cmd3d.gp -")
END SUB 'ContourPlot()
'---

SUB ThreeDplot(PlotFileName$,PlotTitle$,Annotation$,xCoord$,yCoord$,zCoord$,
               XaxisLabel$,YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,A$)
LOCAL N%, ProcessID???
N% = FREEFILE
OPEN "cmd3d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set pm3d"
PRINT #N%, "show pm3d"
IF zMin$ < "" AND zMax$ > "" THEN PRINT #N%, "set xrange [+"zMin$+":+"zMax$+"]"
PRINT #N%, "set label "+Quote$+Annotation$+Quote$" at graph "+xCoord$+", "+yCoord$+", "+zCoord$
PRINT #N%, "show label"
PRINT #N%, "set grid xtics ytics ztics"
PRINT #N%, "set title "+Quote$+PlotTitle$+Quote$+
PRINT #N%, "set xlabel "+Quote$+xAxisLabel$+Quote$+
PRINT #N%, "set ylabel "+Quote$+yAxisLabel$+Quote$+
PRINT #N%, "set zlabel "+Quote$+zAxisLabel$+Quote$+
PRINT #N%, "splot "+Quote$+PlotFileName$+Quote$+A$+" notitle" with lines"
CLOSE #N%
SHELL(GnuPlotEXE$+" cmd3d.gp -") : CALL Delay(1#)
END SUB 'ThreeDplot()
'---

SUB ThreeDplot2(PlotFileName$,PlotTitle$,Annotation$,xCoord$,yCoord$,zCoord$,
                XaxisLabel$,YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,A$,xStart$,xStop$,yStart$,yStop$)
LOCAL N%
N% = FREEFILE
OPEN "cmd3d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set pm3d"
PRINT #N%, "show pm3d"
PRINT #N%, "set hidden3d"
PRINT #N%, "set view 45, 45, 1, 1"
IF zMin$ < "" AND zMax$ > "" THEN PRINT #N%, "set xrange [+"zMin$+":+"zMax$+"]"
PRINT #N%, "set xrange [+"xStart$ + ":" + xStop$ + "]"
PRINT #N%, "set yrange [+"yStart$ + ":" + yStop$ + "]"
PRINT #N%, "set label " + Quote$ + Annotation$ + Quote$" at graph "+xCoord$+", "+yCoord$+", "+zCoord$
PRINT #N%, "show label"
PRINT #N%, "set grid xtics ytics ztics"
PRINT #N%, "set title " + Quote$+PlotTitle$ + Quote$+
PRINT #N%, "set xlabel "+Quote$+xAxisLabel$ + Quote$+
PRINT #N%, "set ylabel "+Quote$+yAxisLabel$ + Quote$+
PRINT #N%, "set zlabel "+Quote$+zAxisLabel$ + Quote$+
PRINT #N%, "splot " + Quote$+PlotFileName$ + Quote$ + A$ + " notitle with lines"
CLOSE #N%
SHELL(GnuPlotEXE$+" cmd3d.gp -")
END SUB 'ThreeDplot2()
'---

SUB TwoDplot2Curves(PlotFileName1$,PlotFileName2$,PlotTitle$,Annotation$,xCoord$,yCoord$,xAxisLabel$,yAxisLabel$,
                     LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$,LineSize)
LOCAL N%, ProcessID???
N% = FREEFILE
OPEN "cmd2d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set output "+Quote$+"test.plt"+Quote$" tried this 3/11/06, didn't work...
IF LogXaxis$ = "YES" AND LogYaxis$ = "NO" THEN PRINT #N%, "set logscale x"
IF LogXaxis$ = "NO" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale y"
IF LogXaxis$ = "YES" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale xy"
IF xMin$ < "" AND xMax$ > "" THEN PRINT #N%, "set xrange [+"xMin$+":+"xMax$+"]"
IF yMin$ < "" AND yMax$ > "" THEN PRINT #N%, "set yrange [+"yMin$+":+"yMax$+"]"
PRINT #N%, "set label "+Quote$+Annotation$+Quote$" at graph "+xCoord$+", "+yCoord$+
PRINT #N%, "set grid xtics"
PRINT #N%, "set grid ytics"
PRINT #N%, "set xtics "+xTics$
PRINT #N%, "set ytics "+yTics$
PRINT #N%, "set grid minor"
PRINT #N%, "set grid mytics"
PRINT #N%, "set title "+Quote$+PlotTitle$+Quote$+
PRINT #N%, "set xlabel "+Quote$+xAxisLabel$+Quote$+
PRINT #N%, "set ylabel "+Quote$+yAxisLabel$+Quote$+
PRINT #N%, "plot "+Quote$+PlotFileName1$+Quote$+" with lines linewidth "+REMOVE$(STR$(LineSize),ANY" ")+" - "
PRINT #N%, "plot "+Quote$+PlotFileName2$+Quote$+" with points pointsize 0.05"+REMOVE$(STR$(LineSize),ANY" ")-
CLOSE #N%
ProcessID??? = SHELL(GnuPlotEXE$+" cmd2d.gp -") : CALL Delay(1#)
END SUB 'TwoDplot2Curves()
'---

```

```

SUB Probe2Dplots(ProbePlotsFileList$,PlotTitle$,Annotation$,xCoord$,yCoord$,XaxisLabel$,YaxisLabel$,_
LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,XTics$,YTics$,GnuPlotEXE$)
LOCAL N%, ProcessID???
N% = FREEFILE
OPEN "cmd2d.gp" FOR OUTPUT AS #N%
IF LogXaxis$ = "YES" AND LogYaxis$ = "NO" THEN PRINT #N%, "set logscale x"
IF LogXaxis$ = "NO" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale y"
IF LogXaxis$ = "YES" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale xy"
IF xMin$ <> "" AND xMax$ <> "" THEN PRINT #N%, "set xrange [+" + xMin$ + ":" + xMax$ + "]"
IF yMin$ <> "" AND yMax$ <> "" THEN PRINT #N%, "set yrange [+" + yMin$ + ":" + yMax$ + "]"
PRINT #N%, "set label " + Quote$ + Annotation$ + Quote$ + " at graph +" + xCoord$ + "," + yCoord$
PRINT #N%, "set grid xtics"
PRINT #N%, "set grid ytics"
PRINT #N%, "set xtics " + XTics$
PRINT #N%, "set ytics " + YTics$
PRINT #N%, "set grid mxtics"
PRINT #N%, "set grid mytics"
PRINT #N%, "set title " + Quote$ + PlotTitle$ + Quote$ + " at Step #" + Step$ + " " + RepositionFactor$ + " " + Gamma$ + " " + FunctionName$ + " " + "Function"
PRINT #N%, "set xlabel " + Quote$ + XaxisLabel$ + Quote$ + " at Step #" + Step$ + " " + RepositionFactor$ + " " + Gamma$ + " " + FunctionName$ + " " + "Function"
PRINT #N%, "set ylabel " + Quote$ + YaxisLabel$ + Quote$ + " at Step #" + Step$ + " " + RepositionFactor$ + " " + Gamma$ + " " + FunctionName$ + " " + "Function"
PRINT #N%, "ProbePlotsFileList$"
CLOSE #N%
ProcessID??? = SHELL(GnuPlotEXE$ + " cmd2d.gp -") : CALL Delay(1#)
END SUB 'Probe2Dplots()
'---

SUB Show2Dprobes(RC),Np%,Nt&,j&,Frep,BestFitness,BestProbeNumber%,BestTimeStep&,FunctionName$,RepositionFactor$,Gamma
LOCAL N%, p%
LOCAL A$, PlotFileName$, PlotTitle$, Symbols$
LOCAL xMin$, xMax$, yMin$, yMax$
LOCAL s1, s2, s3, s4 AS EXT
PlotFileName$ = "Probes(" + REMOVE$(STR$(j&),ANY" ") + ")"
IF j &gt; 0 THEN 'PLOT PROBES AT THIS TIME STEP
    PlotTitle$ = "\nLOCATIONS OF " + REMOVE$(STR$(Np%),ANY" ") + " PROBES AT TIME STEP" + STR$(j&) + "/ " + REMOVE$(STR$(Nt&),ANY" ") + "\n" + REMOVE$(STR$(BestTimeStep%),ANY" ") + -
        "Fitness = " + REMOVE$(STR$(ROUND(BestTimeStep%,3)),ANY" ") + " , Probe #" + REMOVE$(STR$(BestProbeNumber%),ANY" ") + " at Step #" + Step$ + " " +
        "[Frep = " + REMOVE$(STR$(Frep,4),ANY" ") + " " + RepositionFactor$ + "]\n"
    ELSE 'PLOT INITIAL PROBE DISTRIBUTION
        PlotTitle$ = "\nLOCATIONS OF " + REMOVE$(STR$(Np%),ANY" ") + " INITIAL PROBES FOR " + FunctionName$ + " FUNCTION\n[gamma = " +
            "+STR$(ROUND(Gamma,3))]\n"
    END IF
    N% = FREEFILE : OPEN PlotFileName$ FOR OUTPUT AS #N%
    FOR p% = 1 TO Np% : PRINT #N%, USING$("#####.##### #####.#####",R(p%,1,j&),R(p%,2,j&)) : NEXT p%
    CLOSE #N%
    s1 = 1.1# : s2 = 1.1# : s3 = 1.1# : s4 = 1.1# 'expand plots axes by 10%
    IF XMin(1) > 0## THEN s1 = 0.9##
    IF XMax(1) < 0## THEN s2 = 0.9##
    IF XMin(2) > 0## THEN s3 = 0.9##
    IF XMax(2) < 0## THEN s4 = 0.9##
    xMin$ = REMOVE$(STR$(s1*XMin(1),2),ANY" ")
    xMax$ = REMOVE$(STR$(s2*XMax(1),2),ANY" ")
    yMin$ = REMOVE$(STR$(s3*XMin(2),2),ANY" ")
    yMax$ = REMOVE$(STR$(s4*XMax(2),2),ANY" ")
    CALL TwoDplot(PlotFileName$,PlotTitle$,"0.6","0.7","x1\n\n","nx2","NO","NO",xMin$,xMax$,yMin$,yMax$,"5","5","wgnuplot.exe"," pointsize 1 linewidth 2","")
    KILL PlotFileName$ 'erase plot data file after probes have been displayed
END SUB 'Show2Dprobes()
'---

SUB Show3Dprobes(RC),Np%,Nd%,Nt&,j&,Frep,BestFitness,BestProbeNumber%,BestTimeStep&,FunctionName$,RepositionFactor$,Gamma
LOCAL N%, p%, PlotWindowULC_X%, PlotWindowULC_Y%, PlotWindowWidth%, PlotWindowHeight%, PlotWindowOffset%
LOCAL A$, PlotFileName$, PlotTitle$, Symbols$, Annotation$
LOCAL xMin$, xMax$, yMin$, yMax$, zMin$, zMax$
LOCAL s1, s2, s3, s4, s5, s6 AS EXT
PlotFileName$ = "Probes(" + REMOVE$(STR$(j&),ANY" ") + ")"
IF j &gt; 0 THEN 'PLOT PROBES AT THIS TIME STEP
    PlotTitle$ = "\nLOCATIONS OF " + REMOVE$(STR$(Np%),ANY" ") + " PROBES AT TIME STEP" + STR$(j&) + "/ " + REMOVE$(STR$(Nt&),ANY" ") + "\n" + REMOVE$(STR$(BestTimeStep%),ANY" ") + -
        "Fitness = " + REMOVE$(STR$(ROUND(BestTimeStep%,3)),ANY" ") + " , Probe #" + REMOVE$(STR$(BestProbeNumber%),ANY" ") + " at Step #" + Step$ + " " +
        "[Frep = " + REMOVE$(STR$(Frep,4),ANY" ") + " " + RepositionFactor$ + "]\n"
    ELSE 'PLOT INITIAL PROBE DISTRIBUTION
        A$ = "" : IF Gamma > 0## AND Gamma < 1## THEN A$ = "0"
        PlotTitle$ = "\n" + REMOVE$(STR$(Np%),ANY" ") + "-PROBE IPD FOR FUNCTION " + FunctionName$ + " , GAMMA = " + A$ + REMOVE$(STR$(ROUND(Gamma,3)),ANY" ")
    END IF
    ----- Probe Coordinates -----
    N% = FREEFILE : OPEN PlotFileName$ FOR OUTPUT AS #N%
    PRINT #N%, USING$("#####.##### #####.##### #####.#####",R(1,1,j&),R(1,2,j&),R(1,3,j&)) 'This line repeats Probe #1's coordinates. It's necessary
    FOR p% = 1 TO Np% : PRINT #N%, USING$("#####.##### #####.##### #####.#####",R(p%,1,j&),R(p%,2,j&),R(p%,3,j&)) : NEXT p%
    CLOSE #N%

```

```

----- Principal Diagonal -----
N% = FREEFILE : OPEN "diag" FOR OUTPUT AS #N%
PRINT #N%, USING$("#####.##### ###### #####.#####",XiMin(1),XiMin(2),XiMin(3))
PRINT #N%, ""
PRINT #N%, USING$("#####.##### ###### #####.#####",XiMax(1),XiMax(2),XiMax(3))
CLOSE #N%
----- Probe Line #1 -----
N% = FREEFILE : OPEN "probeline1" FOR OUTPUT AS #N%
PRINT #N%, USING$("#####.##### ###### #####.#####",R(1,1,j&),R(1,2,j&),R(1,3,j&))
PRINT #N%, ""
PRINT #N%, USING$("#####.##### ###### #####.#####",R(Np%/Nd%,1,j&),R(Np%/Nd%,2,j&),R(Np%/Nd%,3,j&))
CLOSE #N%
----- Probe Line #2 -----
N% = FREEFILE : OPEN "probeline2" FOR OUTPUT AS #N%
PRINT #N%, USING$("#####.##### ###### #####.#####",R(1+Np%/Nd%,1,j&),R(1+Np%/Nd%,2,j&),R(1+Np%/Nd%,3,j&))
PRINT #N%, ""
PRINT #N%, USING$("#####.##### ###### #####.#####",R(2*Np%/Nd%,1,j&),R(2*Np%/Nd%,2,j&),R(2*Np%/Nd%,3,j&))
CLOSE #N%
----- Probe Line #3 -----
N% = FREEFILE : OPEN "probeline3" FOR OUTPUT AS #N%
PRINT #N%, USING$("#####.##### ###### #####.#####",R(1+2*Np%/Nd%,1,j&),R(1+2*Np%/Nd%,2,j&),R(1+2*Np%/Nd%,3,j&))
PRINT #N%, ""
PRINT #N%, USING$("#####.##### ###### #####.#####",R(3*Np%/Nd%,1,j&),R(3*Np%/Nd%,2,j&),R(3*Np%/Nd%,3,j&))
CLOSE #N%
----- RE-PLOT PROBE #1 BECAUSE OF SOME ARTIFACT THAT DROPS IT FROM PROBE LINE #1 ?????? -----
N% = FREEFILE : OPEN "probe1" FOR OUTPUT AS #N%
PRINT #N%, USING$("#####.##### ###### #####.#####",R(1,1,j&),R(1,2,j&),R(1,3,j&))
PRINT #N%, USING$("#####.##### ###### #####.#####",R(1,1,j&),R(1,2,j&),R(1,3,j&))
CLOSE #N%
s1 = 1.1# : s2 = s1 : s3 = s1 : s4 = s1 : s5 = s1 : s6 = s1 'expand plots axes by 10%
IF XiMin(1) > 0## THEN s1 = 0.9##
IF XiMax(1) < 0## THEN s2 = 0.9##
IF XiMin(2) > 0## THEN s3 = 0.9##
IF XiMax(2) < 0## THEN s4 = 0.9##
IF XiMin(3) > 0## THEN s5 = 0.9##
IF XiMax(3) < 0## THEN s6 = 0.9##
xmin$ = REMOVE$(STRS(s1*ximin(1),2),ANY" ")
xmax$ = REMOVE$(STRS(s2*ximax(1),2),ANY" ")
ymin$ = REMOVE$(STRS(s3*ximin(2),2),ANY" ")
ymax$ = REMOVE$(STRS(s4*ximax(2),2),ANY" ")
zmin$ = REMOVE$(STRS(s5*ximin(3),2),ANY" ")
zmax$ = REMOVE$(STRS(s6*ximax(3),2),ANY" ")
'USAGE: CALL ThreeDplot3(PlotFileName$,PlotTitle$,Annotations$,xCoord$,yCoord$,zCoord$,
                        XaxisLabel$,YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,xStart$,xStop$,yStart$,yStop$)
PlotWindowULC_X% = 50 : PlotWindowULC_Y% = 50 : Plotwindowwidth% = 1000 : PlotwindowHeight% = 800
Plotwindowoffset% = 100*Gamma
CALL CreateGnuPlotINIfile(PlotWindowULC_X%+PlotwindowOffset%,PlotWindowULC_Y%+PlotwindowOffset%,Plotwindowwidth%,PlotwindowHeight%)
CALL ThreeDplot3(PlotFileName$,PlotTitle$,Annotations$,"0.6","0.7","0.8",
                  "x1","x2","x3",zMin$,zMax$,"wgnuplot.exe",xmin$,xmax$,ymin$,ymax$)
'KILL PlotFileName$ 'erase plot data file after probes have been displayed
END SUB 'Show3Dprobes()
'--
SUB ThreeDplot3(PlotFileName$,PlotTitle$,Annotations$,xCoord$,yCoord$,zCoord$,
                 XaxisLabel$,YaxisLabel$,ZaxisLabel$,zMin$,zMax$,GnuPlotEXE$,xStart$,xStop$,yStart$,yStop$)
LOCAL N%, ProcID???
N% = FREEFILE
OPEN "cmd3d.gp" FOR OUTPUT AS #N%
PRINT #N%, "set pm3d"
PRINT #N%, "show pm3d"
PRINT #N%, "set hidden3d"
PRINT #N%, "set view 45, 45, 1, 1"
PRINT #N%, "set view 45, 60, 1, 1"
IF zMin$ < "" AND zMax$ < "" THEN PRINT #N%, "set zrange [ "+zMin$+": "+zMax$+" ]"
PRINT #N%, "set xrange [ "+xStart$ + ":" + xStop$ + "]"
PRINT #N%, "set yrange [ "+yStart$ + ":" + yStop$ + "]"
PRINT #N%, "set label " + Quotes + AnnoTation$ + Quote$+ " at graph "+xCoord$+", "+yCoord$+", "+zCoord$
PRINT #N%, "show label"
PRINT #N%, "set grid xtics ytics ztics"
PRINT #N%, "show grid"
PRINT #N%, "set title " + Quote$+PlotTitle$ + Quote$+
PRINT #N%, "set xlabel " + Quote$+XaxisLabel$ + Quote$+
PRINT #N%, "set ylabel " + Quote$+YaxisLabel$ + Quote$+
PRINT #N%, "set zlabel " + Quote$+ZaxisLabel$ + Quote$+
PRINT #N%, "unset colorbox"
PRINT #N%, "set style fill"
PRINT #N%, "splot " + Quote$+PlotFileName$ + Quotes + " notitle lw 1.pt 8, " -
                  + Quotes + "diag" + Quotes + " notitle w l," -
                  + Quotes + "probeline1" + Quotes + " notitle w l," -
                  + Quotes + "probeline2" + Quotes + " notitle w l," -
                  + Quotes + "probeline3" + Quotes + " notitle w l"
CLOSE #N%
ProcID??? = SHELL(GnuPlotEXE$+" cmd3d.gp -")
CALL Delay(1##)
END SUB 'ThreeDplot3()
'--

```

```

SUB TwoDplot(PlotFileName$,PlotTitle$,xCoord$,yCoord$,XaxisLabel$,YaxisLabel$,
             LogXaxis$,LogYaxis$,xMin$,xMax$,yMin$,yMax$,xTics$,yTics$,GnuPlotEXE$,LineType$,Annotation$)
LOCAL N%, ProcessID???
N% = FREEFILE
OPEN "cmd2d.gp" FOR OUTPUT AS #N%
IF LogXaxis$ = "YES" AND LogYaxis$ = "NO" THEN PRINT #N%, "set logscale x"
IF LogXaxis$ = "NO" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale y"
IF LogXaxis$ = "YES" AND LogYaxis$ = "YES" THEN PRINT #N%, "set logscale xy"
IF xMin$ < "" AND xMax$ < "" THEN PRINT #N%, "set xrange [+" + xMin$ + ":" + xMax$ + "]"
IF yMin$ < "" AND yMax$ < "" THEN PRINT #N%, "set yrange [+" + yMin$ + ":" + yMax$ + "]"
PRINT #N%, "set label " + Quote$ + Annotation$ + Quote$ + " at graph " + xCoord$ + "," + yCoord$
PRINT #N%, "set grid xtics " + xTics$
PRINT #N%, "set grid ytics " + yTics$
PRINT #N%, "set grid xtics"
PRINT #N%, "set grid ytics"
PRINT #N%, "show grid"
PRINT #N%, "set title " + Quote$ + PlotTitle$ + Quote$
PRINT #N%, "set xlabel " + Quote$ + XaxisLabel$ + Quote$
PRINT #N%, "set ylabel " + Quote$ + YaxisLabel$ + Quote$
PRINT #N%, "plot "+Quote$+PlotFileName$+Quote$+" notitle"+LineType$

CLOSE #N%
ProcessID??? = SHELL(GnuPlotEXE$+" cmd2d.gp -") : CALL Delay(1#)

END SUB 'TwoDplot()

'-----
SUB CreateGNUploatINIfile(PlotwindowULC_X%,PlotwindowULC_Y%,Plotwindowwidth%,PlotwindowHeight%)
LOCAL N%, WinPath$, A$, B$, WindowsDirectory$
WinPath$ = UCASE$(ENVIRON$("Path"))'DIR$("C:\WINDOWS",23)

DO
  B$ = A$
  A$ = EXTRACT$(WinPath$,";")
  WinPath$ = REMOVE$(WinPath$,A$+";")
  IF RIGHT$(A$,7) = "WINDOWS" OR A$ = B$ THEN EXIT LOOP
  IF RIGHT$(A$,5) = "WINNT" OR A$ = B$ THEN EXIT LOOP
LOOP
WindowsDirectory$ = A$
N% = FREEFILE
'----- WGNUPLOT.INPUT FILE -----
OPEN WindowsDirectory$+"\\wgnuplot.ini" FOR OUTPUT AS #N%
PRINT #N%, "[WGNUPLOT]"
PRINT #N%, "TextOrigin=0"
PRINT #N%, "TextSize=640 150"
PRINT #N%, "TextFont=Terminal,9"
PRINT #N%, "GraphOrigin=" + REMOVE$(STR$(PlotwindowULC_X%),ANY" ") + "+" + REMOVE$(STR$(PlotwindowULC_Y%),ANY" ")
PRINT #N%, "GraphSize=" + REMOVE$(STR$(Plotwindowwidth%),ANY" ") + "+" + REMOVE$(STR$(PlotwindowHeight%),ANY" ")
PRINT #N%, "GraphFont=arial,10"
PRINT #N%, "GraphColor=1"
PRINT #N%, "GraphTop=1"
PRINT #N%, "GraphBackground=255 255 255"
PRINT #N%, "Border=0"
PRINT #N%, "Axis=192 192 192 2 2"
PRINT #N%, "Line1=0 255 0 0"
PRINT #N%, "Line2=0 255 0 0 1"
PRINT #N%, "Line3=255 0 0 0 2"
PRINT #N%, "Line4=255 0 255 0 3"
PRINT #N%, "Line5=0 0 128 0 4"

CLOSE #N%
END SUB 'CreateGNUploatINIfile()

'-----
SUB Delay(NumSecs)
  LOCAL StartTime, StopTime AS EXT
  StartTime = TIMER
  DO UNTIL (StopTime-StartTime) >= NumSecs
    StopTime = TIMER
  LOOP
END SUB 'Delay()

'-----
SUB MathematicalConstants
  EulerConst   = 0.577215664901532860606512##
  Pi1          = 3.141592653589793238462643##
  Pi2          = Pi1/2##
  Pi4          = Pi1/4##
  TwoPi        = 2#*Pi1
  FourPi       = 4#*Pi1
  e            = 2.718281828459045235360287##
  Root2         = 1.4142135623730950488##
END SUB
'-----
SUB AlphabetAndDigits
  Alphabet$    = "ABCDEFGHIJKLMNOPQRSTUVWXYZabcdefghijklmnopqrstuvwxyz"
  Digits$       = "0123456789"
  RunID$        = REMOVE$(DATE$+"_"+TIME$,ANY Alphabet$+" :-/")
END SUB
'-----
SUB SpecialSymbols
  Quote$        = CHR$(34) 'quotation mark '
  SpecialCharacters$ = "'() ,#:;/"
END SUB

```

```

'-----
SUB EMconstants
  Mu0 = 4E-7##*Pi
  Eps0 = 8.854##*E-12 'hy/meter
  C = 2.998E8## 'velocity of light, 1##/SQR(Mu0*Eps0) 'meters/sec
  eta0 = SQR(Mu0/Eps0) 'impedance of free space, ohms
END SUB
'-----
SUB ConversionFactors
  Rad2Deg = 180##/Pi
  Deg2Rad = 1##/Rad2Deg
  Feet2Meters = 0.3048#
  Meters2Feet = 1##/Feet2Meters
  Inches2Meters = 0.0254#
  MetersInches = 1##/Inches2Meters
  Miles2Meters = 1609.344##
  Meters2Miles = 1##/Miles2Meters
  NautMi2Meters = 1852##
  Meters2NautMi = 1##/NautMi2Meters
END SUB
'-----
SUB ShowConstants 'puts up msgbox showing all constants
LOCAL A$  

A$ = "Mathematical_Constants:"+CHR$(13)+_
"Euler const="+STR$(EulerConst)+CHR$(13)+_
"Pi=" +STR$(Pi)+CHR$(13)+_
"Pi/2=" +STR$(Pi2)+CHR$(13)+_
"Pi/4=" +STR$(Pi4)+CHR$(13)+_
"2Pi=" +STR$(Pi)+CHR$(13)+_
"4Pi=" +STR$(FourPi)+CHR$(13)+_
"e=" +STR$(e)+CHR$(13)+_
"sqrt=" +STR$(Root2)+CHR$(13)+CHR$(13)+_
"Alphabet_Digits & Special Characters:"+CHR$(13)+_
"Alphabet=" +Alphabet$+CHR$(13)+_
"Digits=" +Digits$+CHR$(13)+_
"quote=" +Quotes$+CHR$(13)+_
"Spec chars=" +Specialcharacters$+CHR$(13)+CHR$(13)+_
"EM Constants:"+CHR$(13)+_
"Mu0=" +STR$(Mu0)+CHR$(13)+_
"Eps0=" +STR$(Eps0)+CHR$(13)+_
"C=" +STR$(C)+CHR$(13)+_
"Eta0=" +STR$(eta0)+CHR$(13)+CHR$(13)+_
"Conversion Factors:"+CHR$(13)+_
"Rad2Deg=" +STR$(Rad2Deg)+CHR$(13)+_
"Deg2Rad=" +STR$(Deg2Rad)+CHR$(13)+_
"Feet2Meters=" +STR$(Feet2Meters)+CHR$(13)+_
"Metres2Ft=" +STR$(Metres2Feet)+CHR$(13)+_
"Inches2Meters=" +STR$(Inches2Meters)+CHR$(13)+_
"Metres2Inches=" +STR$(Metres2Inches)+CHR$(13)+_
"Miles2Meters=" +STR$(Miles2Meters)+CHR$(13)+_
"Metres2Miles=" +STR$(Metres2Miles)+CHR$(13)+_
"NautMi2Meters=" +STR$(NautMi2Meters)+CHR$(13)+_
"Metres2NautMi=" +STR$(Metres2NautMi)+CHR$(13)+CHR$(13)
MSGBOX(A$)
END SUB
'-----
SUB DisplayRmatrix(Np%,Nd%,Nt&,R())
LOCAL p%, i%, j&, A$  

A$ = "Position Vector Matrix R()"+CHR$(13)
FOR p% = 1 TO Np%
  FOR i% = 1 TO Nd%
    FOR j& = 0 TO Nt&
      A$ = A$ + "R(" +STR$(p%) +", " +STR$(i%) +", " +STR$(j&)+ " ) =" +STR$(R(p%,i%,j&)) + CHR$(13)
    NEXT j&
  NEXT i%
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayRmatrixThisTimestep(Np%,Nd%,j&,R(),Gamma)
LOCAL p%, i%, A$, B$  

A$ = "Position Vector Matrix R() at step "+STR$(j&)+", Gamma =" +STR$(Gamma)+": "+CHR$(13)+CHR$(13)
FOR p% = 1 TO Np%
  A$ = A$ + "Probe#" +REMOVE$(STR$(p%),ANY" ") +": "
  B$ = ""
  FOR i% = 1 TO Nd%
    B$ = B$ + " " + USING$("####.##",R(p%,i%,j&))
  NEXT i%
  A$ = A$ + B$ + CHR$(13)
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayAmatrix(Np%,Nd%,Nt&,A())
LOCAL p%, i%, j&, A$  

A$ = "Acceleration Vector Matrix A()"+CHR$(13)
FOR p% = 1 TO Np%

```

```

FOR i% = 1 TO Nd%
  FOR j& = 0 TO Nt&
    A$ = A$ + "A(" + STR$(p%) + ", " + STR$(i%) + ", " + STR$(j&) + ") =" + STR$(A(p%, i%, j&)) + CHR$(13)
  NEXT j&
NEXT i%
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayAmatrixThisTimestep(Np%,Nd%,j&,A())
LOCAL p%, i%, A$
A$ = "Acceleration matrix A() at step "+STR$(j&)+":"+CHR$(13)
FOR p% = 1 TO Np%
  FOR i% = 1 TO Nd%
    A$ = A$ + "A(" + STR$(p%) + ", " + STR$(i%) + ", " + STR$(j&) + ") =" + STR$(A(p%, i%, j&)) + CHR$(13)
  NEXT i%
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayMmatrix(Np%,Nt&,M())
LOCAL p%, j&, A$
A$ = "Fitness Matrix M()"+CHR$(13)
FOR p% = 1 TO Np%
  FOR j& = 0 TO Nt&
    A$ = A$ + "M(" + STR$(p%) + ", " + STR$(j&) + ") =" + STR$(M(p%, j&)) + CHR$(13)
  NEXT j&
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayMbestMatrix(Np%,Nt&,Mbest())
LOCAL p%, j&, A$
A$ = "Np= "+STR$(Np%)+" Nt="+STR$(Nt&)+CHR$(13)+"Fitness Matrix Mbest()"+CHR$(13)
FOR p% = 1 TO Np%
  FOR j& = 0 TO Nt&
    A$ = A$ + "Mbest(" + STR$(p%) + ", " + STR$(j&) + ") =" + STR$(Mbest(p%, j&)) + CHR$(13)
  NEXT j&
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayMmatrixThisTimeStep(Np%,j&,M())
LOCAL p%, A$
A$ = "Fitness matrix M() at step "+STR$(j&)+":"+CHR$(13)
FOR p% = 1 TO Np%
  A$ = A$ + "M(" + STR$(p%) + ", " + STR$(j&) + ") =" + STR$(M(p%, j&)) + CHR$(13)
NEXT p%
MSGBOX(A$)
END SUB
'-----
SUB DisplayXiMinMax(Nd%,XiMin(),XiMax())
LOCAL i%, A$
A$ = ""
FOR i% = 1 TO Nd%
  A$ = A$ + "XiMin(" + STR$(i%) + ") = " + STR$(XiMin(i%)) + " XiMax(" + STR$(i%) + ") = " + STR$(XiMax(i%)) + CHR$(13)
NEXT i%
MSGBOX(A$)
END SUB
'-----
SUB DisplayRunParameters2(FunctionName$,Nd%,Np%,Nt&,G,DeltaT,Alpha,Beta,Freq,PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$)
LOCAL A$
A$ = "Function = " + FunctionName$ + CHR$(13) +
  "Nd = "+STR$(Nd%)+CHR$(13)+_
  "Np = "+STR$(Np%)+CHR$(13)+_
  "Nt = "+STR$(Nt&)+CHR$(13)+_

```

```

"G = "+STR$(G)+CHR$(13)+_
"DeltaT = "+STR$(DeltaT)+CHR$(13)+_
"Alpha = "+STR$(Alpha)+CHR$(13)+_
"Beta = "+STR$(Beta)+CHR$(13)+_
"Freq = "+STR$(Freq)+CHR$(13)+_
"Init Probes: "+PlaceInitialProbes$+CHR$(13)+_
"Init Accel: "+InitialAcceleration$+CHR$(13)+_
"Retrive Method: "+RepositionFactor$+CHR$(13)

MSGBOX(A$)
END SUB
'-----
SUB Tabulate1DprobeCoordinates(Max1DprobesPlotted%,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Freq,R(),M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)
LOCAL N%, ProbeNum%, FileHeader$, A$, B$, C$, D$, E$, F$, H$, StepNum&, FieldNumber% 'kludgy, yes, but it accomplishes its purpose...
    CALL GetPlotAnnotation(FileHeader$,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Freq,M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)
    REPLACE "\n" WITH ", " IN FileHeader$
    FileHeader$ = LEFT$(FileHeader$,LEN(FileHeader$)-2)
    FileHeader$ = "PROBE COORDINATES" + CHR$(13) +_
    "-----" + CHR$(13) + FileHeader$

N% = FREEFILE : OPEN "ProbeCoordinates.DAT" FOR OUTPUT AS #N%
A$ = " Step # : B$ = " ----- : C$ = ""
FOR ProbeNum% = 1 TO Np% 'create out data file header
    SELECT CASE ProbeNum%
        CASE 1 TO 99 : E$ = "" : F$ = "" : H$ = "" : " "
        CASE 10 TO 99 : E$ = "" : F$ = "" : H$ = "" : " "
        CASE 100 TO 999 : E$ = "---" : F$ = " " : H$ = " " : " "
    END SELECT
    A$ = A$ + "P" + NoSpaces$(ProbeNum%+0,0) + F$ 'note: adding zero to ProbeNum% necessary to convert to floating point...
    B$ = B$ + E$ + "---" + H$
    C$ = C$ + "#####.###"
    C$ = C$ + "#.#.#####"
NEXT ProbeNum%
PRINT #N%, FileHeader$ + CHR$(13) : PRINT #N%, A$ : PRINT #N%, B$

FOR StepNum& = 0 TO LastStep&
    D$ = USING$("#####",StepNum&)
    FOR ProbeNum% = 1 TO Np% : D$ = D$ + USING$(C$,R(ProbeNum%,1,StepNum&)) : NEXT ProbeNum%
    PRINT #N%, D$
NEXT StepNum&
CLOSE #N%
END SUB 'Tabulate1DprobeCoordinates()
'-----

SUB Plot1DprobePositions(Max1DprobesPlotted%,Nd%,Np%,LastStep&,G,DeltaT,Alpha,Beta,Freq,R(),M(),PlaceInitialProbes$,InitialAcceleration$,RepositionFactor$,FunctionName$,Gamma)
    'plots on-screen 1D function probe positions vs time step if Np <= 10
LOCAL ProcessID???, N%, n1%, n2%, n3%, n4%, n5%, n6%, n7%, n8%, n9%, n10%, n11%, n12%, n13%, n14%, n15%, ProbeNum%, StepNum&, A$
LOCAL PlotAnnotation$

IF Np% > Max1DprobesPlotted% THEN EXIT SUB
CALL CLEANUP 'delete old "Px" plot files, if any
ProbeNum% = 0
DO 'create output data files, probe-by-probe
    INCR ProbeNum% : n1% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n1% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n2% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n2% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n3% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n3% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n4% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n4% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n5% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n5% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n6% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n6% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n7% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n7% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n8% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n8% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n9% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n9% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n10% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n10% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n11% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n11% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n12% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n12% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n13% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n13% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n14% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n14% : IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : n15% = FREEFILE : OPEN "P"+REMOVES$(STR$(ProbeNum%),ANY" ") FOR OUTPUT AS #n15% : IF ProbeNum% = Np% THEN EXIT LOOP
LOOP
ProbeNum% = 0
DO 'output probe positions as a function of time step
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n1%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n2%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n3%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n4%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n5%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n6%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n7%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n8%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n9%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP
    INCR ProbeNum% : FOR StepNum& = 0 TO LastStep& : PRINT #n10%, USING$("#####.#####",StepNum&,R(ProbeNum%,1,StepNum&)) : NEXT StepNum& :
    IF ProbeNum% = Np% THEN EXIT LOOP

```



```

'-----
SUB GetTestFunctionNumber(FunctionName$)
LOCAL hDlg AS DWORD
LOCAL N%, M%
LOCAL FrameWidth&, FrameHeight&, Boxwidth&, BoxHeight&
' Boxwidth& = 276 : BoxHeight& = 300 : FrameWidth& = 82 : FrameHeight& = BoxHeight&-5
Boxwidth& = 276 : BoxHeight& = 300 : FrameWidth& = 90 : FrameHeight& = BoxHeight&-5
DIALOG NEW 0, "CENTRAL FORCE OPTIMIZATION TEST FUNCTIONS",,, Boxwidth&, BoxHeight&, %WS_CAPTION OR %WS_SYSMENU, 0 TO hDlg
'-----
CONTROL ADD FRAME, hDlg, %IDC_FRAME1, "Test Functions", 5, 2, FrameWidth&, FrameHeight&
CONTROL ADD FRAME, hDlg, %IDC_FRAME2, "GSO Test Functions", 105, 2, FrameWidth&, 255
'-----
CONTROL ADD OPTION, hDlg, %IDC_Function_Number1, "Parrott F4", 10, 14, 70, 10, %WS_GROUP OR %WS_TABSTOP
CONTROL ADD OPTION, hDlg, %IDC_Function_Number2, "SGO", 10, 24, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number3, "Goldstein-Price", 10, 34, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number4, "Step", 10, 44, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number5, "Schwefel 2.26", 10, 54, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number6, "Colville", 10, 64, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number7, "Griewank", 10, 74, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number31, "PBM #1", 10, 84, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number32, "PBM #2", 10, 94, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number33, "PBM #3", 10, 104, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number34, "PBM #4", 10, 114, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number35, "PBM #5", 10, 124, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number36, "Himmelblau", 10, 134, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number37, "Rosenthal", 10, 144, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number38, "Sphere", 10, 154, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number39, "HimmelblauNL", 10, 164, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number40, "Tripod", 10, 174, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number41, "Rosenbrock F6", 10, 184, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number42, "Comp Spring", 10, 194, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number43, "Gear Train", 10, 204, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number44, "Loaded Bowtie", 10, 214, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number45, "Yagi Array", 10, 224, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number46, "Reserved", 10, 234, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number47, "Reserved", 10, 244, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number48, "Reserved", 10, 254, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number49, "Reserved", 10, 264, 70, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number50, "Reserved", 10, 274, 70, 10
'----- Test Functions from GSO Paper -----
CONTROL ADD OPTION, hDlg, %IDC_Function_Number8, "f1", 120, 14, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number9, "f2", 120, 24, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number10, "f3", 120, 34, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number11, "f4", 120, 44, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number12, "f5", 120, 54, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number13, "f6", 120, 64, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number14, "f7", 120, 74, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number15, "f8", 120, 84, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number16, "f9", 120, 94, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number17, "f10", 120, 104, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number18, "f11", 120, 114, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number19, "f12", 120, 124, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number20, "f13", 120, 134, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number21, "f14", 120, 144, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number22, "f15", 120, 154, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number23, "f16", 120, 164, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number24, "f17", 120, 174, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number25, "f18", 120, 184, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number26, "f19", 120, 194, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number27, "f20", 120, 204, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number28, "f21", 120, 214, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number29, "f22", 120, 224, 40, 10
CONTROL ADD OPTION, hDlg, %IDC_Function_Number30, "f23", 120, 234, 40, 10
CONTROL SET OPTION hDlg, %IDC_Function_Number1, %IDC_Function_Number1, %IDC_Function_Number3 'default to Parrott F4
'-----
CONTROL ADD BUTTON, hDlg, %IDOK, "&OK", 200, 0.45##BoxHeight&, 50, 14
'-----
DIALOG SHOW MODAL hDlg CALL DlgProc
CALL Delay(1#)

IF FunctionNumber% < 1 OR FunctionNumber% > 45 THEN
    FunctionNumber% = 1 : MSGBOX("Error in function number...")
END IF

SELECT CASE FunctionNumber%
CASE 1 : FunctionName$ = "ParrottF4"
CASE 2 : FunctionName$ = "SGO"
CASE 3 : FunctionName$ = "GP"
CASE 4 : FunctionName$ = "STEP"
CASE 5 : FunctionName$ = "SCHWEFEL_226"
CASE 6 : FunctionName$ = "COLVILLE"
CASE 7 : FunctionName$ = "GRIEWANK"
CASE 8 : FunctionName$ = "F1"
CASE 9 : FunctionName$ = "F2"
CASE 10: FunctionName$ = "F3"
CASE 11: FunctionName$ = "F4"
CASE 12: FunctionName$ = "F5"
CASE 13: FunctionName$ = "F6"
CASE 14: FunctionName$ = "F7"
CASE 15: FunctionName$ = "F8"
CASE 16: FunctionName$ = "F9"
CASE 17: FunctionName$ = "F10"
CASE 18: FunctionName$ = "F11"
CASE 19: FunctionName$ = "F12"
CASE 20: FunctionName$ = "F13"
CASE 21: FunctionName$ = "F14"
CASE 22: FunctionName$ = "F15"
CASE 23: FunctionName$ = "F16"
CASE 24: FunctionName$ = "F17"
CASE 25: FunctionName$ = "F18"
CASE 26: FunctionName$ = "F19"
CASE 27: FunctionName$ = "F20"
CASE 28: FunctionName$ = "F21"
CASE 29: FunctionName$ = "F22"
CASE 30: FunctionName$ = "F23"
CASE 31: FunctionName$ = "PBM_1"
CASE 32: FunctionName$ = "PBM_2"
CASE 33: FunctionName$ = "PBM_3"

```

```

CASE 34: FunctionName$ = "PBM_4"
CASE 35: FunctionName$ = "PBM_5"
CASE 36: FunctionName$ = "HIMMELBLAU"
CASE 37: FunctionName$ = "ROSENBRICK"
CASE 38: FunctionName$ = "SPHERE"
CASE 39: FunctionName$ = "HIMMELBLAUNL0"
CASE 40: FunctionName$ = "TRIPOD"
CASE 41: FunctionName$ = "ROSENBRICKF6"
CASE 42: FunctionName$ = "COMPRESSSIONSPRING"
CASE 43: FunctionName$ = "GEARTRAIN"
CASE 44: FunctionName$ = "BOWTIE"
CASE 45: FunctionName$ = "YAGI"

END SELECT
END SUB
'-----
CALLBACK FUNCTION DlgProc() AS LONG
'-----Callback procedure for the main dialog
'-----
LOCAL c, lRes AS LONG, sText AS STRING
SELECT CASE AS LONG CBMSG
CASE %WM_INITDIALOG% %WM_INITDIALOG is sent right before the dialog is shown.
CASE %WM_COMMAND% ' <- a control is calling
SELECT CASE AS LONG CBCTL% ' <- look at control's id
CASE %IDOK% ' <- OK button or Enter key was pressed
IF CBCTLMMSG = %BN_CLICKED% THEN
' Loop through the Function_Number controls
' to see which one is selected
FOR c = %IDC_Function_Number1% TO %IDC_Function_Number50%
CONTROL GET CHECK CBHNDL, c TO lRes
IF lRes THEN EXIT FOR
NEXT 'c holds the id for selected test function.
FunctionNumber% = c-120
DIALOG END CBHNDL
END IF
END SELECT
END FUNCTION
'----- PBM ANTENNA BENCHMARK FUNCTIONS -----
'Reference for benchmarks PBM_1 through PBM_5:
'Pantoja, M F., Bretones, A. R., Martin, R. G., "Benchmark Antenna Problems for Evolutionary Optimization Algorithms," IEEE Trans. Antennas & Propagation, vol. 55, no. 4, April 2007,
'pp. 1111-1121
FUNCTION PBM_1(R(),Nd%,p%,j&) 'PBM Benchmark #1: Max D for Variable-Length CF Dipole
LOCAL Z, Lengthwaves, ThetaRadians AS EXT
LOCAL N%, Nseg%, FeedSegNum%
LOCAL NumSegs$, FeedSeg$, HalfLength$, Radius$, ThetaDeg$, Lyne$, GainDB$
Lengthwaves = R(p%,1,j&)
ThetaRadians = R(p%,2,j&)
ThetaDeg$ = REMOVE$(STR$(ROUND(ThetaRadians*Rad2Deg,2)),ANY" ")
IF TALLY(ThetaDeg$,".") = 0 THEN ThetaDeg$ = ThetaDeg$+."
Nsegs% = 2*(INT(100*Lengthwaves)\2)+1 '100 segs per wavelength, must be an odd #, VOLTAGE SOURCE
FeedSegNum% = Nsegs%2 + 1 'center segment number, VOLTAGE SOURCE
NumSegs$ = REMOVE$(STR$(Nsegs%),ANY" ")
FeedSeg$ = REMOVE$(STR$(FeedSegNum%),ANY" ")
HalfLength$ = REMOVE$(STR$(ROUND(Lengthwaves/2##,6)),ANY" ")
IF TALLY(HalfLength$,".") = 0 THEN HalfLength$ = HalfLength$+."
Radius$ = "0.00001" 'REMOVE$(STR$(ROUND(Lengthwaves/1000##,6)),ANY" ")
N% = FREEFILE
OPEN "BM1.NEC" FOR OUTPUT AS #N%
PRINT #N%,"CM File: PBML.NEC"
PRINT #N%,"CM Run ID "+DATE$+" "+TME$S
PRINT #N%,"CM Nd="+STR$(Nd%)+"_P="+STR$(p%)+"_j="+STR$(j&)
PRINT #N%,"CM R(p,1,j)="+STR$(R(p,1,j&))+", R(p,2,j)="+STR$(R(p,2,j&))
PRINT #N%,"CE"
PRINT #N%,"GW 1,"+NumSegs$+",0.,0.,-"+HalfLength$+",0.,0.,"+HalfLength$+", "+Radius$
PRINT #N%,"GE"
PRINT #N%,"EX 0.1,"+FeedSegs$+",0.1,0.,"VOLTAGE SOURCE
PRINT #N%,"RP 0,1,0,0.99,-79564,0."
PRINT #N%,"RP 0,1,1,1001,+metabeg$+,0.,0.,1000." gain at 1000 wavelengths range
PRINT #N%,"Q"
PRINT #N%,"EN"
CLOSE #N%
'- ANGLES - - - POWER GAINS - - - - - POLARIZATION - - - - - E(THETA) - - - - - E(PHI) - - -
THETA   PHI      VERT.  HOR.  TOTAL    AXIAL   TILT   SENSE   MAGNITUDE   PHASE   MAGNITUDE   PHASE
DEGREES DEGREES   DB     DB     RATIO   DEG.    VOLTS/M   DEGREES   VOLTS/M   DEGREES
90.00    0.00   3.91 -999.99   3.91   0.00000  0.00  LINEAR  1.29504E-04   5.37  0.00000E+00  -5.24
123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x
10       20       30       40       50       60       70       80       90       100      110      120
SHELL "n41_2k1.exe",0
N% = FREEFILE

```

```

OPEN "PBM1.OUT" FOR INPUT AS #N%
WHILE NOT EOF(#N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$,"DEGREES DEGREES") > 0 THEN EXIT LOOP
    WEND 'position at next data line
    LINE INPUT #N%, Lyne$
CLOSE #N%
GainDB$ = REMOVE$(MID$(Lyne$,37,8),ANY" ")
PBM_1 = 10^(VAL(GainDB$)/10##) 'Directivity
END FUNCTION 'PBM_1()
'---

FUNCTION PBM_2(R(),Nd%,p%,j&) 'PBM Benchmark #2: Max D for variable-Separation Array of CF Dipoles
LOCAL Z, DipoleSeparationWaves, ThetaRadians AS EXT
LOCAL N%, i%
LOCAL NumSegs$, FeedSeg$, Radius$, Thetabeg$, Lyne$, GainDB$, Xcoord$, wireNum$
DipoleSeparationWaves = R(p%,1,j&)
ThetaRadians = R(p%,2,j&)
ThetaDeg$ = REMOVE$(STR$(ROUND(ThetaRadians*Rad2Deg,2)),ANY" ")
IF TALLY(ThetaDeg$,".") = 0 THEN ThetaDeg$ = ThetaDeg$+"."
NumSegs$ = "49"
FeedSeg$ = "25"
Radius$ = "0.00001"
N% = FREEFILE
OPEN "PBM2.NEC" FOR OUTPUT AS #N%
PRINT #N%,"CM File: PBM2.NEC"
PRINT #N%,"CM Run ID "+DATE$+" "+TIME$
PRINT #N%,"CM Nd=" +STR$(Nd%)+", p=" +STR$(p%)+", j=" +STR$(j&)
PRINT #N%,"CM R(p,1,j)=" +STR$(R(p%,1,j&))+", R(p,2,j)=" +STR$(R(p%,2,j&))
PRINT #N%,"CE"
FOR i% = -9 TO 9 STEP 2
    WireNum$ = REMOVE$(STR$((i%+11)\2),ANY" ")
    Xcoord$ = REMOVE$(STR$(i%\2*DipoleSeparationWaves/2##),ANY" ")
    PRINT #N%,"GW "+wireNum$+", "+NumSegs$+", "+Xcoord$+", 0.,-0.25,"+Xcoord$+", 0.,0.25,"+Radius$+
NEXT 1%
PRINT #N%,"GE"
FOR i% = 1 TO 10
    PRINT #N%,"EX 0,"+REMOVE$(STR$(i%),ANY" ")+","+FeedSeg$+",0,1.,0." 'VOLTAGE SOURCE
NEXT 1%
PRINT #N%,"FR 0,1,0,0,299,79564,0."
PRINT #N%,"RP 0,1,1,1001,"+ThetaDeg$+",90.,0.,0.,1000." 'gain at 1000 wavelengths range
PRINT #N%,"XQ"
PRINT #N%,"EN"
CLOSE #N%
' -- ANGLES -- POWER GAINS -- -- - POLARIZATION -- -- - E(THETA) -- -- - E(PHI) -- --
THETA   PHI      VERT.    HOR.   TOTAL    AXIAL    TILT    SENSE    MAGNITUDE   PHASE   MAGNITUDE   PHASE
DEGREES DEGREES          DB     DB      DB      RATIO    DEG.      VOLTS/M    DEGREES      VOLTS/M    DEGREES
90.00     0.00    3.91    999.99    3.91    0.00000   0.00  LINEAR   1.29504E-04    3.37    0.00000E+00    -5.24
123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x10
10       20       30       40       50       60       70       80       90       100      110      120
SHELL "n41_2k1.exe",0
N% = FREEFILE
OPEN "PBM2.OUT" FOR INPUT AS #N%
WHILE NOT EOF(#N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$,"DEGREES DEGREES") > 0 THEN EXIT LOOP
    WEND 'position at next data line
    LINE INPUT #N%, Lyne$
CLOSE #N%
GainDB$ = REMOVE$(MID$(Lyne$,37,8),ANY" ")
IF AddNoiseToPBM2$ = "YES" THEN
    Z = 10^(VAL(GainDB$)/10##) + GaussianDeviate(0#,0.4472##) 'directivity with Gaussian noise (zero mean, 0.2 variance)
ELSE
    Z = 10^(VAL(GainDB$)/10##) 'directivity without noise
END IF
PBM_2 = Z
END FUNCTION 'PBM_2()
'---

FUNCTION PBM_3(R(),Nd%,p%,j&) 'PBM Benchmark #3: Max D for Circular Dipole Array
LOCAL Beta, ThetaRadians, Alpha, Rev, ImV AS EXT
LOCAL N%, i%
LOCAL NumSegs$, FeedSeg$, Radius$, Thetabeg$, Lyne$, GainDB$, Xcoord$, Ycoord$, wireNum$, ReEx$, ImEx$
Beta = R(p%,1,j&)
ThetaRadians = R(p%,2,j&)
ThetaDeg$ = REMOVE$(STR$(ROUND(ThetaRadians*Rad2Deg,2)),ANY" ")

```

```

IF TALLY(ThetaDeg$,".") = 0 THEN ThetaDeg$ = ThetaDeg$+."
NumSegs$ = "49"
FeedSeg$ = "25"
Radius$ = "0.00001"
N% = FREEFILE
OPEN "PBM3.NEC" FOR OUTPUT AS #N%
PRINT #N%, "CM File: PBM3.NEC"
PRINT #N%, "CM Run_ID "+DATE$+" "+TIME$
PRINT #N%, "CM Nd="+STR$(Nd)+"", p=STR$(p%)+"", j="+STR$(j&)
PRINT #N%, "CM R(p,1,j)="+STR$(R(p%,1,j&))+", R(p,2,j)="+STR$(R(p%,2,j&))
PRINT #N%, "CE"
FOR i% = 1 TO 8
    wireNum$ = REMOVE$(STR$(i%),ANY" ")
    SELECT CASE i%
        CASE 1 : Xcoord$ = "1" : Ycoord$ = "0"
        CASE 2 : Xcoord$ = "0.70711" : Ycoord$ = "0.70711"
        CASE 3 : Xcoord$ = "0" : Ycoord$ = "1"
        CASE 4 : Xcoord$ = "-0.70711" : Ycoord$ = "0.70711"
        CASE 5 : Xcoord$ = "-1" : Ycoord$ = "0"
        CASE 6 : Xcoord$ = "-0.70711" : Ycoord$ = "-0.70711"
        CASE 7 : Xcoord$ = "0" : Ycoord$ = "-1"
        CASE 8 : Xcoord$ = "0.70711" : Ycoord$ = "-0.70711"
    END SELECT
    PRINT #N%, "GW "+wireNum$+", "+NumSegs$+", "+Xcoord$+", "+Ycoord$+", -0.25, "+Xcoord$+", "+Ycoord$+", 0.25, "+Radius$+
NEXT i%
PRINT #N%, "GE"
FOR i% = 1 TO 8
    Alpha = -COS(TwoPi*Beta*(i%-1))
    ReV = COS(Alpha)
    ImV = SIN(Alpha)
    ReEX$ = REMOVE$(STR$(ROUND(ReV,6)),ANY" ")
    ImEX$ = REMOVE$(STR$(ROUND(ImV,6)),ANY" ")
    IF TALLY(ReEX$,".") = 0 THEN ReEX$ = ReEX$+"."
    IF TALLY(ImEX$,".") = 0 THEN ImEX$ = ImEX$+"."
    PRINT #N%, "EX 0, "+REMOVE$(STR$(i%),ANY" ")+" , "+FeedSeg$+", 0, "+ReEX$+", "+ImEX$ " VOLTAGE SOURCE
NEXT i%
PRINT #N%, "FR 0 1,0,0.299_79564,0."
PRINT #N%, "RP 0,1,1,1001, "+ThetaDeg$+", 0.,0.,0.,1000." "gain at 1000 wavelengths range
PRINT #N%, "XQ"
PRINT #N%, "EN"
CLOSE #N%
'----- ANGLES - - - VERT. - POWER GAINS - - - - POLARIZATION - - - - - E(THETA) - - - - - E(PHI) - - -
THETA DEGREES PHI DEGREES VERT. HOR. TOTAL AXIAL TILT SENSE MAGNITUDE PHASE MAGNITUDE PHASE
DEGREES DEGREES DB DB DB RATIO DEG. VOLTS/M DEGREES VOLTS/M DEGREES
90.00 0.00 3.91 -999.99 3.91 0.0000 0.00 LINEAR 1.29504E-04 5.37 0.00000E+00 -5.24
123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x10 20 30 40 50 60 70 80 90 100 110 120
SHELL "n41_2k1.exe",0
N% = FREEFILE
OPEN "PBM3.OUT" FOR INPUT AS #N%
WHILE NOT EOF(N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$,"DEGREES DEGREES") > 0 THEN EXIT LOOP
    WEND 'position at next data line
    LINE INPUT #N%, Lyne$
CLOSE #N%
GainDB$ = REMOVE$(MID$(Lyne$,37,8),ANY" ")
PBM_3 = 10^(VAL(GainDB$)/10#) 'Directivity
END FUNCTION 'PBM_3()
'-----
FUNCTION PBM_4(R(),Nd%,p%,j&) 'PBM Benchmark #4: Max D for vee dipole
LOCAL TotalLengthwaves, AlphaRadians, ArmLength, Xlength, Zlength, Lfeed AS EXT
LOCAL N%, i%, Nseg$, FeedZcoord$
LOCAL NumSegs$, Lyne$, GainDB$, Xcoord$, Zcoord$
TotalLengthwaves = 2##*R(p%,1,j&)
AlphaRadians = R(p%,2,j&)
Lfeed = 0.01##
FeedZcoord$ = REMOVE$(STR$(Lfeed),ANY" ")
ArmLength = (TotalLengthwaves-2##*Lfeed)/2##
Xlength = ROUND(ArmLength*COS(AlphaRadians),6)
Xcoord$ = REMOVE$(STR$(Xlength),ANY" ") : IF TALLY(Xcoord$,".") = 0 THEN Xcoord$ = Xcoord$+".
Zlength = ROUND(ArmLength*SIN(AlphaRadians),6)
Zcoord$ = REMOVE$(STR$(Zlength+Lfeed),ANY" ") : IF TALLY(Zcoord$,".") = 0 THEN Zcoord$ = Zcoord$+".
Nseg$ = 2^(INT(TotalLengthwaves*100)\2) 'even number, total # segs
NumSegs$ = REMOVE$(STR$(Nseg$^2),ANY" ") '# segs per arm
N% = FREEFILE
OPEN "PBM4.NEC" FOR OUTPUT AS #N%
PRINT #N%, "CM File: PBM4.NEC"
PRINT #N%, "CM Run_ID "+DATE$+" "+TIME$
PRINT #N%, "CM Nd="+STR$(Nd)+"", p=STR$(p%)+"", j="+STR$(j&)

```

```

PRINT #N%, "CM R(p,1,j)=" + STR$(R(p%,1,j&)) + ", R(p,2,j)=" + STR$(R(p%,2,j&))
PRINT #N%, "CE"
PRINT #N%, "GW 1,5,0.,.-+FeedZcoord$+,0.,.,+FeedZcoord$+,0.00001" 'feed wire, 1 segment, 0.01 wvln
PRINT #N%, "GW 2," + NumSegs$ + ",0.,.+FeedZcoord$+,+Xcoord$+,0.,+Zcoord$+,0.00001" 'upper arm
PRINT #N%, "GW 3," + NumSegs$ + ",0.,.-+FeedZcoord$+,+Xcoord$+,0.,-+Zcoord$+,0.00001" 'lower arm
PRINT #N%, "GE"
PRINT #N%, "EX 0,1,3,0,1,0." "VOLTAGE SOURCE
PRINT #N%, "FR 0,1,0,0,299.79564,0."
PRINT #N%, "RP 0,1,1,1001,90.,0.,0.,1000." 'ENDFIRE gain at 1000 wavelengths range
PRINT #N%, "XQ"
PRINT #N%, "EN"

CLOSE #N%
' -- ANGLES -- - POWER GAINS - - - POLARIZATION - - - - E(THETA) - - - - E(PHI) - - -
; THETA   PHI     VERT.   HOR.   TOTAL      AXIAL    TILT   SENSE   MAGNITUDE   PHASE
; DEGREES DEGREES   DB     DB     DB      RATIO    DEG.    VOLTS/M   DEGREES   VOLTS/M   DEGREES
; 90.00    0.00    3.91   -999.99   3.91   0.00000   0.00  LINEAR  1.29504E-04   5.37   0.00000E+00   -5.24
; 123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x
; 10       20       30      40      50      60      70      80      90      100     110      120
SHELL "n41_2k1.exe",0
N% = FREEFILE
OPEN "PBM4.OUT" FOR INPUT AS #N%
WHILE NOT EOF(N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$, "DEGREES DEGREES") > 0 THEN EXIT LOOP
    WEND 'position at next data line
    LINE INPUT #N%, Lyne$
CLOSE #N%
GainDB$ = REMOVE$(MID$(Lyne$, 37, 8), ANY")
PBM_4 = 10*(VAL(GainDB$)/10#) 'Directivity
END FUNCTION 'PBM_4()
'-----
FUNCTION PBM_5(R(), Nd%, p%, j&) 'PBM Benchmark #5: N-element collinear array (Nd=N-1)
LOCAL TotalLengthwaves, Di(), Ystart, Y1, Y2, SumDi AS EXT
LOCAL N%, i%, q%
LOCAL Lyne$, GainDB$
REDIM Di(1 TO Nd%)
FOR i% = 1 TO Nd%
    Di(i%) = R(p%, i%, j&) 'dipole separation, wavelengths
NEXT i%
TotalLengthwaves = 0#
FOR i% = 1 TO Nd%
    TotalLengthwaves = TotalLengthwaves + Di(i%)
NEXT i%
TotalLengthWaves = TotalLengthwaves + 0.5## 'add half-wavelength of 1 meter at 299.8 MHz
Ystart = -TotalLengthwaves/2##
N% = FREEFILE
OPEN "PBM5.NEC" FOR OUTPUT AS #N%
PRINT #N%, "CM File: PBM5.NEC"
PRINT #N%, "CM Run ID "+DATE$+" "+TIME$+
PRINT #N%, "CM ND=" + STR$(Nd%) + ", D=" + STR$(p%) + ", J=" + STR$(j&)
PRINT #N%, "CM R(p,1,j)=" + STR$(R(p%,1,j&)) + ", R(p,2,j)=" + STR$(R(p%,2,j&))
PRINT #N%, "CE"
FOR i% = 1 TO Nd%+1
    SumDi = 0#
    FOR q% = 1 TO i%-1
        SumDi = SumDi + Di(q%)
    NEXT q%
    Y1 = ROUND(Ystart + SumDi, 6)
    Y2 = ROUND(Y1+0.5##, 6) 'add one-half wavelength for other end of dipole
    PRINT #N%, "GW "+REMOVE$(STR$(i%), ANY")+",49,0.,"+REMOVE$(STR$(Y1), ANY")+",0.,0.,"+REMOVE$(STR$(Y2), ANY")+",0.,0.00001"
NEXT i%
PRINT #N%, "GE"
FOR i% = 1 TO Nd%+1
    PRINT #N%, "EX 0, "+REMOVE$(STR$(i%), ANY")+",25,0,1,0." "VOLTAGE SOURCES
NEXT i%
PRINT #N%, "FR 0,1,0,0,299.79564,0."
PRINT #N%, "RP 0,1,1,1001,90.,0.,0.,1000." 'gain at 1000 wavelengths range
PRINT #N%, "XQ"
PRINT #N%, "EN"

CLOSE #N%
' -- ANGLES -- - POWER GAINS - - - POLARIZATION - - - - E(THETA) - - - - E(PHI) - - -
; THETA   PHI     VERT.   HOR.   TOTAL      AXIAL    TILT   SENSE   MAGNITUDE   PHASE
; DEGREES DEGREES   DB     DB     DB      RATIO    DEG.    VOLTS/M   DEGREES   VOLTS/M   DEGREES
; 90.00    0.00    3.91   -999.99   3.91   0.00000   0.00  LINEAR  1.29504E-04   5.37   0.00000E+00   -5.24
; 123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x
; 10       20       30      40      50      60      70      80      90      100     110      120

```

```

SHELL "n41_2k1.exe",0
N% = FREEFILE
OPEN "PBM5.OUT" FOR INPUT AS #N%
WHILE NOT EOF(N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$,"DEGREES DEGREES") > 0 THEN EXIT LOOP
    WEND 'position at next data line
    LINE INPUT #N%, Lyne$
CLOSE #N%
GainDB$ = REMOVE$(MID$(Lyne$,37,8),ANY" ")
PBM_5 = 10^(VAL(GainDB$)/10##) 'Directivity
END FUNCTION 'PBM_5()

'-----
FUNCTION BOWTIE(R(),Nd%,p%,j&) 'FREE SPACE BOWTIE
LOCAL N%, i%, Nsegs%, NumFreqs%, ElemenNum%, NumRadPattAngles%, ExcitedSegment%
LOCAL Lyne$, FR1$, FileStatus$, FileID$
LOCAL A, B, C AS EXT 'coefficients for Bowtie Fitness function
LOCAL a_meters, SegLength, x1, x2, y1, y2, z1, z2 AS EXT
LOCAL Z0, FrequencyMHz(), RadEfficiencyPCT(), MaxGainDBI(), MinGainDBI(), RinOhms(), XinOhms(), VSWR(), ForwardGainDBI() AS EXT
LOCAL Fitness, MinimumRadiationEfficiency, MaximumRadiationEfficiency, MinimumMaxGain, MaximumMaxGain, MinVSWR, MaxVSWR, MinRin, MaxRin, MinXin, MaxXin, MaxFwdGain, MinFwdGain AS EXT
LOCAL StartFreqMHz!, StopFreqMHz!, FreqStepMHz!
LOCAL ArmLengthMeters, AngleRadians, LoadResistance10hms, LoadResistance20hms AS EXT
LOCAL LoadedSegNum1%, LoadedSegNum2%
REDIM FrequencyMHz(1 TO 1), RadEfficiencyPCT(1 TO 1), MaxGainDBI(1 TO 1), MinGainDBI(1 TO 1), RinOhms(1 TO 1), XinOhms(1 TO 1), VSWR(1 TO 1), ForwardGainDBI(1 TO 1)

'DECISION SPACE BOUNDARY ARRAY:
'DECISION SPACE BOUNDARY ARRAY:
    Array Element #      Design Variable
    -----  -----
    1      Bowtie arm length (meters)
    2      Bowtie HALF angle (degrees)
    3      Loading segment number #1
    4      Loading resistance #1 (ohms)
    5      Z0

' IMPORTANT NOTE: SEGMENTATION IS FIXED AT 9 !!!! BE SURE Nsegs% = 9 BELOW, OR CHANGE IT HERE AND IN SUB GetFunctionRunParameters()
Nsegs% = 9

ArmLengthMeters      = ROUND(R(p%,1,j&),3)
AngleRadians         = ROUND(R(p%,2,j&)*Deg2Rad,3) 'remember, this is the HALF angle
LoadedSegNum1%       = MAX(INT(R(p%,3,j&)),1)
LoadResistance10hms  = ROUND(R(p%,4,j&),2)
Z0                  = ROUND(R(p%,5,j&),1)

a_meters = 0.0005## 'meters
Zo = 300## 'feed system characteristic impedance, OHMS, for computing VSWR
NumRadPattAngles% = 19

IF BowtieSegmentLength$ = "FIXED" THEN SegLength = BowtieSegmentLengthhwln 'wavelengths, FIXED [SEE HEADER NOTE ON SEGMENTATION]
StartFreqMHz! = 800! : StopFreqMHz! = 12000! : FreqStepMHz! = 100! : NumFreqs% = 1 + (StopFreqMHz!-StartFreqMHz!)/FreqStepMHz!
FR1$ = "FR 0,"+Int2String$(NumFreqs%)+",0,0,"+FP2String$(StartFreqMHz!)+","+FP2String$(StopFreqMHz!)+","+FP2String$(FreqStepMHz!)
PROCESS SET PRIORITY %NORMAL_PRIORITY_CLASS 'NORMAL PRIORITY TO AVOID PROBLEMS WRITING/READING NEC FILES
PROCESS SET PRIORITY %REALTIME_PRIORITY_CLASS 'PREEMPTS ALL OTHER PROCESSES -> CAN CAUSE PROBLEMS...
N% = FREEFILE
OPEN "BOWTIE.NEC" FOR OUTPUT AS #N%
FileID$ = REMOVE$(DATE$+TIME$,ANY Alphabet$+" -:/")
PRINT #N%, "CM File: BOWTIE.NEC"
PRINT #N%, "CM R-LOADED BOWTIE IN FREE SPACE WITH"
PRINT #N%, "CM Zo AS AN OPTIMIZATION PARAMETER."
PRINT #N%, "CM Antenna in Y-Z plane."
PRINT #N%, "CM Run ID: "+RunIDs
PRINT #N%, "CM Fitness function:
PRINT #N%, "CM [Min(Eff)+5*Min(Gmax)]/[|Zo-MaxRin|*(MaxVSWR-MinVSWR)*(MaxXin-MinXin)]
PRINT #N%, "CM Arm Length = "+REMOVE$(STR$(ArmLengthMeters),ANY" ")+" meters"
PRINT #N%, "CM Bowtie HALF Angle = "+REMOVE$(STR$(ROUND(R(p%,2,j&),2)),ANY" ")+" degrees"
PRINT #N%, "CM Z0 = "+REMOVE$(STR$(Z0),ANY" ")+" ohms"
PRINT #N%, "CM Rload = "+REMOVE$(STR$(ROUND(LoadResistance10hms,2)),ANY" ")+" ohms"
PRINT #N%, "CM Loaded Seg # = "+REMOVE$(STR$(LoadedSegNum1%),ANY" ")+" "+REMOVE$(STR$(Nsegs%),ANY" ")
PRINT #N%, "CM File ID = "+FileID$
PRINT #N%, "CM Nd = "+STR$(Nd%)+" , p = "+STR$(p%)+" , j = "+STR$(j&)
PRINT #N%, "CE"

x1 = 0## : x2 = x1 : y1 = -0.01## : y2 = -y1 : z1 = 0## : z2 = z1 'feed wire coords (wvln)
PRINT
#N%, "Gw1,3,"+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2String$(a_meters)      'feed
wire, 3 segs
y1 = 0.01## : y2 = ROUND(y1+ArmLengthMeters*COS(AngleRadians),3) : z1 = 0## : z2 = ROUND(ArmLengthMeters*SIN(AngleRadians),3) 'upper right arm
PRINT
#N%, "Gw2,"+Int2String$(Nsegs%)+","+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2Stri
ng$(a_meters) 'feed wire, 3 segs
y1 = 0.01## : y2 = ROUND(y1+ArmLengthMeters*COS(AngleRadians),3) : z1 = 0## : z2 = -ROUND(ArmLengthMeters*SIN(AngleRadians),3) 'lower right arm
PRINT
#N%, "Gw3,"+Int2String$(Nsegs%)+","+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2Stri
ng$(a_meters) 'feed wire, 3 segs
y1 = ROUND(0.01##+ArmLengthMeters*COS(AngleRadians),3) : y2 = y1 : z1 = ROUND(ArmLengthMeters*SIN(AngleRadians),3) : z2 = -z1 'right arm vertical
connecting wire

```

```

PRINT
#N%, "Gw4,"+Int2String$(Nsegs%)+","+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2Stri
ng$(a_meters) 'feed wire, 3 segs

y1 = -0.01## : y2 = ROUND(y1-ArmLengthMeters*COS(AngleRadians),3) : z1 = 0## : z2 = ROUND(ArmLengthMeters*SIN(AngleRadians),3) 'upper left arm
PRINT
#N%, "Gw5,"+Int2String$(Nsegs%)+","+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2Stri
ng$(a_meters) 'feed wire, 3 segs

y1 = -0.01## : y2 = ROUND(y1-ArmLengthMeters*COS(AngleRadians),3) : z1 = 0## : z2 = -ROUND(ArmLengthMeters*SIN(AngleRadians),3) 'lower left arm
PRINT
#N%, "Gw6,"+Int2String$(Nsegs%)+","+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2Stri
ng$(a_meters) 'feed wire, 3 segs

y1 = -ROUND(0.01##*ArmLengthMeters*COS(AngleRadians),3) : y2 = y1 : z1 = ROUND(ArmLengthMeters*SIN(AngleRadians),3) : z2 = -z1 'left arm vertical
connecting wire
PRINT
#N%, "Gw7,"+Int2String$(Nsegs%)+","+FP2String$(x1)+" ,"+FP2String$(y1)+" ,"+FP2String$(z1)+" ,"+FP2String$(x2)+" ,"+FP2String$(y2)+" ,"+FP2String$(z2)+" ,"+FP2Stri
ng$(a_meters) 'feed wire, 3 segs

PRINT #N%, "GE"

----- LOAD RESISTOR #1 -----
IF LoadResistance1ohms <> 0## THEN 'load bowtie only if loading resistance is not zero
    PRINT #N%, "LD0,2 ,"+Int2String$(LoadedSegNum1%)+","+Int2String$(LoadedSegNum1%)+",
        +FP2String$((ROUND(LoadResistance1ohms,2))+"0.,0." 'load upper right arm
    PRINT #N%, "LD0,3 ,"+Int2String$(LoadedSegNum1%)+","+Int2String$(LoadedSegNum1%)+",
        +FP2String$((ROUND(LoadResistance1ohms,2))+"0.,0." 'load lower right arm
    PRINT #N%, "LD0,5 ,"+Int2String$(LoadedSegNum1%)+","+Int2String$(LoadedSegNum1%)+",
        +FP2String$((ROUND(LoadResistance1ohms,2))+"0.,0." 'load upper left arm
    PRINT #N%, "LD0,6 ,"+Int2String$(LoadedSegNum1%)+","+Int2String$(LoadedSegNum1%)+",
        +FP2String$((ROUND(LoadResistance1ohms,2))+"0.,0." 'load lower left arm
END IF

----- LOAD RESISTOR #2 -----
IF LoadResistance2ohms <> 0## THEN 'load bowtie only if loading resistance is not zero
    PRINT #N%, "LD0,2 ,"+Int2String$(LoadedSegNum2%)+","+Int2String$(LoadedSegNum2%)+",
        +FP2String$((ROUND(LoadResistance2ohms,2))+"0.,0." 'load upper right arm
    PRINT #N%, "LD0,3 ,"+Int2String$(LoadedSegNum2%)+","+Int2String$(LoadedSegNum2%)+",
        +FP2String$((ROUND(LoadResistance2ohms,2))+"0.,0." 'load lower right arm
    PRINT #N%, "LD0,5 ,"+Int2String$(LoadedSegNum2%)+","+Int2String$(LoadedSegNum2%)+",
        +FP2String$((ROUND(LoadResistance2ohms,2))+"0.,0." 'load upper left arm
    PRINT #N%, "LD0,6 ,"+Int2String$(LoadedSegNum2%)+","+Int2String$(LoadedSegNum2%)+",
        +FP2String$((ROUND(LoadResistance2ohms,2))+"0.,0." 'load lower left arm
END IF

PRINT #N%, FR1$ ' frequency card
PRINT #N%, "EX 0,1,2,1,1,.0." 'excite center segment in DRIVEN ELEMENT #2 with 1+j0 volts
PRINT #N%, "RP 0 ,"+Int2String$(NumRadPattAngles%)+",1,1001,0.,0.,"+FP2String2$(ROUND(90##/(NumRadPattAngles%-1),2))+",0.,100000." 'vertical
radiation pattern at Phi=0 (+x-axis)
PRINT #N%, "EN"

CLOSE #N%
SHELL "NEC2D_200_02-22-2011.EXE",0
SHELL "NEC41D_4K_053011.EXE",0

CALL
GetNECdata("BOWTIE.OUT",NumFreqs%,NumRadPattAngles%,zo,FrequencyMHz(),RadEfficiencyPCT(),MaxGainDBI(),MinGainDBI(),RinOhms(),XinOhms(),VSWR(),ForwardGainDB
i(),FileStatus$,FileID$)

Fitness = -98765## 'default value
IF FileStatus$ = "OK" THEN
    MinimumRadiationEfficiency = RadEfficiencyPCT(1) : MinimumMaxGain = MaxGainDBI(1) : MinVSWR = VSWR(1) : MaxVSWR = VSWR(1)
    MinRin = RinOhms(1) : MaxRin = RinOhms(1) : MinXin = XinOhms(1) : MaxXin = XinOhms(1)
    MinFwdGain = ForwardGainDBI(1) : MaxFwdGain = ForwardGainDBI(1)

    FOR i% = 1 TO NumFreqs%
        IF RadEfficiencyPCT(i%) <= MinimumRadiationEfficiency THEN MinimumRadiationEfficiency = RadEfficiencyPCT(i%)
        IF MinimumRadiationEfficiency < ### THEN EXIT 'bad run - use default fitness & exit
        IF RadEfficiencyPCT(i%) >= MaximumRadiationEfficiency THEN MaximumRadiationEfficiency = RadEfficiencyPCT(i%)
        IF MaxGainDBI(i%) <= MinimumMaxGain THEN MinimumMaxGain = MaxGainDBI(i%)
        IF MaxGainDBI(i%) >= MaximumMaxGain THEN MaximumMaxGain = MaxGainDBI(i%)
        IF VSWR(i%) <= MinVSWR THEN MinVSWR = VSWR(i%)
        IF VSWR(i%) >= MaxVSWR THEN MaxVSWR = VSWR(i%)
        IF RinOhms(i%) <= MinRin THEN MinRin = RinOhms(i%)
        IF RinOhms(i%) >= MaxRin THEN MaxRin = RinOhms(i%)
        IF XinOhms(i%) <= MinXin THEN MinXin = XinOhms(i%)
        IF XinOhms(i%) >= MaxXin THEN MaxXin = XinOhms(i%)
        IF ForwardGainDBI(i%) >= MaxFwdGain THEN MaxFwdGain = ForwardGainDBI(i%)
        IF ForwardGainDBI(i%) <= MinFwdGain THEN MinFwdGain = ForwardGainDBI(i%)
    NEXT i%
    A = BowtieFitnessCoefficients(1) : B = BowtieFitnessCoefficients(2) : C = BowtieFitnessCoefficients(3) 'use this notation for consistency
'NOTE: Forward gain is in direction on +x-axis.
    Fitness = (A*ForwardGainDBi-B*ABS(zo-MaxRin)-C*(MAX(ABS(MaxXin),ABS(MinXin))))/(A+B+C) 'NOTE: THIS IS ONE OF AN INFINITY OF FITNESS FUNCTIONS.
'CHANGING THE FUNCTION CHANGES THE DECISION SPACE LANDSCAPE
'RESULTING IN COMPLETELY DIFFERENT ANTENNA DESIGNS.

    IF MinimumRadiationEfficiency >= 0## THEN Fitness = (MinimumRadiationEfficiency+5##*MinimumMaxGain)/(ABS(zo-MaxRin)*(MaxVSWR-MinVSWR)*(MaxXin-
MinXin)) 'compute only if run is OK and min eff >= 0
END IF

N% = FREEFILE
OPEN "BOWTIE.NEC" FOR APPEND AS #N%
PRINT #N%, "CM R-LOADED BOWTIE IN FREE SPACE WITH"
PRINT #N%, "CM ZO AS AN OPTIMIZATION PARAMETER."
PRINT #N%, "Run ID: "+RunID$
PRINT #N%, USING$ ("Fitness      =# #####",Fitness)
PRINT #N%, "Min/Max Gain(dBi) Min/Max      =" +STR$(MinFwdGain)+"/" +STR$(MaxFwdGain)
PRINT #N%, "Min/Max Gain(dB) Min/Max      =" +STR$(ROUND(MinVSWR,2))+"/" +STR$(ROUND(MaxVSWR,2))+"/" +REMOVE$(STR$(zo),ANY" ")
PRINT #N%, "Min/Max Gain(dB) Min/Max      =" +STR$(ROUND(MinRin,2))+"/" +STR$(ROUND(MaxRin,2))
PRINT #N%, "Min/Max Gain(dB) Min/Max      =" +STR$(ROUND(MinXin,2))+"/" +STR$(ROUND(MaxXin,2))
PRINT #N%, "Max(dB) Min/Max Gain      =" +STR$(ROUND(MinimumMaxGain,2))+"/" +STR$(ROUND(MaximumMaxGain,2))
PRINT #N%, "Eff(%) Min/Max Gain      =" +STR$(ROUND(MinGainDBI,2))+"/" +STR$(ROUND(MaxGainDBI,2))
PRINT #N%, ""

CLOSE #N%
N% = FREEFILE
OPEN "BOWTIE.OUT" FOR APPEND AS #N%
PRINT #N%, ""
PRINT #N%, "CM R-LOADED BOWTIE IN FREE SPACE WITH"
PRINT #N%, "CM ZO AS AN OPTIMIZATION PARAMETER."
PRINT #N%, "Run ID: "+RunID$
PRINT #N%, USING$ ("Fitness      =# #####",Fitness)
PRINT #N%, "Fwd Gain (dbi) Min/Max      =" +STR$(MinFwdGain)+"/" +STR$(MaxFwdGain)
PRINT #N%, "VSWR Min/Max      =" +STR$(ROUND(MinVSWR,2))+"/" +STR$(ROUND(MaxVSWR,2))+"/" +REMOVE$(STR$(zo),ANY" ")

```

```

PRINT #N%, "Rin Min/Max      =" +STR$(ROUND(MinRin,2)) +"/" +STR$(ROUND(MaxRin,2))
PRINT #N%, "Min Min/Max      =" +STR$(ROUND(MinMin,2)) +"/" +STR$(ROUND(MaxMin,2))
PRINT #N%, "Gmax(DBI) Min/Max  =" +STR$(ROUND(MinimumMaxGain,2)) +"/" +STR$(ROUND(MaximumMaxGain,2))
PRINT #N%, "Eff(%) Min/Max     =" +STR$(ROUND(MinimumRadiationEfficiency,2)) +"/" +STR$(ROUND(MaximumRadiationEfficiency,2))
PRINT #N%
CLOSE #N%
;----- ANGLES ----- ;----- POWER GAINS ----- ;----- POLARIZATION ----- ;----- E(THETA) ----- ;----- E(PHI) -----
;----- DEGREES DEGREES VERT. HOR. TOTAL AXIAL TILT SENSE MAGNITUDE PHASE MAGNITUDE PHASE
;----- 90.00 0.00 3.91 -999.99 3.91 0.0000 0.00 LINEAR 1.29504E-04 5.37 0.0000E+00 -5.24
;----- 10 20 30 40 50 60 70 80 90 100 110 120
BOWTIE = Fitness
END FUNCTION 'BOWTIE()

'-----
SUB ReplaceCommentCard(NECfile$)
LOCAL N%, M%
LOCAL Lyne$

N% = FREEFILE : OPEN NECfile$ FOR INPUT AS #N%
M% = FREEFILE : OPEN "NECtemp" FOR OUTPUT AS #M%
WHILE NOT EOF(N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$, "BOWTIE.NEC") > 0 THEN REPLACE "BOWTIE.NEC" WITH "BESTBOWTIE.NEC" IN Lyne$
    PRINT #M%, Lyne$
WEND
CLOSE #M% : CLOSE #N%
KILL NecFile$ : NAME "NECtemp" AS NECfile$
END SUB
'-----

FUNCTION FP2String2$(X!)
LOCAL A$
A$=LTRIM$(RTRIM$(STR$(X!)))
IF TALLY(A$,".") = 0# THEN A$ = A$ + "."
FP2String2$ = A$
END FUNCTION
'---

FUNCTION FP2String$(X)
LOCAL A$
A$=LTRIM$(RTRIM$(STR$(X)))
IF TALLY(A$,".") = 0## THEN A$ = A$ + "."
FP2String$ = A$
END FUNCTION
'---

FUNCTION Int2String$(X%)
LOCAL A$
A$=LTRIM$(RTRIM$(STR$(X%)))
Int2String$ = A$
END FUNCTION
'---

SUB
GetNECdata(NECoutputFile$, NumFreqs%, NumRadPattAngles%, Zo, FrequencyMHz(), RadEfficiencyPCT(), MaxGainDBI(), MinGainDBI(), RinOhms(), XinOhms(), VSWR(), ForwardGainDBI(), Filestatus$, FileID$)
LOCAL N%, idx%, AngleNum%
LOCAL Lyne$, Dum$
LOCAL GmaxDBI, GminDBI, FwdGainDBI AS EXT
REDIM FrequencyMHz(1 TO NumFreqs%), RadEfficiencyPCT(1 TO NumFreqs%), MaxGainDBI(1 TO NumFreqs%), MinGainDBI(1 TO NumFreqs%), _
RinOhms(1 TO NumFreqs%), XinOhms(1 TO NumFreqs%), VSWR(1 TO NumFreqs%), ForwardGainDBI(1 TO NumFreqs%)
Filestatus$ = "NOK"
OPEN NECoutputFile$ FOR INPUT AS #N%
WHILE NOT EOF(N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$, "RUN TIME") > 0 THEN Filestatus$ = "OK"
WEND
CLOSE #N%
IF Filestatus$ <> "OK" THEN EXIT SUB
OPEN NECoutputFile$ FOR INPUT AS #N%
idx% = 1
WHILE NOT EOF(N%)
    LINE INPUT #N%, Lyne$
    IF INSTR(Lyne$, "File ID") > 0 THEN 'CHECK THAT NEC OUTPUT FILE WAS COMPUTED FROM CURRENT NEC INPUT FILE BY COMPARING FILE ID's (TO AVOID
    CACHE/BUFFER PROBLEMS CREATED BY OS)
        IF FileID$ <> REMOVE$(Lyne$, ANY Alphabet$+" ") THEN MSGBOX("WARNING! NEC I/O File ID's Don't Match!" +CHR$(13)+Lyne$ =
"+Lyne$+CHR$(13)+"FileID$ = "+FileID$)
        END IF
        IF INSTR(Lyne$, "FREQUENCY=") > 0 THEN
            Lyne$ = REMOVE$(Lyne$, "MHz") : Lyne$ = REMOVE$(Lyne$, "FREQUENCY=") : FrequencyMHz(idx%) = VAL(Lyne$)
        'MSGBOX("idx=" +STR$(idx%) + " F=" +STR$(FrequencyMHz(idx%)))
        END IF
        IF INSTR(Lyne$, "INPUT PARAMETERS") > 0 THEN
            LINE INPUT #N%, Dum$ : LINE INPUT #N%, Dum$ : LINE INPUT #N%, Dum$ 'skip three lines
            LINE INPUT #N%, Lyne$ 'input next line with impedance data
            Rinohms(idx%) = VAL(MID$(Lyne$, 61, 12)) : Xinohms(idx%) = VAL(MID$(Lyne$, 73, 12)) : VSWR(idx%) =
StandingwaveRatio(Zo, Rinohms(idx%), Xinohms(idx%))
        END IF
        IF INSTR(Lyne$, "EFFICIENCY") > 0 THEN RadEfficiencyPCT(idx%) = VAL(REMOVE$(Lyne$, ANY Alphabet$+" "))
        IF INSTR(Lyne$, "E(THETA)") > 0 THEN
            LINE INPUT #N%, Dum$ : LINE INPUT #N%, Dum$ 'skip two lines
            GmaxDBI = -9999## : GminDBI = -GmaxDBI
            FOR AngleNum% = 1 TO NumRadPattAngles%
END IF

```



```

' PROCESS SET PRIORITY %REALTIME_PRIORITY_CLASS 'PREEMPTS ALL OTHER PROCESSES -> CAN CAUSE PROBLEMS...
N% = FREEFILE
OPEN "YAGI.NEC" FOR OUTPUT AS #N%
FileID$ = REMOVE$(DATE$+TIME$,ANY Alphabet$" -:/")
PRINT #N%,"CM File: YAGI.NEC"
PRINT #N%,"CM YAGI ARRAY IN FREE SPACE"
PRINT #N%,"CM Band center frequency, FC = 299.8 MHz"
PRINT #N%,"CM Run ID: "+RunID$
PRINT #N%,"CM Fitness function:
PRINT #N%,"CM Gfwd(L)-5*2*VSWR(L)+Gfwd(M)-4*VSWR(M)+Gfwd(U)-2*VSWR(U)/5"
PRINT #N%,"CM where L,M,U are lower/mid/upper frequencies"
PRINT #N%,"CM MaxFwd[(Zo-MaxRin)*(MaxVSWR-MinVSWR)*(MaxXin-MinXin)]"
PRINT #N%,"CM (A*MaxFwdGain-B*(Zo-MaxRin)-C*(MAX(|MaxXin|,|MinXin|)))*D*(MaxVSWR-MinVSWR)/(A+B+C+D)"
PRINT #N%,"CM where "+yagiCoefficients$
PRINT #N%,"CM ZO=" +REMOVE$(STR$(Zo),ANY" ")+" ohms"
PRINT #N%,"CM File ID "+FileID$
PRINT #N%,"CM Nd=" +STR$(Nd)+" , p="STR$(p%)+" , j=" +STR$(j&)
PRINT #N%,"CE"

FOR EleNum% = 1 TO NumYagiElements%
    BoomDistance = 0#
    FOR i% = 1 TO EleNum% 'add up element spacings to get position along boom
        Spacing = ROUND(R(p%,i%,j&),3) 'element spacing from previous element, WAVELENGTHS (note Reflector spacing = 0 always)
        BoomDistance = BoomDistance + Spacing
    NEXT i%
    Length = R(p%,EleNum%+NumYagiElements%,j&) 'element length, WAVELENGTHS
    NSegs% = 9 'use same # segs each element unless seg LENGTH is FIXED, in which case use a different # segs in each element as follows
    IF YagiSegmentLength$ = "FIXED" THEN 'adjust # segments in each element and change element length to be an integer # of segments
        NSegs% = INT(Length/SegLength)
        NSegs% = 2^(NSegs%\2)+1 'must be odd # to preserve symmetry about excitation at center
        Length = NSegs%*SegLength 'round element length to an integer multiple of segment length to guaranty segment alignment as recommended in
    END IF
    IF EleNum% = 2 THEN ExcitedSegment% = NSegs%\2+1
    x1 = ROUND(BoomDistance,3) : x2 = x1 'yagi elements are parallel to Y-axis arrayed along +X-axis. Round spacings & length to nearest 0.001
    wavelength.
    y1 = ROUND(-Length/2##,3) : y2 = -y1
    PRINT
#N%,"GW"+Int2String$(EleNum%)+"."+Int2String$(NSegs%)+"."+FP2String$(x1)+"."+FP2String$(y1)+"_0."+"FP2String$(x2)+"."+FP2String$(y2)+"_0."+"FP2String$(a_wv
    ln)

    NEXT EleNum%
    PRINT #N%,"GE"
    PRINT #N%,"FR1$ ' frequency card
    PRINT #N%,"EX 0,2,"+Int2String$(ExcitedSegment%)+",1,1.,0." 'excite center segment in DRIVEN ELEMENT #2 with 1+j0 volts
    PRINT #N%,"RP 0,"+Int2String$(NumRadPattAngles%)+",1,1001,0.,0.,"+FP2String2$(ROUND(90#/((NumRadPattAngles%-1),2))+",0.,100000." 'vertical
radiation pattern at Phi=0 (+x-axis)
    PRINT #N%,"EN"
    CLOSE #N%
    SHELL "NEC2D_200_02-22-2011.EXE",0
    SHELL "NEC4ID_4K_053011.EXE",0
    GetNECdata(NumFreqs%,NumRadPattAngles%,zo,FrequencyMHz(),RadEfficiencyPCT(),MaxGainDBI(),MinGainDBI(),RinOhms(),XinOhms(),VSWR(),ForwardGainDBI,Filestatus$,
    ,FileID$) CALL
    GetNECdata("YAGI_OUT",NumFreqs%,NumRadPattAngles%,zo,FrequencyMHz(),RadEfficiencyPCT(),MaxGainDBI(),MinGainDBI(),RinOhms(),XinOhms(),VSWR(),ForwardGainDBI(
    ),FileStatus$,FileID$) CALL
    Fitness = -98765## 'default value
    IF FileStatus$ = "OK" THEN
        MinimumRadiationEfficiency = RadEfficiencyPCT(1) : MinimumMaxGain = MaxGainDBI(1) : MinVSWR = VSWR(1) : MaxVSWR = VSWR(1)
        MinRin = RinOhms(1) : MaxRin = RinOhms(1) : MinXin = XinOhms(1) : MaxXin = XinOhms(1)
        MinFwdGain = ForwardGainDBI(1) : MaxFwdGain = ForwardGainDBI(1)
        FOR i% = 1 TO NumFreqs%
            IF RadEfficiencyPCT(i%) <= MinimumRadiationEfficiency THEN MinimumRadiationEfficiency = RadEfficiencyPCT(i%)
            IF RadEfficiencyPCT(i%) <= MaximumRadiationEfficiency THEN MaximumRadiationEfficiency = RadEfficiencyPCT(i%)
            IF MaxGainDBI(i%) <= MinimumMaxGain THEN MinimumMaxGain = MaxGainDBI(i%)
            IF MaxGainDBI(i%) >= MaximumMaxGain THEN MaximumMaxGain = MaxGainDBI(i%)
            IF VSWR(i%) <= MinVSWR THEN MinVSWR = VSWR(i%)
            IF VSWR(i%) >= MaxVSWR THEN MaxVSWR = VSWR(i%)
            IF RinOhms(i%) <= MinRin THEN MinRin = RinOhms(i%)
            IF RinOhms(i%) >= MaxRin THEN MaxRin = RinOhms(i%)
            IF XinOhms(i%) <= MinXin THEN MinXin = XinOhms(i%)
            IF XinOhms(i%) >= MaxXin THEN MaxXin = XinOhms(i%)
            IF ForwardGainDBI(i%) >= MaxFwdGain THEN MaxFwdGain = ForwardGainDBI(i%)
            IF ForwardGainDBI(i%) <= MinFwdGain THEN MinFwdGain = ForwardGainDBI(i%)
        NEXT i%
        A = YagiFitnessCoefficients(1) : B = YagiFitnessCoefficients(2) : C = YagiFitnessCoefficients(3) : D = YagiFitnessCoefficients(4) 'use this
notation for consistency
        Fitness = (A*MaxFwdGain-B*ABS(Zo-MaxRin)-C*(MAX(ABS(MaxXin),ABS(MinXin)))-D*(MaxVSWR-MinVSWR))/(A+B+C+D) 'Yagi radiation efficiency = 100%
because it isn't loaded
        'NOTE: THIS IS ONE OF AN INFINITY OF FITNESS FUNCTIONS. CHANGING THE FUNCTION CHANGES THE DECISION SPACE LANDSCAPE RESULTING IN COMPLETELY
        DIFFERENT ANTENNA DESIGNS.
        Fitness = MaxFwdGain/(ABS(Zo-MaxRin)*(MaxVSWR-MinVSWR)*(MaxXin-MinXin)) 'compute only if run is OK
        Fitness = ForwardGainDBI(1)/5##-2##*VSWR(1)+ForwardGainDBI(NumFreqs%\2+1)-4##*VSWR(NumFreqs%\2+1)+ForwardGainDBI(NumFreqs%)-2##*VSWR(NumFreqs%)/5##
    END IF
    N% = FREEFILE
    OPEN "YAGI.NEC" FOR APPEND AS #N%
    PRINT #N%,""
    PRINT #N%,"YAGI ARRAY IN FREE SPACE"
    PRINT #N%,"CM Band center frequency, FC = 299.8 MHz"
    PRINT #N%,"Run ID: "+RunID$
    PRINT #N%,USING$("Fitness" =#.####^#####",Fitness)
    PRINT #N%,"Max Fwd Gain (dB) =" +STR$(MaxFwdGain)

```

```

PRINT #N%, "VSWR Min/Max      =" +STR$(ROUND(MinVSWR,2))+"/"+STR$(ROUND(MaxVSWR,2))+"/"+REMOVE$(STR$(Zo),ANY" ")
PRINT #N%, "Rin Min/Max       =" +STR$(ROUND(MinRin,2))+"/"+STR$(ROUND(MaxRin,2))
PRINT #N%, "Xin Min/Max       =" +STR$(ROUND(MinXin,2))+"/"+STR$(ROUND(MaxXin,2))
PRINT #N%, "Cmax(dB) Min/Max   =" +STR$(ROUND(MinimumMaxGain,2))+"/"+STR$(ROUND(MaximumMaxGain,2))
PRINT #N%, "Eff(%) Min/Max      =" +STR$(ROUND(MinimumRadiationEfficiency,2))+"/"+STR$(ROUND(MaximumRadiationEfficiency,2))
PRINT #N%, ""
CLOSE #N%
N% = FREEFILE
OPEN "YAGI.OUT", FOR APPEND AS #N%
PRINT #N%, "YAGI ARRAY IN FREE SPACE"
PRINT #N%, "CM Band center frequency, FC = 299.8 MHz"
PRINT #N%, "Run ID: +RunID$
PRINT #N%, USINGS ("Fitness      =#.####^AAAAA", Fitness)
PRINT #N%, "Max Fwd Gain (dbi) ="+STR$(MaxFwdGain)
PRINT #N%, "VSWR Min/Max      =" +STR$(ROUND(MinVSWR,2))+"/"+STR$(ROUND(MaxVSWR,2))+"/"+REMOVE$(STR$(Zo),ANY" ")
PRINT #N%, "Rin Min/Max       =" +STR$(ROUND(MinRin,2))+"/"+STR$(ROUND(MaxRin,2))
PRINT #N%, "Xin Min/Max       =" +STR$(ROUND(MinXin,2))+"/"+STR$(ROUND(MaxXin,2))
PRINT #N%, "Cmax(dB) Min/Max   =" +STR$(ROUND(MinimumMaxGain,2))+"/"+STR$(ROUND(MaximumMaxGain,2))
PRINT #N%, "Eff(%) Min/Max      =" +STR$(ROUND(MinimumRadiationEfficiency,2))+"/"+STR$(ROUND(MaximumRadiationEfficiency,2))
PRINT #N%, ""
CLOSE #N%
' - - ANGLES - -    - POWER GAINS -    - - - POLARIZATION - - - E(THETA) - - - - - E(PHI) - - -
DEGREES DEGREES     VERT. HOR. TOTAL      AXIAL    TILT SENSE MAGNITUDE PHASE MAGNITUDE PHASE
90.00   0.00      3.91 -999.99  3.91  0.00000  0.00 LINEAR 1.29504E-04  5.37  0.0000E+00 -5.24
123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x123456789x
10      20      30      40      50      60      70      80      90      100     110     120
YAGI_ARRAY = Fitness
END FUNCTION 'YAGI_ARRAY()
'-----
***** END PROGRAM 'CFO_R_ONLY_LOADED_BOWTIE_YAGI_07-10-2011.BAS' *****

```

Appendix II

CM File: BESTBOWTIE.NEC
 CM R-LOADED BOWTIE IN FREE SPACE WITH
 CM Zo AS AN OPTIMIZATION PARAMETER.
 CM Antenna in Y-Z plane.
 CM Run ID: 07022011_221747
 CM Fitness function:
 CM $[\text{Min}(\text{Eff}) + 5^{\circ} \text{Min}(\text{Gmax})] / [\text{Zo} \cdot \text{MaxRin}]^{\alpha} (\text{MaxVSWR} - \text{MinVSWR})^{\beta} (\text{Maxxin} - \text{Minxin})]$
 CM Arm Length = .051 meters
 CM Bowtie HALF Angle = 39.4 degrees
 CM Zin = 715 ohms
 CM Rload = 166.93 ohms
 CM Loaded SParam = 6/9
 CM File ID: 0703201125840
 CM Nd = 5 p = 1, j = 35
 R-LOADED BOWTIE ANTENNA IN FREE SPACE: SUMMARY NEC DATA

F(MHz)	Rad Eff (%)	Max Gain (dBi)	Min Gain (dBi)	Fwd Gain (dBi)	Rin (ohms)	Xin (ohms)	VSWR//715
200.00	0.000	-13.22	-13.23	-13.22	52.28	-808.22	31.19
215.00	0.000	-12.62	-12.64	-12.62	52.79	-745.39	28.30
230.00	0.000	-12.07	-12.08	-12.07	53.33	-690.31	25.94
245.00	0.000	-11.55	-11.57	-11.55	53.92	-641.56	23.97
260.00	0.000	-11.07	-11.09	-11.07	54.54	-598.04	22.31
275.00	0.370	-10.62	-10.65	-10.62	55.20	-558.90	20.89
290.00	0.960	-10.20	-10.23	-10.20	55.91	-523.46	19.67
305.00	1.570	-9.80	-9.83	-9.80	56.66	-491.17	18.60
320.00	2.200	-9.42	-9.46	-9.42	57.45	-461.59	17.66
335.00	2.840	-9.07	-9.11	-9.07	58.28	-434.35	16.82
350.00	3.500	-8.73	-8.78	-8.73	59.16	-409.36	16.06
365.00	4.180	-8.42	-8.46	-8.42	60.08	-385.75	15.38
380.00	4.860	-8.11	-8.17	-8.11	61.05	-363.93	14.76
395.00	5.560	-7.83	-7.88	-7.83	62.06	-343.50	14.20
410.00	6.260	-7.55	-7.61	-7.55	63.13	-324.33	13.67
425.00	6.980	-7.29	-7.36	-7.29	64.24	-306.26	13.19
440.00	7.690	-7.04	-7.12	-7.04	65.40	-289.19	12.73
455.00	8.420	-6.81	-6.88	-6.81	66.61	-273.02	12.31
470.00	9.140	-6.58	-6.66	-6.58	67.88	-257.66	11.91
485.00	9.870	-6.36	-6.45	-6.36	69.19	-243.04	11.54
500.00	10.610	-6.15	-6.25	-6.15	70.57	-229.10	11.18
515.00	11.340	-5.96	-6.06	-5.96	71.99	-215.77	10.84
530.00	12.070	-5.77	-5.87	-5.77	73.47	-203.00	10.52
545.00	12.800	-5.58	-5.69	-5.58	75.02	-190.74	10.22
560.00	13.530	-5.41	-5.53	-5.41	76.62	-178.97	9.92
575.00	14.250	-5.24	-5.36	-5.24	78.28	-167.63	9.64
590.00	14.970	-5.08	-5.21	-5.08	80.00	-156.71	9.37
605.00	15.680	-4.92	-5.06	-4.92	81.79	-146.16	9.11
620.00	16.390	-4.77	-4.92	-4.77	83.64	-136.96	8.86
635.00	17.100	-4.63	-4.78	-4.63	85.60	-126.60	8.62
650.00	17.790	-4.49	-4.65	-4.49	87.54	-116.53	8.39
665.00	18.480	-4.35	-4.52	-4.35	89.60	-107.26	8.16
680.00	19.160	-4.22	-4.40	-4.22	91.73	-98.26	7.94
695.00	19.830	-4.10	-4.29	-4.10	93.93	-89.51	7.73
710.00	20.490	-3.98	-4.18	-3.98	96.20	-81.01	7.53
725.00	21.140	-3.86	-4.07	-3.86	98.55	-72.73	7.33
740.00	21.790	-3.75	-3.97	-3.75	100.98	-64.68	7.14
755.00	22.420	-3.64	-3.87	-3.64	103.49	-56.83	6.95
770.00	23.040	-3.54	-3.77	-3.54	106.08	-49.18	6.77
785.00	23.650	-3.44	-3.68	-3.44	108.76	-41.72	6.60
800.00	24.250	-3.34	-3.59	-3.34	111.51	-34.45	6.43
815.00	24.820	-3.24	-3.51	-3.24	114.34	-27.34	6.26
830.00	25.400	-3.15	-3.43	-3.15	117.27	-20.42	6.10
845.00	25.960	-3.06	-3.35	-3.06	120.29	-13.67	5.95
860.00	26.520	-2.97	-3.28	-2.97	123.40	-7.09	5.79
875.00	27.060	-2.89	-3.20	-2.89	126.60	-0.66	5.65
890.00	27.590	-2.81	-3.13	-2.81	130.90	5.60	5.50
905.00	28.110	-2.73	-3.07	-2.73	133.89	5.37	5.37
920.00	28.610	-2.65	-3.01	-2.65	136.78	5.16	5.23
935.00	29.100	-2.58	-2.94	-2.58	140.37	5.05	5.10
950.00	29.580	-2.51	-2.89	-2.51	144.05	4.99	4.97
965.00	30.050	-2.44	-2.83	-2.44	147.84	4.58	4.85
980.00	30.510	-2.37	-2.78	-2.37	151.72	3.90	4.73
995.00	30.950	-2.30	-2.72	-2.30	155.70	4.08	4.61
1010.00	31.380	-2.24	-2.67	-2.24	159.79	5.09	4.50
1025.00	31.800	-2.18	-2.63	-2.18	163.97	54.94	4.39
1040.00	32.210	-2.12	-2.58	-2.12	168.26	59.62	4.28
1055.00	32.610	-2.06	-2.54	-2.06	172.64	64.14	4.18
1070.00	32.990	-2.00	-2.50	-2.00	177.13	68.49	4.08
1085.00	33.360	-1.94	-2.46	-1.94	181.71	72.67	3.98
1100.00	33.720	-1.89	-2.42	-1.89	186.38	76.66	3.88
1115.00	34.070	-1.84	-2.38	-1.84	191.16	80.48	3.79
1130.00	34.410	-1.78	-2.35	-1.78	196.02	84.10	3.70
1145.00	34.730	-1.73	-2.31	-1.73	200.97	87.54	3.62
1160.00	35.050	-1.68	-2.28	-1.68	206.00	90.77	3.53
1175.00	35.350	-1.63	-2.25	-1.63	211.12	93.81	3.45
1190.00	35.640	-1.59	-2.22	-1.59	216.31	96.63	3.37
1205.00	36.920	-1.54	-2.20	-1.54	221.58	99.44	3.30
1220.00	36.190	-1.50	-2.17	-1.50	226.91	101.63	3.22
1235.00	36.450	-1.45	-2.15	-1.45	232.32	103.80	3.15
1250.00	36.690	-1.41	-2.13	-1.41	237.76	105.73	3.08
1265.00	36.930	-1.37	-2.10	-1.37	243.25	107.43	3.01
1280.00	37.150	-1.33	-2.08	-1.33	248.77	108.88	2.95
1295.00	37.360	-1.29	-2.07	-1.29	254.32	110.09	2.89
1310.00	37.570	-1.25	-2.05	-1.25	259.89	111.04	2.83
1325.00	37.760	-1.21	-2.03	-1.21	265.46	111.74	2.77
1340.00	37.940	-1.17	-2.02	-1.17	271.03	112.18	2.71
1355.00	38.110	-1.13	-2.00	-1.13	276.58	112.35	2.66
1370.00	38.270	-1.10	-1.99	-1.10	282.11	112.26	2.61
1385.00	38.410	-1.06	-1.98	-1.06	287.59	111.89	2.56
1400.00	38.550	-1.03	-1.97	-1.03	293.01	111.26	2.51
1415.00	38.680	-0.99	-1.96	-0.99	298.36	110.35	2.47
1430.00	38.800	-0.96	-1.95	-0.96	303.63	109.18	2.42
1445.00	38.910	-0.93	-1.95	-0.93	308.79	107.73	2.38
1460.00	39.000	-0.90	-1.94	-0.90	313.84	106.02	2.34
1475.00	39.090	-0.86	-1.94	-0.86	319.76	105.04	2.30
1490.00	39.170	-0.83	-1.94	-0.83	325.52	101.81	2.27
1505.00	39.230	-0.80	-1.93	-0.80	328.12	99.32	2.23
1520.00	39.290	-0.77	-1.93	-0.77	332.54	96.59	2.20
1535.00	39.340	-0.75	-1.93	-0.75	336.77	93.63	2.17
1550.00	39.380	-0.72	-1.94	-0.72	340.78	90.44	2.14
1565.00	39.400	-0.69	-1.94	-0.69	344.57	87.03	2.11
1580.00	39.420	-0.66	-1.94	-0.66	348.12	83.42	2.09
1595.00	39.430	-0.64	-1.95	-0.64	351.41	79.62	2.07
1610.00	39.420	-0.61	-1.95	-0.61	354.44	75.65	2.05
1625.00	39.410	-0.59	-1.96	-0.59	357.18	71.52	2.03
1640.00	39.390	-0.56	-1.97	-0.56	359.64	67.26	2.01
1655.00	39.360	-0.54	-1.98	-0.54	361.81	62.86	2.00
1670.00	39.320	-0.52	-1.99	-0.52	363.66	58.37	1.98
1685.00	39.270	-0.49	-2.00	-0.49	365.21	53.79	1.97
1700.00	39.210	-0.47	-2.01	-0.47	366.44	49.14	1.96
1715.00	39.140	-0.45	-2.03	-0.45	367.34	44.45	1.96
1730.00	39.060	-0.43	-2.04	-0.43	367.93	39.73	1.95
1745.00	38.970	-0.41	-2.06	-0.41	368.19	35.01	1.95
1760.00	38.870	-0.39	-2.08	-0.39	368.13	30.31	1.95
1775.00	38.760	-0.37	-2.09	-0.37	367.75	25.64	1.95

