




wound' (no twist on the bobbin), this was important for the winding process. When winding the coil each one was tested after completion both for short circuit to the body and for internal, wind to wind shorting. Once all of the coils were wound and secured the complete assembly was then electrically tested and only when all tests were satisfied did we proceed with the next stage.

The 24 coils are wired in three phases, A B & C and alternate in a repeating pattern. Each coil in a phase is connected in series with one end connected to a power lead and the other connected to a common star point. The coils are powered in pairs by the controller and the sequence produced creates the required motion of the target shaft. To ensure that the coils are wired correctly, printed circuit boards were produced at Imperial College HEP electronics lab (see *Fig.x*). These were attached to the bobbin and the coils and power leads plus a lead to the star connector (to allow individual coils to be powered in isolation) soldered to them. The thermocouple devices were also bonded to the bobbin. Once more electrical tests were carried out.

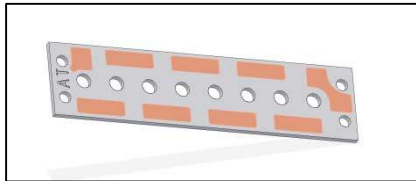

The next step was to fit the cooling jacket, this consisted of 3 segments which were fitted around the bobbin and then plumbed together in series to allow one input and one output from the stator assembly. These segments were manufactured from copper and care was needed when fitting them that they did not damage the coil insulation. Once the cooling jacket was fitted a potting jig was used to allow the complete assembly to be potted under vacuum in such a way as to allow it to fit inside the target body. The potting not only ensured that the stator was robust but it also improved the heat path to the cooling jacket and it provided a further electrical insulation barrier.

Once potted the stator assembly was mounted inside the target body, the body had been pre-machined to hold the stator assembly in place without axial movement as the assembly was then Electron beam welded to ensure its vacuum seal for the ISIS beam line. The welding and vacuum testing took place at Electron Beam Services Ltd Hemel Hempstead. Once the assembly was completed it was taken to Daresbury Laboratory for field mapping , see section 2.3